



AD-A143 375 BEAVER BROOK KEENE NEW HAMPSHIRE FLOOD DAMAGE REDUCTION 1/2
PROJECT SUPPORTING (U) CORPS OF ENGINEERS WALTHAM MA
NEW ENGLAND DIV FEB 84

UNCLASSIFIED

F/G 13/2 NI

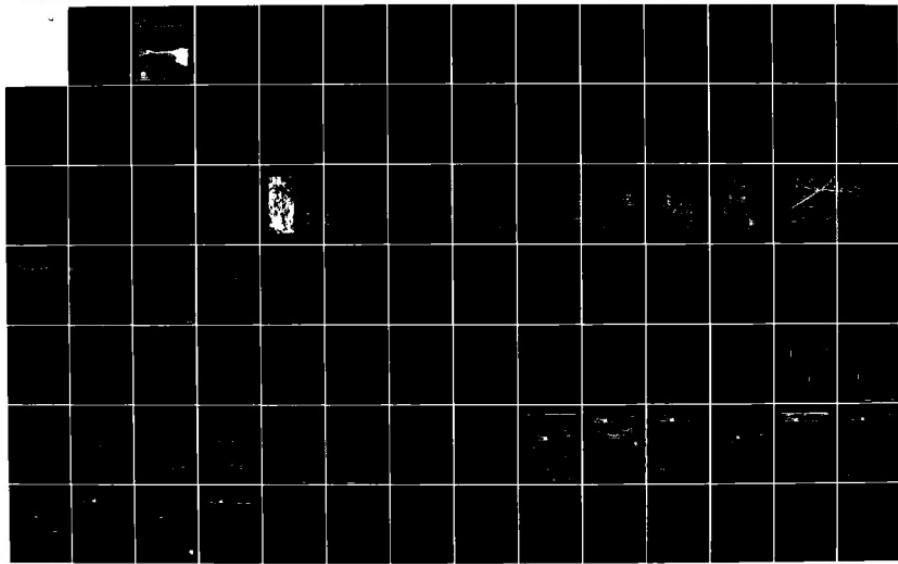

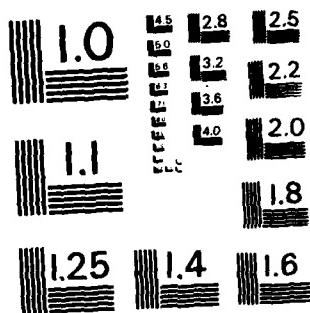

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS - 1963 - A

Detailed Project Report
Beaver Brook, Keene, New Hampshire

(6)

Supporting Documentation

Flood Damage Reduction

AD-A143 375


DTIC FILE COPY



FEBRUARY 1984



**US Army Corps
of Engineers**
Keene, New Hampshire

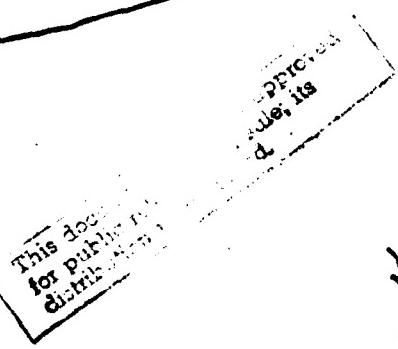

84 07 25 017

SECURITY CLASSIFICATION OF THIS PAGE (When Data Known)

REPORT DOCUMENTATION PAGE		READ INSTRUCTIONS BEFORE COMPLETING FORM
1. REPORT NUMBER	2. GOVT ACCESSION NO.	3. RECIPIENT'S CATALOG NUMBER
4. TITLE (and Subtitle) Flood Damage Reduction Beaver Brook Keene, New Hampshire; Supporting Documentation		5. TYPE OF REPORT & PERIOD COVERED Detailed Project Report
7. AUTHOR(s) U.S. Army Corps of Engineers New England Division		6. PERFORMING ORG. REPORT NUMBER
9. PERFORMING ORGANIZATION NAME AND ADDRESS		10. PROGRAM ELEMENT, PROJECT, TASK AREA & WORK UNIT NUMBERS
11. CONTROLLING OFFICE NAME AND ADDRESS Dept. of the Army, Corps of Engineers New England Division, NEDPL-S 424 Trapelo Rd, Waltham, Mass. 02254		12. REPORT DATE February 1984
14. MONITORING AGENCY NAME & ADDRESS (if different from Controlling Office)		13. NUMBER OF PAGES 123
16. DISTRIBUTION STATEMENT (of this Report)		15. SECURITY CLASS. (of this report) Unclassified
17. DISTRIBUTION STATEMENT (of the above or entered in Block 20, if different from Report)		18a. DECLASSIFICATION/DOWNGRADING SCHEDULE
18. SUPPLEMENTARY NOTES 2 volume set vol 1-Flood Damage Reduction - vol.2. Flood Damage Reduction-Supporting Documentation.		
19. KEY WORDS (Continue on reverse side if necessary and identify by block number) Floods Flood Control Floodways Channel Improvement		
20. ABSTRACT (Continue on reverse side if necessary and identify by block number) Report contains fine appendixes Section A- Hydrologic Analysis B- Geotechnical and Design Considerations C- Economic Analysis D- Archaeological Reconnaissance Report E- Real Estate		

FLOOD DAMAGE REDUCTION

BEAVER BROOK

KEENE, NEW HAMPSHIRE

SUPPORTING DOCUMENTATION
FOR
DETAILED PROJECT REPORT

Accession For	
NTIS GRA&I	<input type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A1	



DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
WALTHAM, MASSACHUSETTS 02264

PERIODIC 1964

TABLE OF CONTENTS

<u>SECTION</u>		<u>PAGE NO.</u>
A	Hydrologic Analysis	A-1
B	Geotechnical and Design Considerations	B-1
C	Economic Analysis	C-1
D	Archaeological Reconnaissance Report	D-1
E	Real Estate	E-1

SECTION A

HYDROLOGIC ANALYSIS

BEAVER BROOK FLOOD CONTROL
KEENE, NEW HAMPSHIRE
ASHUELOT RIVER WATERSHED
CONNECTICUT RIVER BASIN

APPENDIX A
HYDROLOGIC ANALYSIS

BY
HYDROLOGIC ENGINEERING SECTION
WATER CONTROL BRANCH
ENGINEERING DIVISION

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION CORPS OF ENGINEERS
WALTHAM, MASSACHUSETTS

BEAVER BROOK FLOOD CONTROL
KEENE, NEW HAMPSHIRE

TABLE OF CONTENTS

<u>Paragraph</u>	<u>Subject</u>	<u>Page</u>
1	INTRODUCTION	A-1
	a. Purpose and Scope	A-1
	b. References	A-1
2	WATERSHED DESCRIPTION	A-2
	a. General	A-2
	b. Main tributaries	A-2
	c. Keene Flood Plain	A-2
	d. Beaver Brook	A-2
	e. Existing Flood Control Projects	A-3
3	CLIMATOLOGY	A-3
	a. General	A-3
	b. Temperature	A-4
	c. Precipitation	A-4
	d. Snowfall	A-4
	e. Snow Cover	A-4
4	STREAMFLOW	A-4
5	ANALYSIS OF FLOODS	A-10
	a. General	A-10
	b. September 1938	A-10
	c. October 1959	A-13
	d. Other Floods	A-13
6	FLOOD FREQUENCIES	A-13
7	STANDARD PROJECT FLOOD	A-14
	a. General	A-14
	b. Rainfall	A-14
	c. Unit Hydrographs	A-14
	d. Standard Project Discharges	A-15

TABLE OF CONTENTS (cont.)

<u>Paragraph</u>	<u>Subject</u>	<u>Page</u>
8	FLOOD PROFILES	A-15
9	PLANS OF IMPROVEMENTS	A-15
	a. General	A-15
	b. Channel Improvement	A-15
	c. Three Mile Swamp Storage	A-17
	(1) General	A-17
	(2) Dam Modifications	A-17
	(3) Flood Discharge Reductions	A-17
	(4) Design Flood	A-18
	(5) Guide Taking Elevation	A-18

LIST OF TABLES

<u>Table</u>	<u>Title</u>	<u>Page</u>
I	Three Mile Swamp - Pertinent Data	A-3
II	Monthly Temperatures at Keene, NH	A-5
III	Monthly Precipitation at Keene, NH	A-6
IV	Mean Monthly Snowfall at Keene, NH	A-7
V	Water Equivalent of Snow Cover, Ashuelot River Watershed	A-8
VI	Monthly Runoff, South Branch Ashuelot River at Webb, NH	A-8
VII	Peak Discharges, South Branch Ashuelot River and Beaver Brook	A-9
VIII	September 1938 Storm Rainfall	A-11
IX	One-Half Hour Unit Hydrographs - Pertinent Data	A-12
X	Standard Project Storm Rainfall	A-16
XI	Beaver Brook Three Mile Swamp - Flood Data	A-18

LIST OF PLATES

<u>Plate</u>	<u>Title</u>
A-1	Ashuelot River Watershed Map
A-2	Beaver Brook Basin Map and Profile
A-3	Analysis of Floods - September 1938 and October 1959
A-4	Analysis of Floods - SPF, 100-year and 10-year
A-5	Discharge Frequency South Branch Ashuelot and Beaver Brook
A-6	Beaver Brook Discharge Frequencies - Existing and Modified by Three Mile Swamp Storage
A-7	Beaver Brook Plan - Existing and Modified Profiles
A-8	Three Mile Swamp - Plan, Profile and Capacity Curves
A-9	Stage Frequency Curves - Natural and Modified

BEAVER BROOK FLOOD CONTROL
KEENE, NEW HAMPSHIRE

HYDROLOGIC ANALYSIS

1. INTRODUCTION

a. Purpose and Scope. This report presents hydrologic information and analysis relative to flood problems on Beaver Brook located in the Ashuelot River watershed in Keene, New Hampshire. The study was performed under authority contained in Section 205 of the 1948 Flood Control Act and analysis was directed specifically to flooding on Beaver Brook in the reach approximately 1,800 feet in length between Marlboro and Water Streets. Also investigated were modifications to the outlet of the upstream "Three Mile Swamp" for purposes of increased flood control storage. Included are sections on watershed description, general climatology, flood history and frequencies, standard project flood, flood profiles, and plans of improvement. Beaver Brook flooding has been the subject of several past studies. Earlier studies by the Corps of Engineers lead to Congressional authorization in 1968 of "Beaver Brook Lake", a multipurpose water supply and flood control dam and reservoir. However, due to escalating costs and lack of local support the project was not constructed. Current studies reported herein, dealt with the hydrologic analysis of selected small scale structural improvements for inclusion, if feasible, in a primarily nonstructural flood control plan for the city of Keene. The token improvements analyzed were identified in a nonstructural flood damage reduction report completed in 1980 for the city of Keene.

b. References. Some earlier reports dealing with flood problems and hydrology of Beaver Brook are as follows:

- (1) "Report on Drainage in the Beaver Brook Area", Dec. 1962, by Camp, Dresser and McKee Engrs. for the city of Keene.
- (2) "Beaver Brook Dam and Reservoir, Interim Report on Review of Survey", July 1965, Revised December 1966, by New England Division, Corps of Engineers.
- (3) "Channel Improvements for Beaver Brook from Beaver Street to Baker Street", Dec. 1967, by Camp, Dresser and McKee Engrs. for city of Keene.
- (4) Beaver Brook Lake, Design Memo, No. 1, "Hydrology", March 1972, by New England Division, Corps of Engineers.
- (5) "Beaver Brook Improvements - Harrison Street to Baker Street", May 1975 by Whitman and Howard Engrs. for city of Keene.

- (6) "Flood Plain Management Study, Keene, New Hampshire" December 1978, by Anderson-Nichols Engrs. for New England Division, Corps of Engineers.
- (7) "Keene, New Hampshire - Formulation, Assessment and Evaluation of Nonstructural Flood Damage Reduction Techniques", May 1980, by Resource Analysis Engrs. for New England Division, Corps of Engineers.

2. WATERSHED DESCRIPTION

a. General. The city of Keene is at approximately $42^{\circ} 56'$ north latitude and $72^{\circ} 01'$ west longitude in the southwest corner of the State of New Hampshire and is located on the Ashuelot River about 27 miles above its confluence with the Connecticut River near Hinsdale. The Ashuelot River drains an area of 421 square miles and the watershed (shown on plate 1) is generally hilly with low mountains in the headwaters.

b. Main tributaries. The two main tributaries of the Ashuelot River are the Branch and the South Branch. The Branch, entering the Ashuelot just below Keene, New Hampshire, about 26.5 miles upstream from the mouth, is formed by the confluence of Minnewawa and Otter Brooks. The South Branch joins the Ashuelot just above Swanzy Station, or about 23.5 miles upstream from the mouth.

c. Keene flood plain. The reach of the Ashuelot River between the Faulkner and Colony Company Dam in Keene and the Dickinson Dam in West Swanzy is referred to as the Keene flood plain. This reach is the principal flood damage area in the Ashuelot basin. The meandering river channel in the flood plain has low discharge capacity due to its small cross sectional area and flat gradient, with the result that floodwaters cause considerable depth of pondage. About 75 percent of the Ashuelot River drainage area empties into this reach of the river.

d. Beaver Brook. Beaver Brook, with a drainage area of about 10 square miles, flows southward through the city of Keene, joining the Branch near its mouth in the Keene flood plain. The watershed is rectangular in shape with a length of about 7 miles and a width of about 1.5 miles. It has basically a single stream pattern with short side tributaries and steep slopes. Although Beaver Brook has a total fall of over 700 feet in about 8 miles of length, the lower 2 miles in the city of Keene and that portion in the vicinity of the "Three Mile Swamp" are relatively flat as indicated by the profile shown on plate 2. The Beaver Brook watershed is hydrologically flashy due to the mountainous headwater terrain.

A multipurpose water supply and flood control reservoir, "Beaver Brook Lake", was authorized for construction by the Flood Control Act of 13 August 1968. However, due to escalating cost and lack of local support the project

was not constructed. "Three Mile Swamp", a natural swamp partially controlled by a low rock dam, is located within the originally authorized reservoir area. Pertinent data on the Three Mile Swamp is listed in Table I.

TABLE I

THREE MILE SWAMP
PERTINENT DATA

Drainage Area (square miles)	6.0
Dam Elevation Approximate (feet NGVD)	790
Outlet Elevation Approximate (feet NGVD)	787
Dam Height Approximate (feet)	5
Dam Length (feet)	220
Swamp Area Approximate (acres)	70

e. Existing Flood Control Projects. Surry Mountain and Otter Brook Lakes are two Corps of Engineers flood control projects located in the Ashuelot River watershed.

Surry Mountain Dam, completed in 1942, is located in the town of Surry on the Ashuelot River about 6 miles upstream of the Faulkner and Colony Dams. It controls a drainage area of 100 square miles, with the reservoir containing a flood control storage equivalent to 5.9 inches of runoff.

Otter Brook Dam, completed in 1958, is in the city of Keene on Otter Brook about 5 miles upstream of the confluence of the Branch and the Ashuelot River. It controls a drainage area of 47 square miles and has storage equivalent to 7.0 inches of runoff.

3. CLIMATOLOGY

a. General. The Beaver Brook watershed has a variable climate characterized by frequent but generally short periods of heavy precipitation. Some intense rainfalls are produced by local thunderstorms and others by larger weather systems of tropical or extratropical origin moving up the eastern coast. The watershed also lies in the path of prevailing westerlies which traverse the country in an easterly or northeasterly direction producing frequent weather changes. Winters are moderately severe, with subzero temperatures rather common. Spring melting of the winter snow cover generally occurs in late March or April.

b. Temperatures. The mean annual temperature at Keene, New Hampshire is approximately 46° Fahrenheit, with the average monthly temperatures varying from about 70° in July to near 20° in January. Extremes in temperature range from highs slightly in excess of 100°F to lows in the -30 degrees. Table II summarizes mean, maximum and minimum monthly temperatures recorded at Keene, New Hampshire for 94 years of record through 1980.

c. Precipitation. The mean annual precipitation at Keene is 38.9 inches, with the greatest annual precipitation of 52.7 inches recorded in 1975 and the least was 27.1 inches recorded in 1894. Table III summarizes the precipitation at Keene for an 89 year period through 1980.

d. Snowfall. The mean annual snowfall at Keene is about 64 inches. Table IV lists mean monthly values, based on 88 years of record through 1980.

e. Snow Cover. Snow surveys have been taken in the Ashuelot River watershed since December 1948. These surveys indicate that the water equivalent of the snow cover reaches its average maximum of 4.7 inches about mid-March. Some mean, maximum and minimum water equivalents of snow cover in the Ashuelot basin for the later winter months are listed in table V.

4. STREAMFLOW

The US Geological Survey has published records of streamflows at 5 locations in the Ashuelot River watershed; however, there are no gaging stations on Beaver Brook. The two nearest gages recording runoff from uncontrolled areas are the South Branch Ashuelot River at Webb, New Hampshire (D.A. 36 square miles) and the Ashuelot River near Gilsum, New Hampshire (D.A. 71.1 square miles). After analyzing the physical characteristics of the drainage areas above these two gages, it was determined that the runoff character of the South Branch Ashuelot was probably most similar to that of Beaver Brook. Mean, maximum and minimum runoff values in cfs and inches for 58 years of record at South Branch are listed in table VI. The mean annual runoff is about 58 percent of the mean annual precipitation.

Peak flows for each water year of record, on the South Branch and estimate peak flows experienced on Beaver Brook are listed in table VII. Flows on Beaver Brook were estimated from high watermark information and developed stage discharge relations. Peak flow rates were also compared with rainfall-runoff computations and recorded runoff rates from other watersheds in the region.

TABLE II
MONTHLY TEMPERATURES
KEENE, NEW HAMPSHIRE
(94 Years of Record Through 1980)

<u>Month</u>	<u>Mean</u> <u>(°F.)</u>	<u>Maximum</u> <u>(°F.)</u>	<u>Minimum</u> <u>(°F.)</u>
January	21.3	66	-32
February	22.5	65	-21
March	32.9	85	-21
April	44.6	91	1
May	56.0	95	21
June	64.7	98	27
July	69.5	104	34
August	67.3	102	27
September	60.0	101	19
October	49.3	90	10
November	37.7	80	-15
December	25.5	64	-29
Annual	45.9	104	-32

TABLE III
MONTHLY PRECIPITATION
KEENE, NEW HAMPSHIRE
(89 Years of Record Through 1980)

<u>Month</u>	<u>Mean</u> (inches)	<u>Maximum</u> (inches)	<u>Minimum</u> (inches)
January	2.96	9.24	0.76
February	2.62	7.02	0.57
March	3.20	7.60	0.40
April	3.15	6.65	0.35
May	3.35	7.02	0.79
June	3.46	7.73	0.41
July	3.72	11.09	1.07
August	3.62	8.96	1.05
September	3.53	10.39	0.20
October	2.84	7.84	0.23
November	3.33	7.67	0.52
December	3.16	8.86	0.51
Annual	38.9	52.7	27.1

TABLE IV
MEAN MONTHLY SNOWFALL
KEENE, NEW HAMPSHIRE
(88 Years of Record Through 1980)

<u>Month</u>	<u>Snowfall</u> (inches)
January	16.4
February	16.3
March	11.4
April	3.2
May	0
June	0
July	0
August	0
September	0
October	.1
November	3.7
December	13.2
Annual	64.3

TABLE V
WATER EQUIVALENT OF SNOW COVER
ASHUELOT RIVER WATERSHED
(December 1948-April 1981)

<u>Date</u>	<u>Minimum</u>	<u>Mean</u>	<u>Maximum</u>
1 February	0.1	2.9	7.7
15 February	0.0	3.6	8.5
1 March	0.0	4.3	9.6
15 March	0.0	4.7	9.4
1 April	0.0	3.3	8.9
15 April	0.0	1.2	6.5

TABLE VI
MONTHLY RUNOFF
SOUTH BRANCH ASHUELOT RIVER
AT WEBB, NEW HAMPSHIRE
(D.A. = 36 square miles)
(58 Years of Record Through 1978)

<u>Month</u>	<u>Average</u>			<u>Maximum</u>		
	<u>CFS</u>	<u>Inches</u>		<u>CFS</u>	<u>Inches</u>	<u>CFS</u>
January	56.6	1.81		161	5.16	6.4
February	49.8	1.45		153	4.60	9.3
March	112	3.58		366	11.73	23.1
April	174	5.39		356	11.05	64.4
May	81.1	2.60		186	5.97	26.6
June	44.1	1.37		151	4.69	7.0
July	23.0	0.73		102	3.25	3.0
August	17.0	0.54		131	4.21	2.7
September	22.1	0.69		252	7.81	2.6
October	25.9	0.83		133	4.26	2.9
November	52.4	1.62		244	7.55	3.7
December	59.9	1.92		178	5.70	9.5
Annual	59.7	22.5		105	39.9	17.3
						6.5

TABLE VII
ANNUAL PEAK DISCHARGES

<u>Water Year</u>	<u>South Branch Ashuelot at Webb, N.H.</u> (D.A. = 36.0 sq. mi.)	<u>Beaver Brook Keene, N.H.</u> (D.A. = 9.0 sq. mi.)
1921	1560 cfs	
1922	1160	
1923	1400	
1924	1220	
1925	1680	
1926	630	
1927	575	
1928	3560	
1929	1010	
1930	535	
1931	660	
1932	1150	
1933	879	
1934	1300	
1935	619	
1936	3880	900 (March 36)
1937	628	
1938	5960	2000 (Sept 38)
1939	580	
1940	1910	
1941	370	
1942	1780	
1943	476	
1944	1470	
1945	725	
1946	1020	
1947	485	
1948	1070	
1949	660	
1950	615	500 (Nov 50)
1951	2010	
1952	822	
1953	875	
1954	806	
1955	511	
1956	1700	
1957	475	
1958	766	
1959	2070	
1960	4350	1100 (Oct 59)(600 (Apr 60))
1961	445	
1962	878	
1963	758	
1964	552	
1965	325	
1966	828	
1967	750	
1968	1260	
1969	1030	
1970	983	
1971	545	
1972	681	
1973	1210	900 (Dec 73)
1974	2520	
1975	1870	
1976	1110	
1977	2010	
1978	1900	
Mean Log Standard Deviation	• 3.0077 • 0.2732	

5. ANALYSIS OF FLOODS

a. General. Flooding on Beaver Brook has been a recurring problem since the earliest times. Some of the more damaging floods in this century occurred in November 1927, April 1934, March 1936, September 1938, November 1950, October 1959, April 1960 and December 1973. The greatest flood occurred in September 1938 and this event together with the lesser flood of October 1959 was analyzed in developing rainfall-runoff relationships for the stream.

From previous studies it was determined that the lower portion of Beaver Brook is in the flood plain of the Ashuelot River. This flood plain is a large storage reach with its outlet at the dam on the Ashuelot River in West Swanzey. With moderate floods, Beaver Brook stages are a function of the discharge on Beaver Brook. With greater floods the Keene flood plain storage increasingly fills, eventually causing a backwater effect on the lower end of Beaver Brook. The stages on Beaver Brook lower reach then become a function of both the flow in the brook and the co-incident level of the flood plain.

b. September 1938. This flood-producing storm was the result of a stationary cold front along the Atlantic coast overrun by a rapidly moving tropical hurricane, producing record breaking rainfall over large areas of Connecticut, Massachusetts, and New Hampshire. The storm which started with light rain, gradually increased in intensity over the 4-day period (17-21 September). The total rainfall was over 10 inches in the Keene area with a resulting runoff in the area of about 6 inches. Three hour rainfall amounts in the Keene area and runoff amounts as determined by analysis of the South Branch are listed in table VIII. The peak discharge at the South Branch gage during this flood was the maximum recorded to date. The peak discharge on the South Branch (D.A. = 36 square miles) was 5,960 cfs. The 1938 flow on Beaver Brook (D.A. = 10 square miles) was estimated to have been about 2,000 cfs.

The 1938 flood on Beaver Brook was modeled using the Hydrologic Computer Program HEC-1. One-half hour unit graphs were developed for the Three Mile Swamp watershed (6.0 square miles) and the intervening local area (3.0 square miles) to Marlboro Street. Unit graph characteristics were determined using adopted Snyder's coefficients. Pertinent characteristics of the adopted one-half hour unit graphs are listed in table IX. The computer model was tested by applying 1938 excess rainfall and determining the degree to which the experienced peak flows could be reproduced. Once calibrated, the model was used to compute a range of storm runoff hydrographs. Analyses of the 1938 and 100-year synthetic flood are graphically illustrated on plates 3 and 4. Storage-discharge characteristics of Three Mile Swamp were determined from photogrammetric mapping and surveys of the outlet structure. The swamp outlet is presently a 220-foot long stone weir with a crest

TABLE VIII
SEPTEMBER 1938 STORM RAINFALL*

<u>Time</u> (day)	<u>(hrs)</u>	<u>Rainfall</u> (inches)	<u>Loss</u> (inches)	<u>Excess</u> (inches)
19 Sept	3	0.50	0.50	0
19 Sept	6	0.90	0.30	0.60
19 Sept	9	0.30	0.30	0
19 Sept	12M	0.0	0	0
20 Sept	3	0.55	0.55	0
20 Sept	6	0.40	0.40	0
20 Sept	9	0.25	0.25	0
20 Sept	12N	0.75	0.40	0.35
20 Sept	3	0	0	0
20 Sept	6	0	0	0
20 Sept	9	0	0	0
20 Sept	12M	1.00	0.30	0.70
21 Sept	3	1.70	0.40	1.30
21 Sept	6	1.90	0.40	1.50
21 Sept	9	1.30	0.40	0.90
21 Sept	12N	0	0	0
21 Sept	3	1.40	0.40	1.00
Total		10.95	4.60	6.35

*From "Analysis of Design for West Peterborough Dam", November 1947,
Plate No. IV-11.

TABLE IX
 ONE-HALF HOUR UNIT HYDROGRAPHS
PERTINENT DATA

Subbasins	Drainage Area (sq. mi.)	L (mi \bar{t} es)	L_{ca} (mi \bar{t} es)	Slope (ft/ft)	C_t	$\frac{640}{C_p}$	T_p (hrs)	$\frac{Q_p}{C_p}$
<u>10 Year & Oct. 1959</u>								
Three Mile Swamp	6	4.0	2.0	.019	1.6	190	3	390
Local	3	4.0	2.0	.016	1.6	190	3	195
<u>100 Year & Sept. 1938</u>								
Three Mile Swamp	6	4.0	2.0	.019	1.1	190	2	570
Local	3	4.0	2.0	.016	1.1	190	2	285
<u>SPF</u>								
Three Mile Swamp	6	4.0	2.0	.019	1.1	240	2	710
Local	3	4.0	2.0	.016	1.1	240	2	355

elevation of approximately 790 feet NGVD. This long weir results in large incremental increases in outflow with relatively small incremental increases in surcharge storage, thereby minimizing any flood modifying potential of Three Mile Swamp.

c. October 1959. This flood was the result of about 4 inches of rain in 24 hours, with 1.5 inches occurring in one hour in the Keene area, and producing high rates of runoff particularly on smaller tributary streams such as Beaver Brook.

Both the experienced October 1959 flood and the 10-year frequency storm runoff were analyzed using the HEC-1 computer model with adopted rainfall runoff relationships. Pertinent data of the adopted one-half hour unit graphs are listed in table IX. The October 1959 and 10-year synthetic floods are graphically illustrated on plates 3 and 4.

d. Other Floods. The November 1927 event resulted from 4 to 6 inches of rainfall on ground saturated from excessive rains during the previous month. The April 1934 flood was produced by a combination of heavy rains and considerable snowmelt. The March 1936 event resulted from two major rainstorms totaling 6 inches, combined with heavy snowmelt, causing two major rises in river stages about six days apart. The November 1950 flood resulted from 3 to 4 inches of intense rainfall on previously wet ground. The April 1960 event occurred when 3 to 4 inches of rain fell on snow with a high water content. The December 1973 flood was the result of over 3 inches of rainfall on snow covered ground.

6. FLOOD FREQUENCIES

Peak discharge frequencies for ungaged Beaver Brook were developed utilizing the 58-years of South Branch flow records and computed Beaver Brook flows for selected floods. Flows on Beaver Brook were based on high watermark information and developed stage-discharge relations plus recorded runoff rates from other watersheds in the region. Annual peak discharges for the 58-year period of record on the South Branch plus selected Beaver Brook flood discharges are listed in table VII. Three different procedural approaches, or steps, were taken in developing the adopted frequency curve for Beaver Brook. A frequency curve was first computed for the South Branch and transferred to Beaver Brook using a transfer factor equal to the ratio of drainage areas to the 0.7 power. The curve for the South Branch was computed using a Log Pearson Type III statistical analysis with "expected probability" adjustment. The computed frequency curve for the South Branch, with a drainage area of 36 square miles, had a mean log of 3.008, a standard deviation of 0.2732 and an adopted skew of 0.7. The curve transferred to Beaver Brook (D.A. = 9.0 square miles) had the same standard deviation and skew with an adjusted mean log of 2.588.

Secondly, the limited number of flood discharges for Beaver Brook were assigned Weibull plotting positions based on their relative magnitude and positioning in the 58-year historical South Branch record. These plotted points were then compared with the transferred curve for reasonable ness of fit. There was reasonably good agreement between the plotted data and computed curve.

Lastly, as a further comparative analysis, the 100-year and 10-year storm rainfall excess as determined from US Weather Bureau Technical Paper No. 40, was applied to the developed HEC-1 computer model and the resulting Beaver Brook discharges were checked for relative agreement with the adopted frequency curve. Again there was reasonably good agreement. The developed frequency curves and plotted data are shown on plate 5.

7. STANDARD PROJECT FLOOD

a. General. The Standard Project Flood (SPF) represents the flood discharge that may be expected from the most severe combination of meteorologic and hydrologic conditions that are considered reasonably characteristic of the region, excluding extremely rare combinations. The SPF represents a "Standard" against which the flood potential of a river can be judged, as contrasted to an analysis of flood records which may be misleading due to abnormal sequences of events during the period of record. The SPF for Beaver Brook was developed by applying standard project rainfall to adopted subbasin unit hydrographs and combining and routing the resulting component hydrographs.

b. Rainfall. Standard project storm rainfall was determined in accordance with Civil Engineer Bulletin 52-8 and EM 1110-2-1411. The 24-hour index rainfall for the 9 square mile Beaver Brook watershed was 10.4 inches. Losses were assumed to be .15 inch per 2 hours, resulting in a 24-hour rainfall excess of 8.7 inches. Two hour rainfall values are listed in table X. Rainfall rate was assumed uniform within each 2 hour interval.

c. Unit Hydrographs. The watershed was divided into two subbasins, the area above Three Mile Swamp and the remaining downstream local. Unit hydrographs for the two subbasins were "peaked" 25 percent to reflect the more rapid runoff rates expected under standard project storm conditions. Pertinent data on the adopted SPF unit graphs are listed in table IX.

d. Standard Project Discharges. Rainfall excess was applied to the unit hydrographs and the SPF hydrographs computed using the HEC-1 computer model. The resulting hydrograph for the area above Three Mile Swamp was routed through the swamp by "modified puls" and the computed outflow was combined with the downstream local to produce the total SPF for Beaver Brook.

Development of the SPF for the Beaver Brook watershed is graphically illustrated on plate 4.

8. FLOOD PROFILES

Flood profiles and stage-discharge relationships for Beaver Brook were computed utilizing the backwater computer program, HEC-2, and conventional hydraulic formulae. Backwater computations were made using cross sectional surveys developed by Anderson Nichols Company during the "Keene Flood Plain Management Study". Analysis extended from downstream of Marlboro Street to upstream of Harrison Street. Backwater computations were made for both natural and modified conditions using a Manning's "n" of 0.032 for the channel and ranging from .045 to .06 for overbank flow areas. Assumed contraction and expansion loss coefficients were, respectively, 0.3 and 0.5. A starting stage-discharge relationship was developed downstream of Marlboro Street using backwater data developed in the earlier "Keene Flood Plain Management Study". Computed natural and modified profiles plus established December 1973 high water elevations are shown on plate 7.

9. PLANS OF IMPROVEMENT

a. General. Hydrologic analyses were made of two structural plans of improvement for flood damage reduction on Beaver Brook. One plan increased channel capacity by improving the brook channel and the second reduced floodflows by increasing upstream flood storage. Neither plan provided standard project flood protection but were geared more to providing some flood reduction at least for the more frequent flood events. Any such structural plans of improvement would be considered only as one component in a comprehensive flood control plan including nonstructural flood plain zoning and flood insurance. Analyses were performed to determine the potential magnitude and frequency of flood level reductions for use in determining project feasibility.

b. Channel Improvements. Channel improvements were investigated for the damage reach extending from Marlboro to Water Streets, a total distance of approximately 1,800 feet. Both an 8-foot deep by 20-foot wide rectangular channel (160 square feet) and an equivalent trapezoidal channel were investigated. The improvements would be quite comparable hydraulically, to an improved channel section already built at one location in the reach by the Kingsbury Tool Company. Past improvements to Beaver Brook were generally designed for a flow of about 600 cfs. The improvement would provide some stage reduction for floods in the 10 to 20 year frequency range but would provide negligible reduction for the larger but rarer floods. As stated previously, the lower reach of Beaver Brook is affected by backwater from the Ashuelot "Keene flood plain"; also the gradient of the brook in this reach is extremely flat.

TABLE X
STANDARD PROJECT STORM RAINFALL

<u>Time</u> <u>(hours)</u>	<u>Rainfall</u> <u>(inches)</u>	<u>Loss</u> <u>(inches)</u>	<u>Excess</u> <u>(inches)</u>
2	.1	.1	0
4	.2	.15	.05
6	.3	.15	.15
8	.4	.15	.25
10	1.5	.15	1.35
12	5.4	.15	5.25
14	.9	.15	.75
16	.6	.15	.45
18	.4	.15	.25
20	.3	.15	.15
22	.2	.15	.05
24	.1	.10	0
Total	10.4	1.70	8.70

These two features limit the extent of flood reduction possibilities via channel improvements. Also, any type of channel improvement in this lower reach would have to be continually maintained free of debris and sediment build-up in order to remain effective.

Natural and modified stage frequency curves in the reach were determined by performing backwater computations for a range of flows. The resulting curves are shown on plate 9.

c. Three Mile Swamp Storage.

(1) General. Three Mile Swamp is a natural retention wetland located about 4.5 miles upstream on Beaver Brook. An analysis was made of the outlet structure of this swamp with respect to increasing the flood storage effectiveness of this swamp. Such improvements would not, or should not, be viewed as a flood control dam and reservoir but simply structural modifications to increase the effectiveness of the natural flood retention area.

(2) Dam Modifications. The existing swamp outlet structure is an old stone masonry dam with a 220-foot long stone weir at approximately elevation 790 feet NGVD. This weir results in large incremental increases in outflow with relatively small increases in surcharge storage, thereby minimizing the flood modifying potential of the Three Mile Swamp.

The alternate weir investigated would consist of a stepped weir, thus varying delta storage versus delta flow, i.e., "time of storage", with changing magnitude of flow. The alternate outlet would be a self-regulating structure with an 8-foot width at elevation 787, 50 feet at elevation 792, and 200 feet at elevation 794 feet NGVD. Discharge rating for the weir was computed using a weir coefficient of 3.0. Storage capacity of the swamp was computed by planimetering available 2 foot contour maps, assuming a horizontal swamp profile. Plan and profile of the swamp, in the area of the outlet structure, and outlet rating curves (existing and modified) and area-capacity curves of the swamp are shown on plate 8.

(3) Flood Discharge Reductions. The HEC-1 computer model, previously developed, was used to route a range of floods through Three Mile Swamp using the developed storage data and the revised outlet rating for the swamp.

Plate 3 graphically illustrates the modifying effects of the alternate outlet structure on the September 1938 and October 1959 floods, while plate 4 illustrates the SPF, 100- and 10-year flood analysis. Plate 6 shows the comparative natural and modified discharge frequency curves. The modified curve was determined by analyzing

the above floods for both natural and modified conditions and drawing a representative modified frequency curve.

(4) Design Flood. The modified Three Mile Swamp outlet would in effect be a relatively low (generally less than 10 feet in height) run-of-river type overflow dam. Therefore, due to the relatively low height, the standard project flood was adopted as the spillway design flood and the structure would be designed to safely pass the SPF discharge of 4,300 cfs with a minimum of 2 feet of freeboard. A low dike would be required on the east side of Route 10 to prevent ponding on that highway during flood storage periods. Top elevation of the dike would be 799 feet NGVD providing 2 feet of freeboard above the SPF level of 797 feet NGVD. Local drainage west of the dike would discharge to Beaver Brook downstream of the dam structure. A listing of computed inflows, outflows, and storages in the swamp are presented in table XI.


(5) Guide Taking Elevation. Since the modified outlet structure would cause an increase in the magnitude and frequency of flooding in the swamp, land taking or easements would be required. The recommended guide taking elevation for land taking has been set at elevation 797, standard project flood level, encompassing approximately 120 acres of land. A plan and profile of the Three Mile Swamp area, including flood levels, are shown on plate 8.

TABLE XI
BEAVER BROOK
THREE MILE SWAMP FLOOD DATA

Flood	Natural		Modified		Storage (inches(R.O.))
	Outflow (cfs)	Stage (ft NGVD)	Outflow (cfs)	Stage (ft NGVD)	
Sept 1938	1340	791	1230	795	1.0
Oct 1959	720	790.6	410	793.1	.6
10 Year	680	790.6	370	792.9	.5
100 Year	1730	791.3	1170	794.9	1.0
SPF	4300	792.7	3800	797.0	1.6




WATERSHED

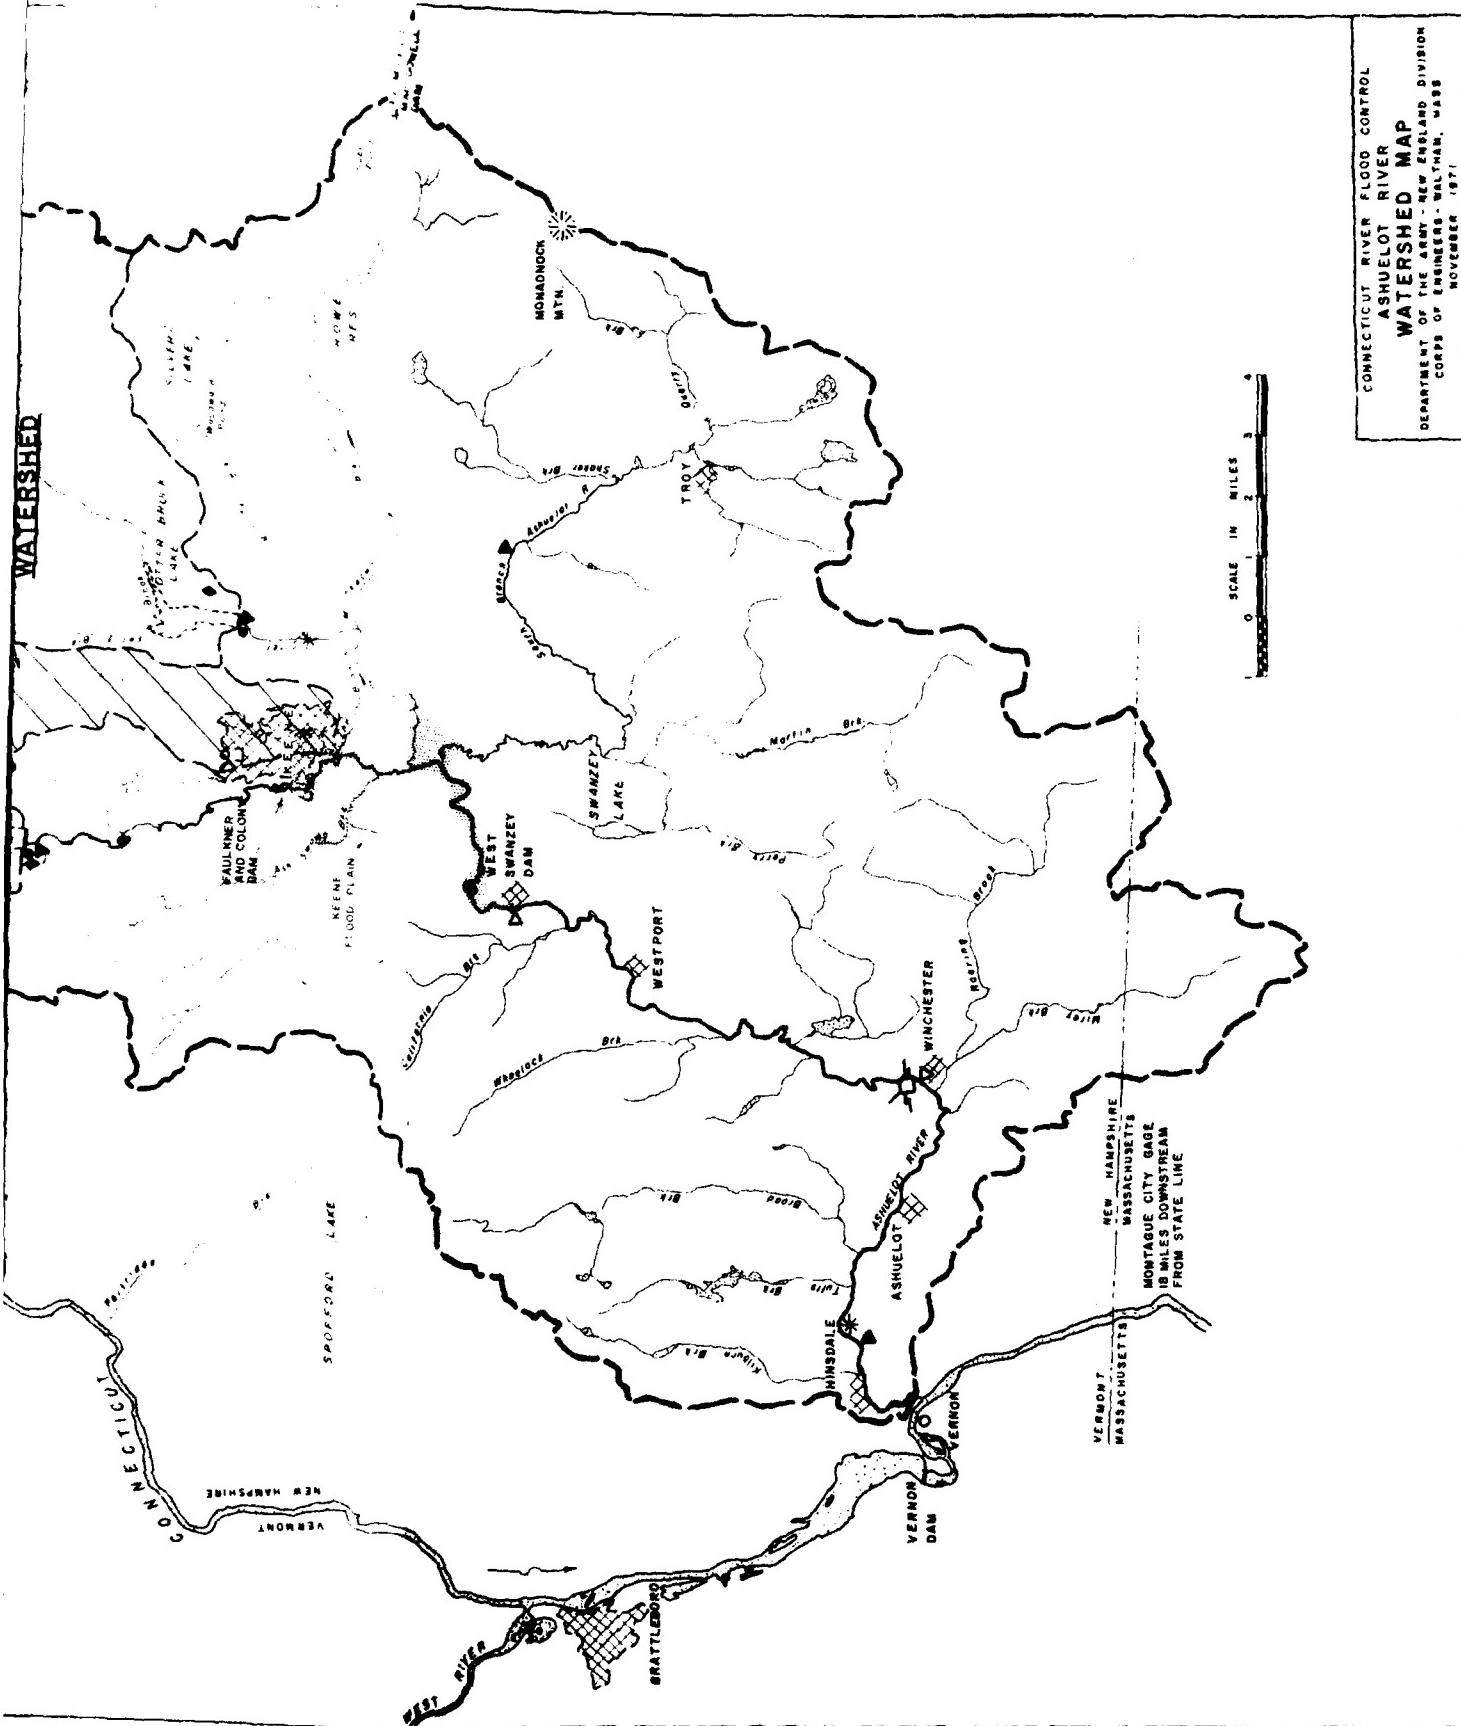


CORPS OF ENGINEERS



PLAN
SCALE: 1" = 2000'
0 2000 2000

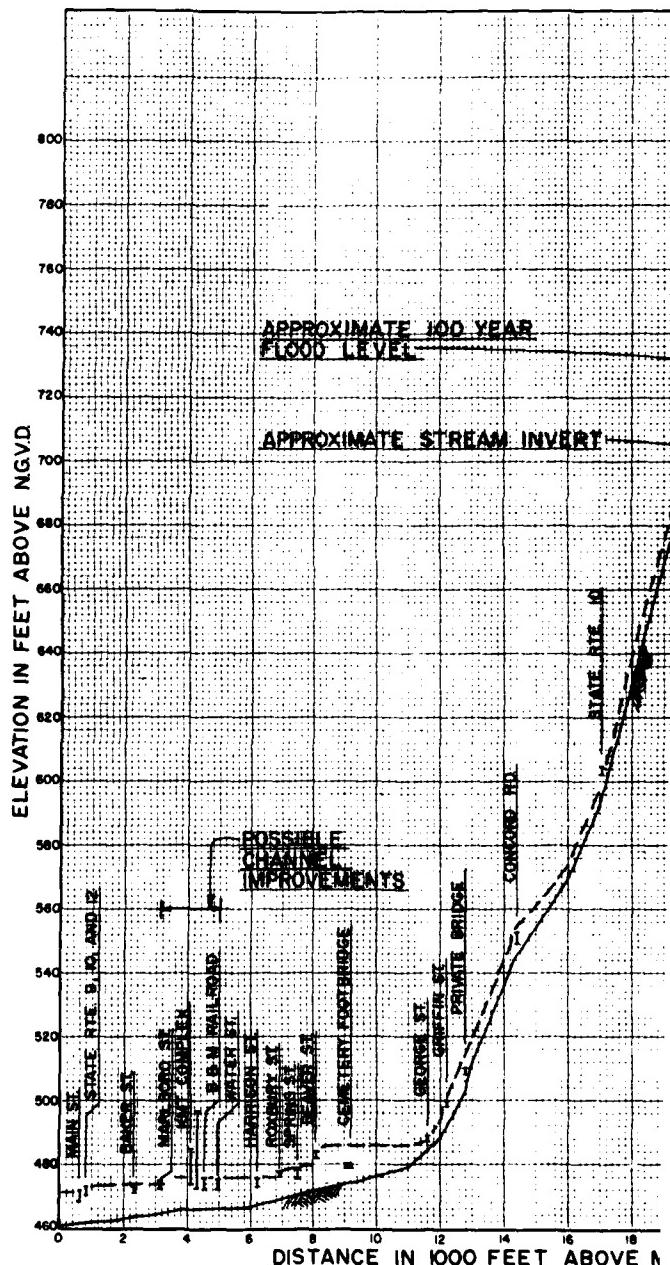

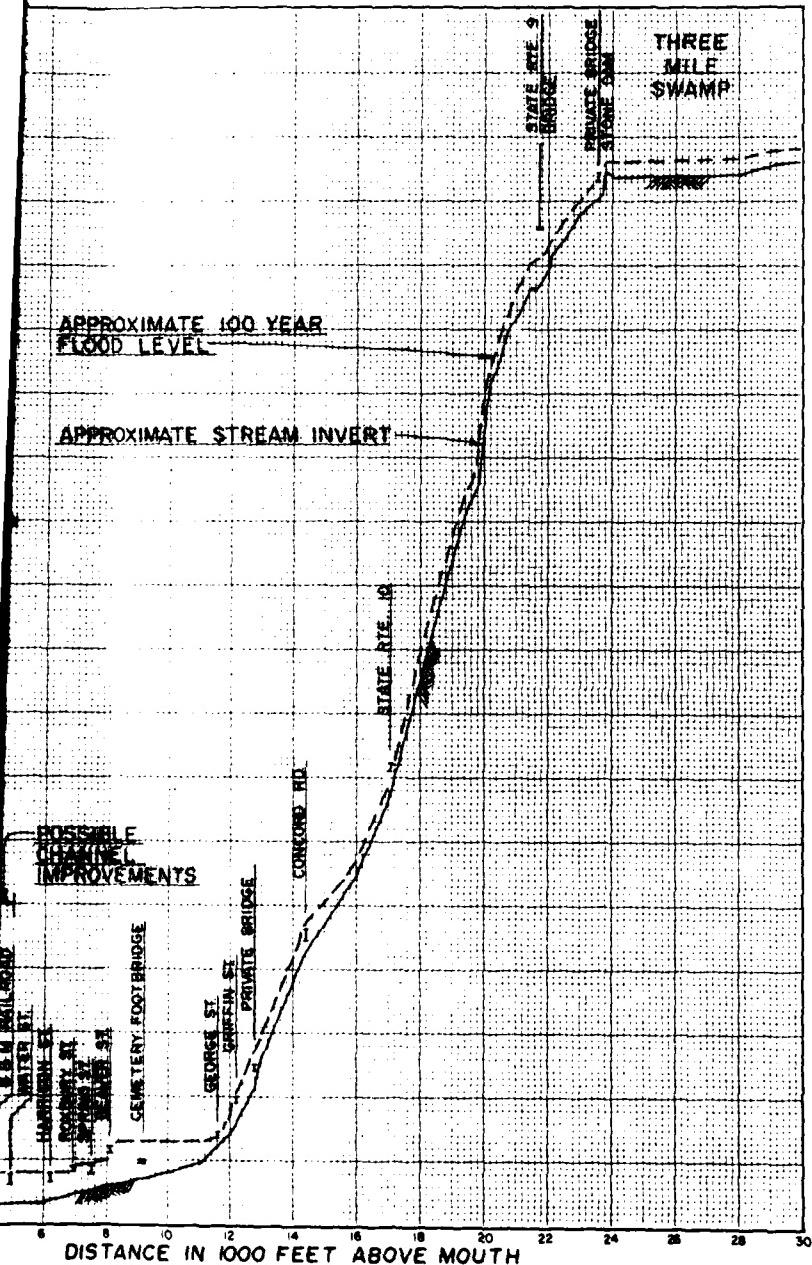

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
CORPS OF ENGINEERS
WATKINS, MASS.







ASHUELOT RIVER BASIN
BEAVER BROOK KEENE, N.H.
BEAVER BROOK WATERSHED MAP AND
PROFILE




HYDRO ENG SECT

FEB 1963

PLATE A-2

2

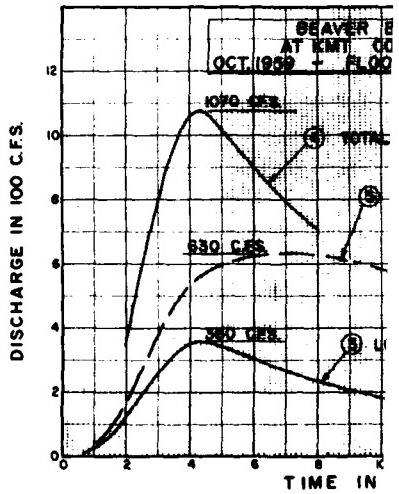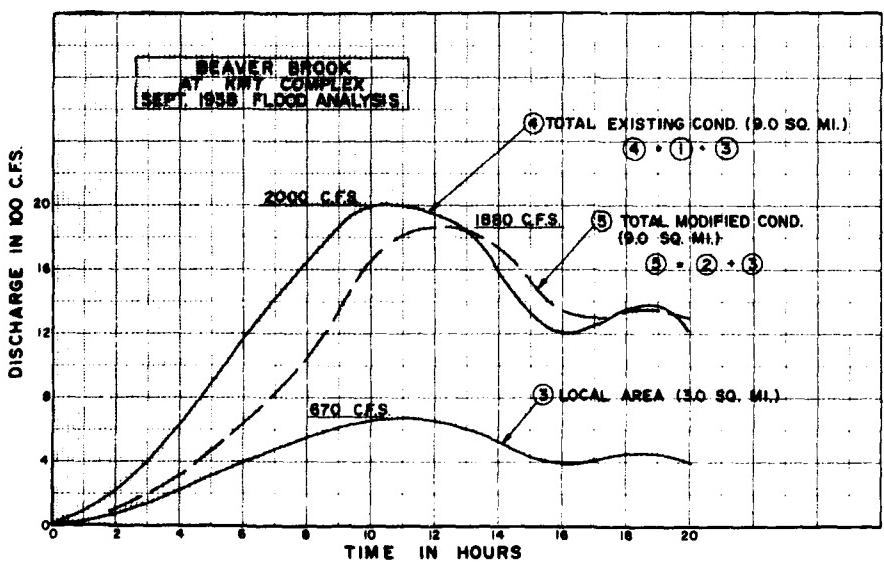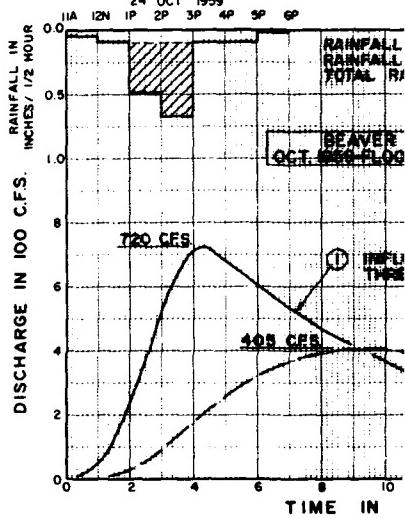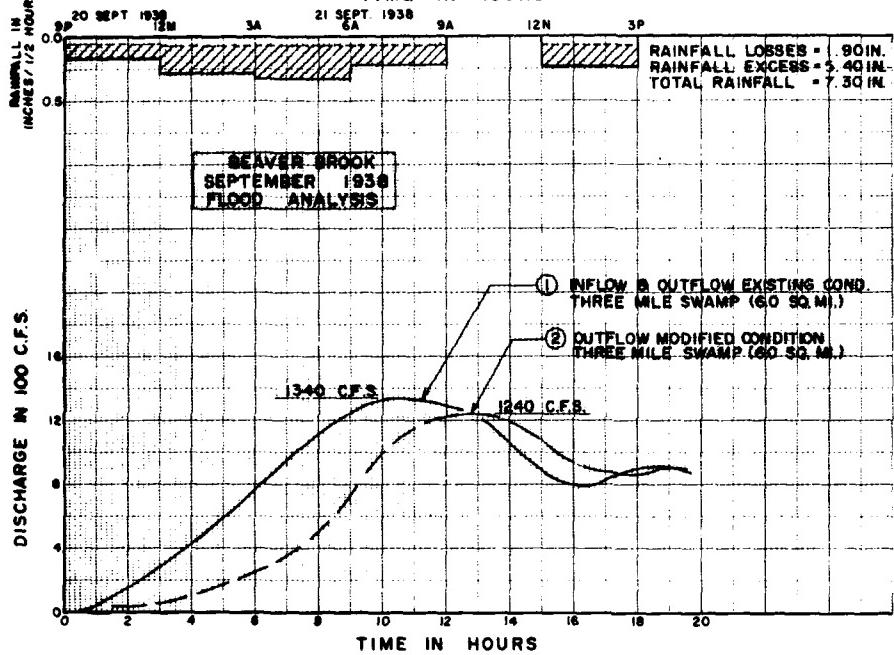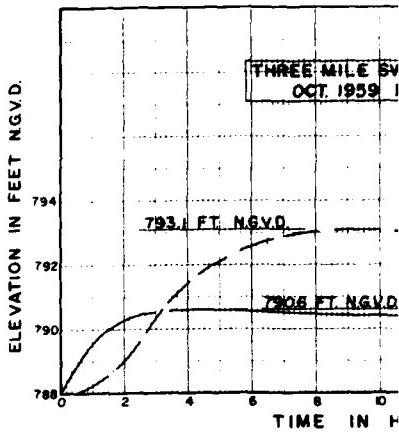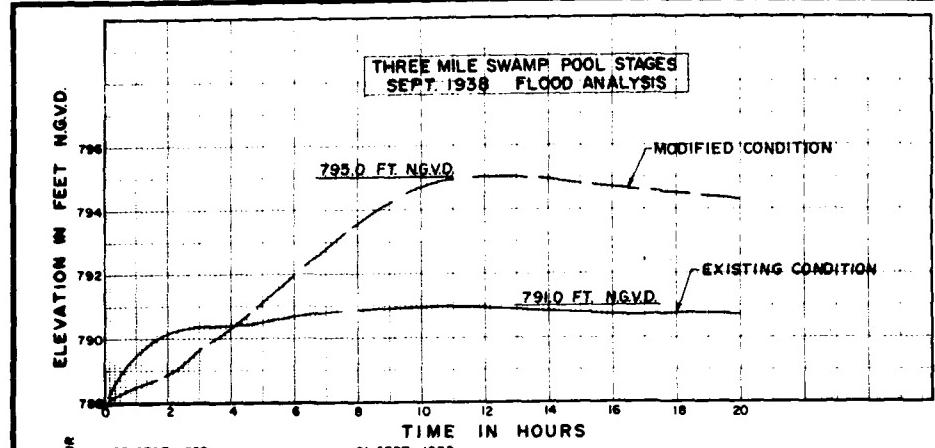

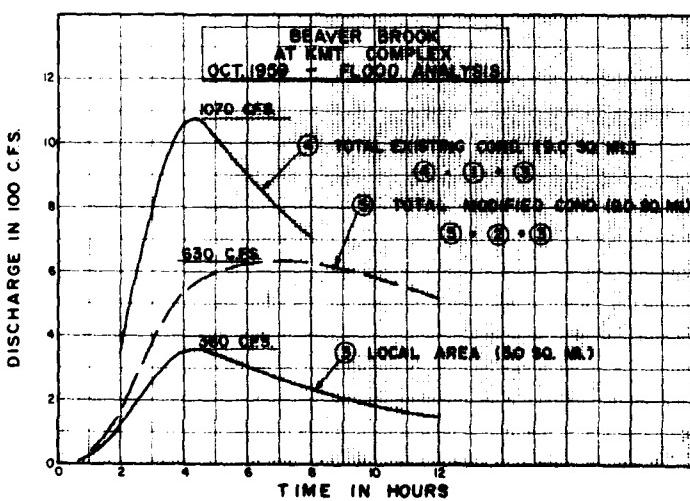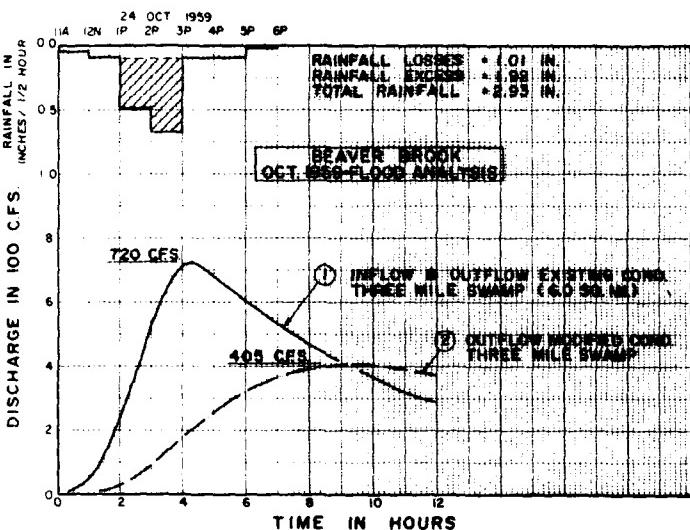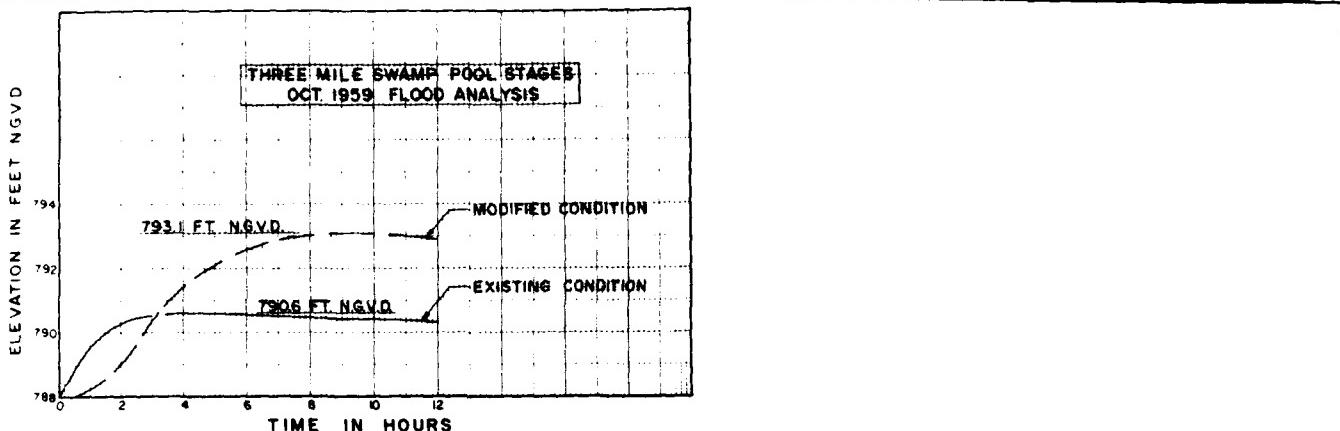







NOTES:
MINIMUM INVERT OF EXISTING AND MODIFIED
OUTLET OF THREE MILE SWAMP AT
ELEVATION 787 FT. N.G.V.D.

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
COMPT. OF ENGINEERS
WALTHAM, MASS.


ASHUELOT RIVER BASIN
BEAVER BROOK - KEENE, NH.
ANALYSIS OF FLOODS
SEPT. 1938 & OCT. 1959
HYDRO. ENG. SECT. FEB. 1963

PLATE A-3


2

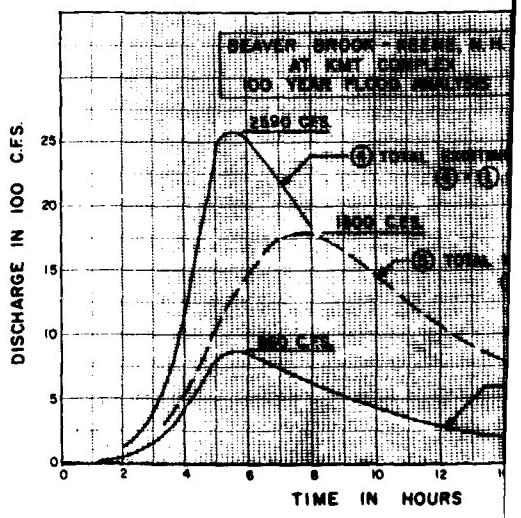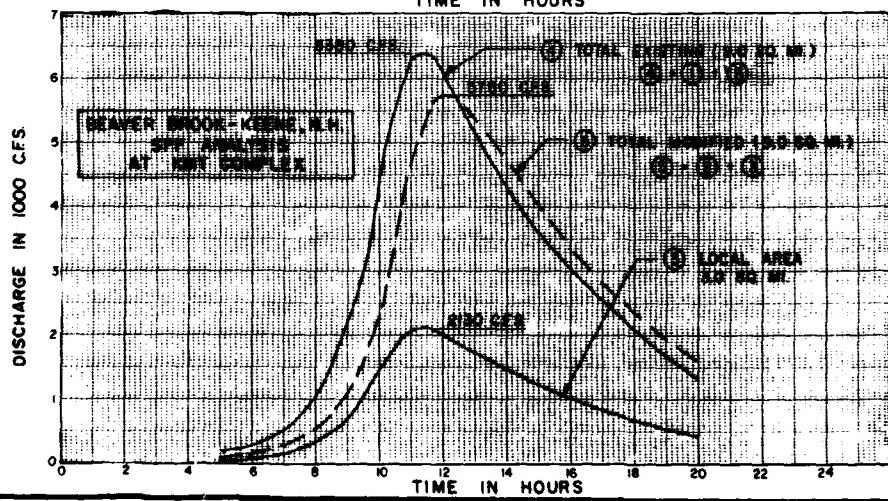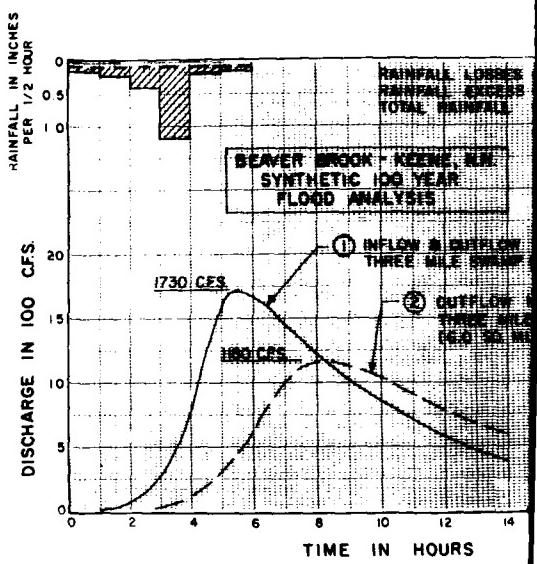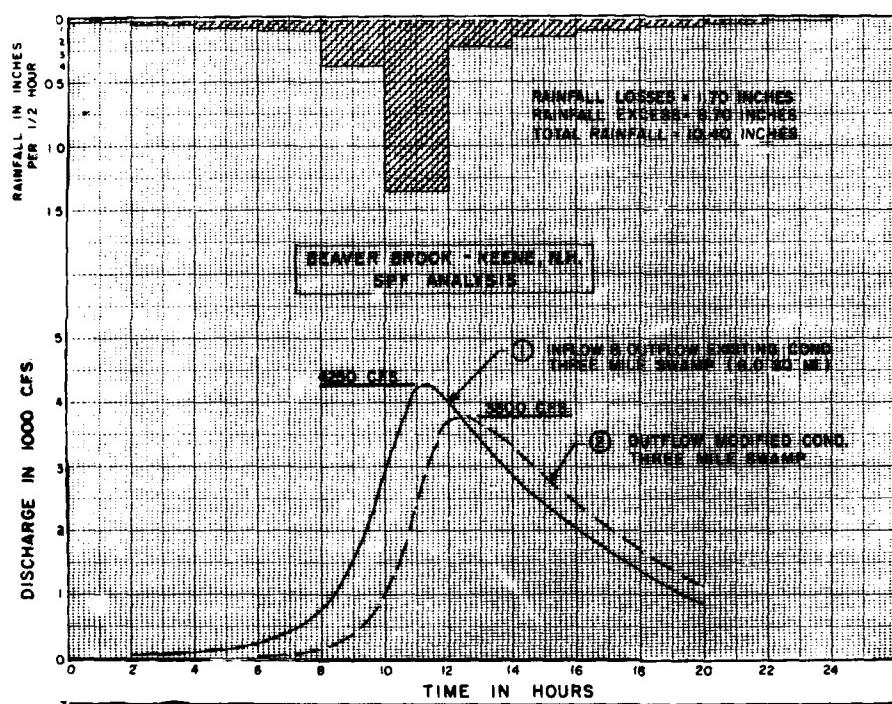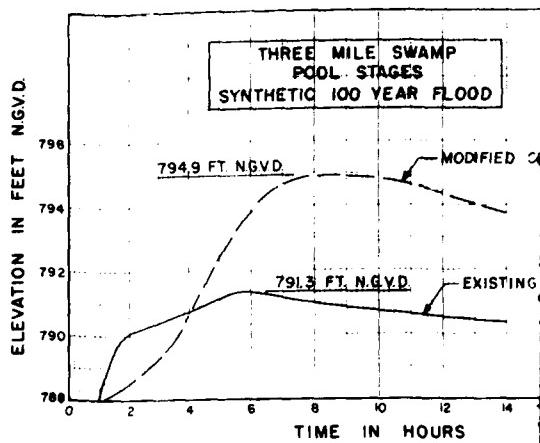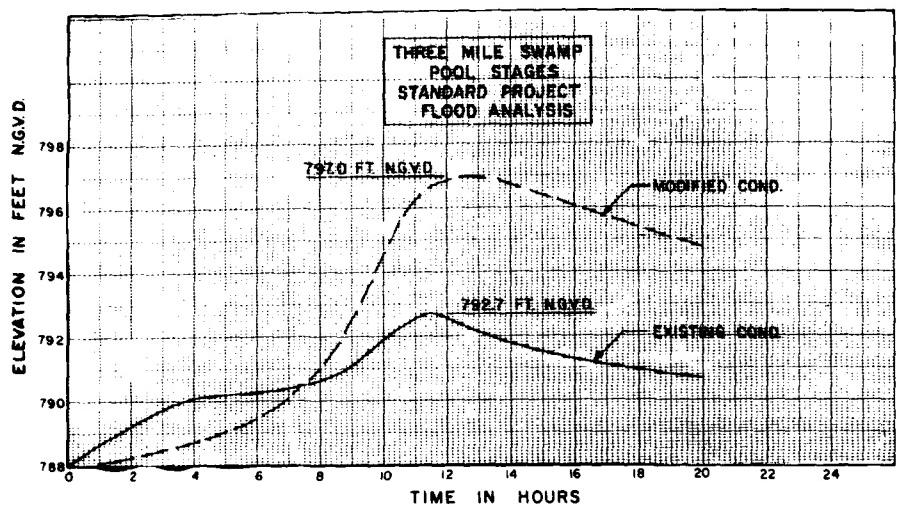



THREE MILE SWAMP
POOL STAGES
SYNTHETIC 100 YEAR FLOOD

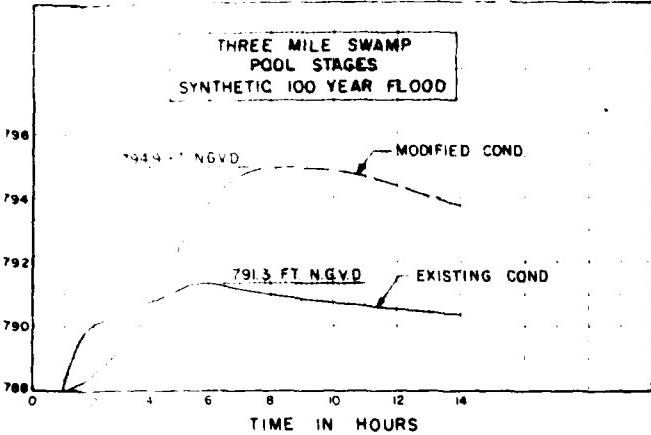


BEAVER BROOK - KEENE, N.H.
AT KMT COMPLEX
10 YEAR FLOOD ANALYSIS

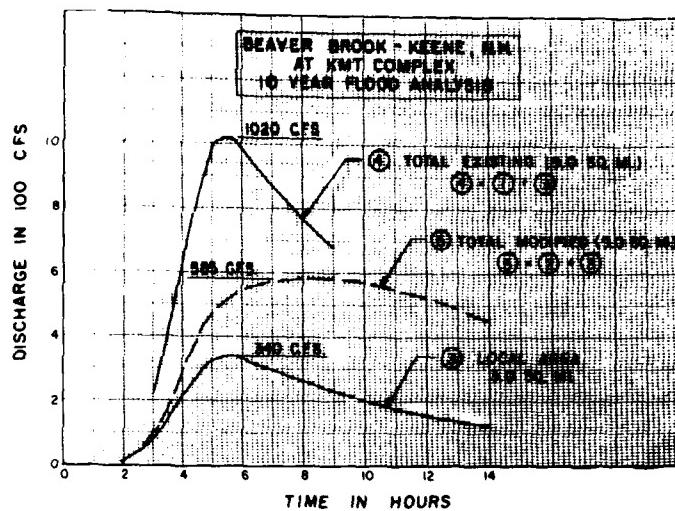

BEAVER BROOK - KEENE, N.H.
SYNTHETIC 100 YEAR
FLOOD ANALYSIS

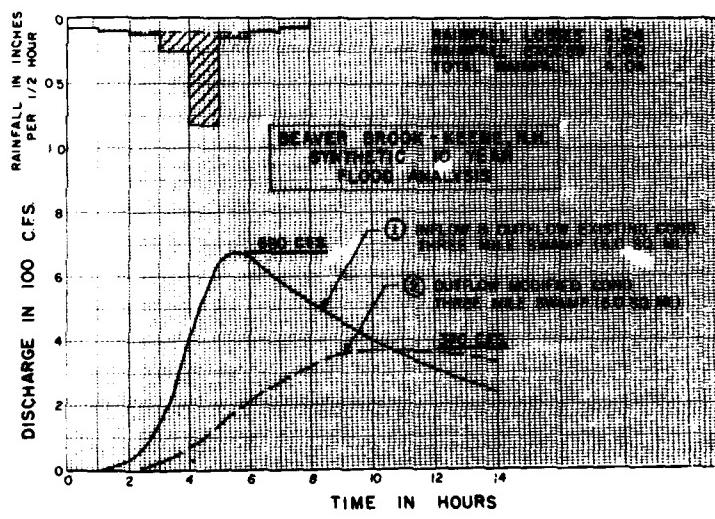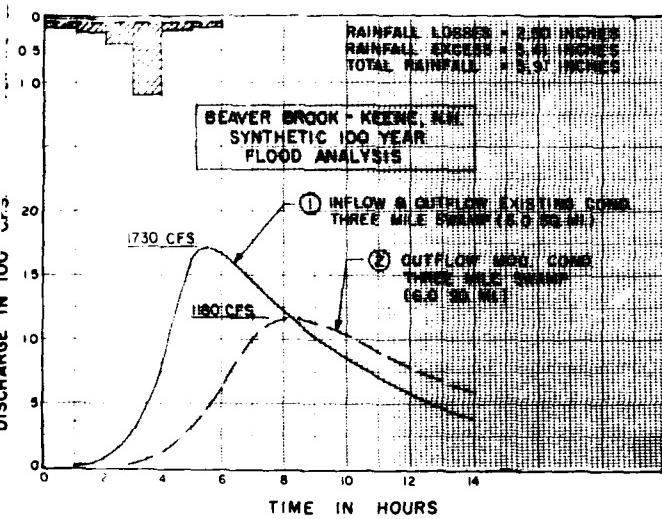

BEAVER BROOK - KEENE, N.H.
AT KMT COMPLEX
100 YEAR FLOOD ANALYSIS

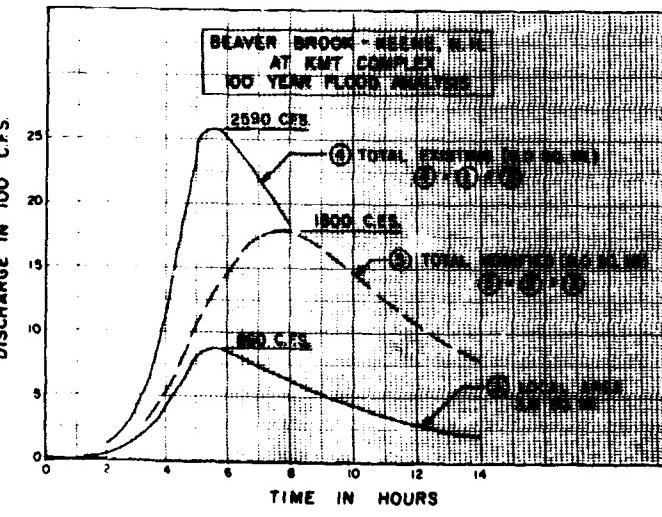

NOTES:

MIN. INVERT OF EXISTING
AND MODIFIED
OUTLET OF THREE
MILE SWAMP AT
ELEVATION 787 FT.
N.G.V.D.


DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
CORPS OF ENGINEERS
WALTHAM, MASS.

ASHUELOT RIVER BASIN
BEAVER BROOK - KEENE, N.H.
ANALYSIS OF FLOODS
SPF 100 YR. - 10 YR.

HYDRO. ENGR. SECT

FEB. 1963

PLATE A-4

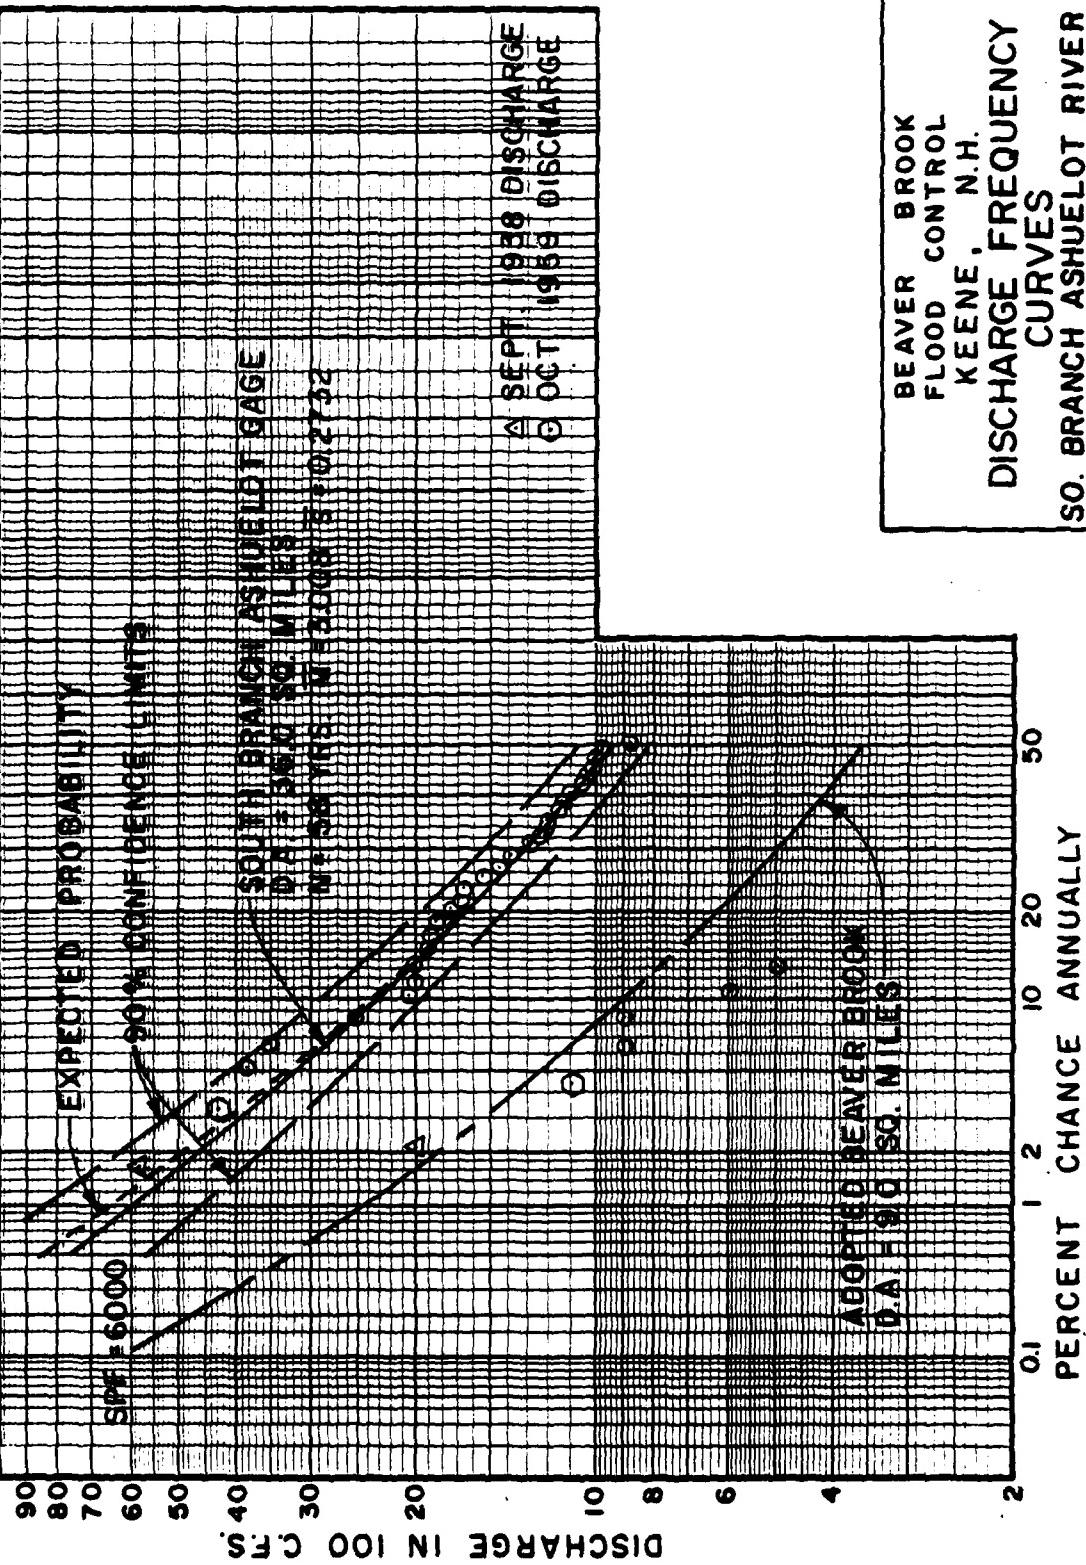

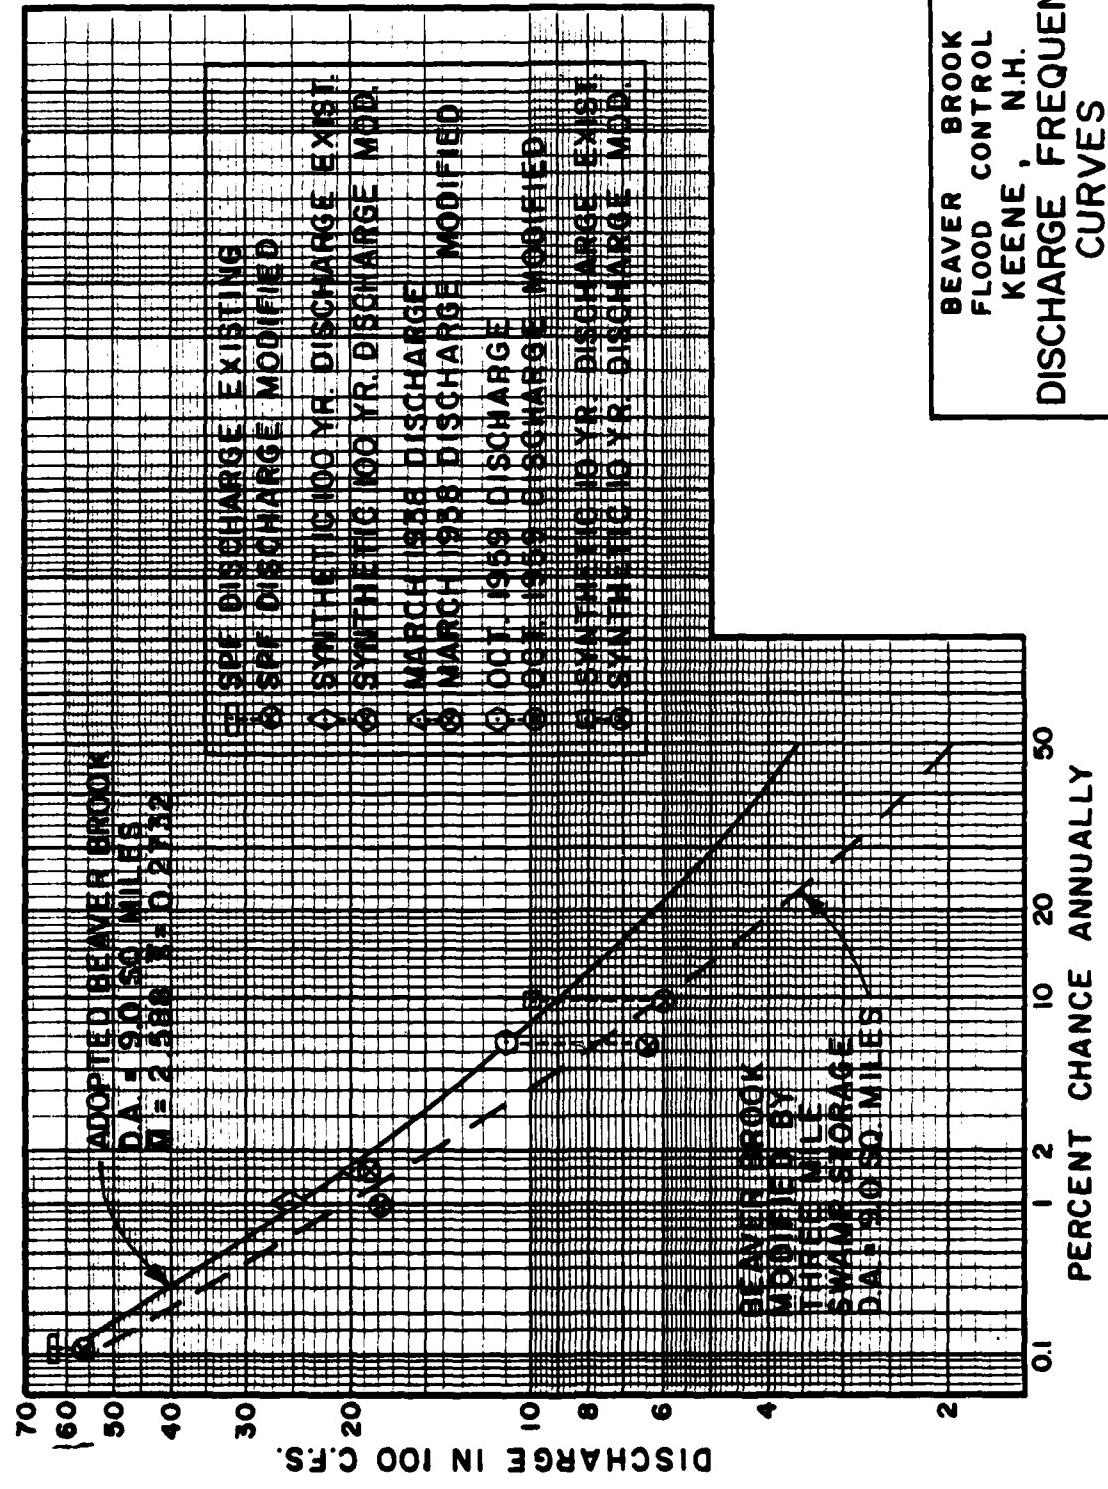


PLATE A-6

CORPS OF ENGINEERS


A

B

C

D

E

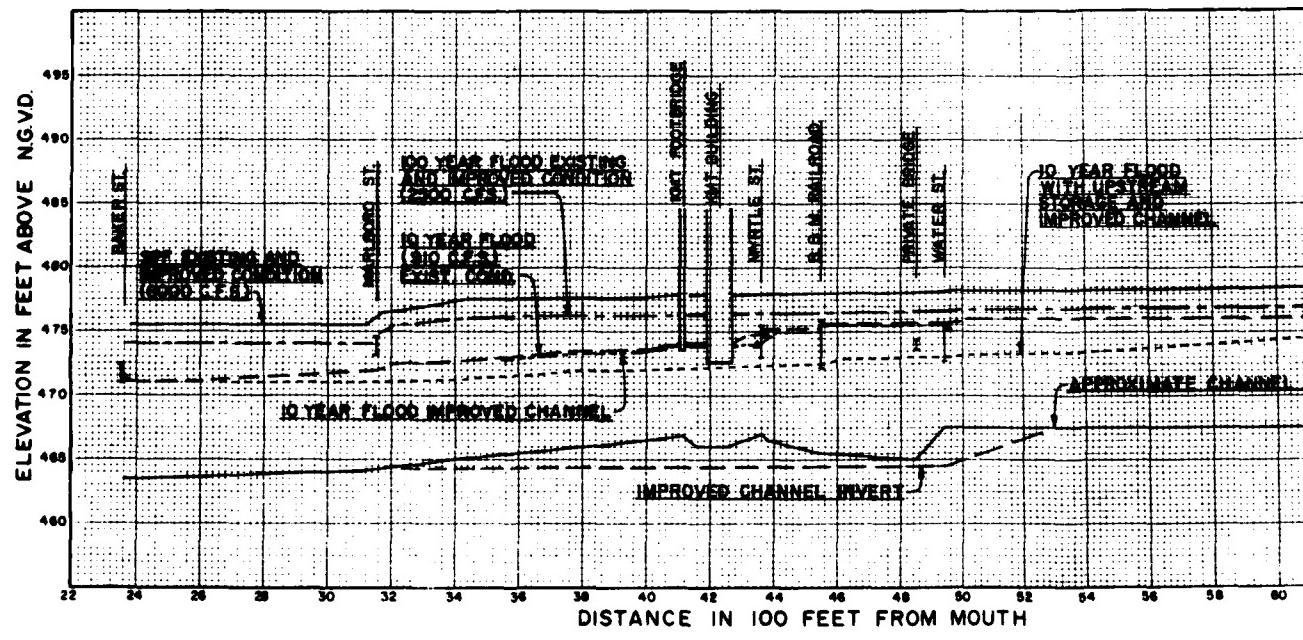

U. S. ARMY

D

E

F

G




LEGEND

100 YEAR FLOOD LIMITS

SCALE IN FEET

200 400

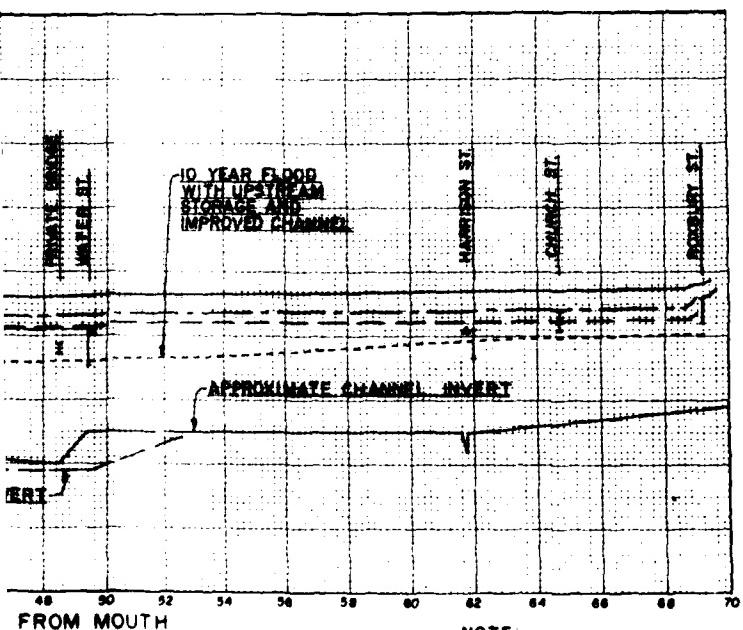

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
COAST OF maine
WATerville, Maine



ASHUELOT RIVER BASIN
BEAVER BROOK KEENE, N.H.
PLAN & PROFILE
EXISTING & IMPROVED CONDITIONS
HYDRO. ENG. SECT. FEB. 1968


PLATE A-7







2






CORPS OF ENGINEERS

A B C D E

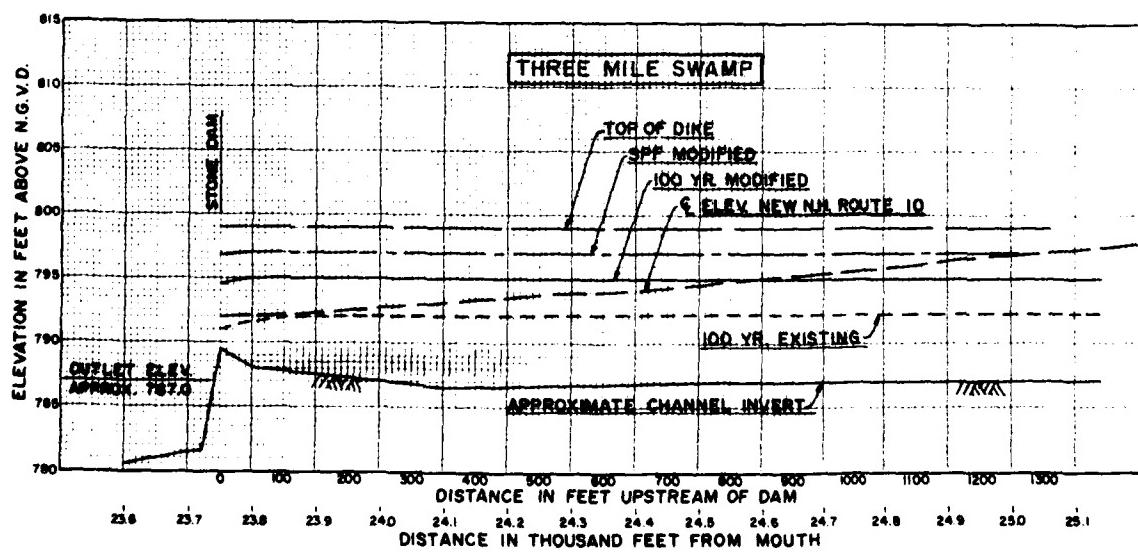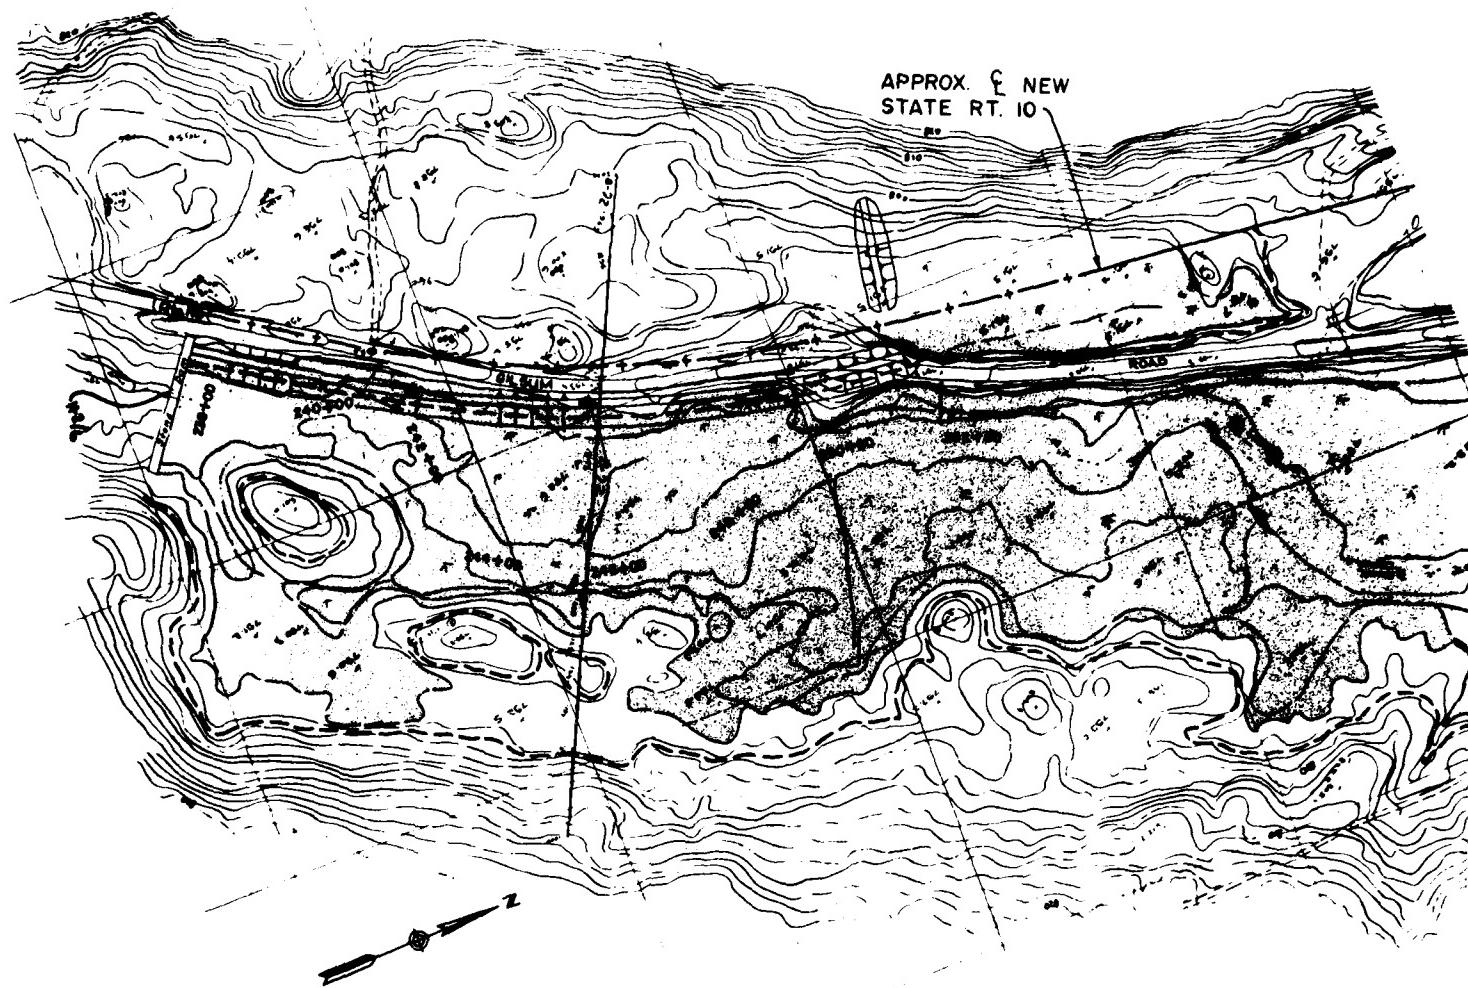

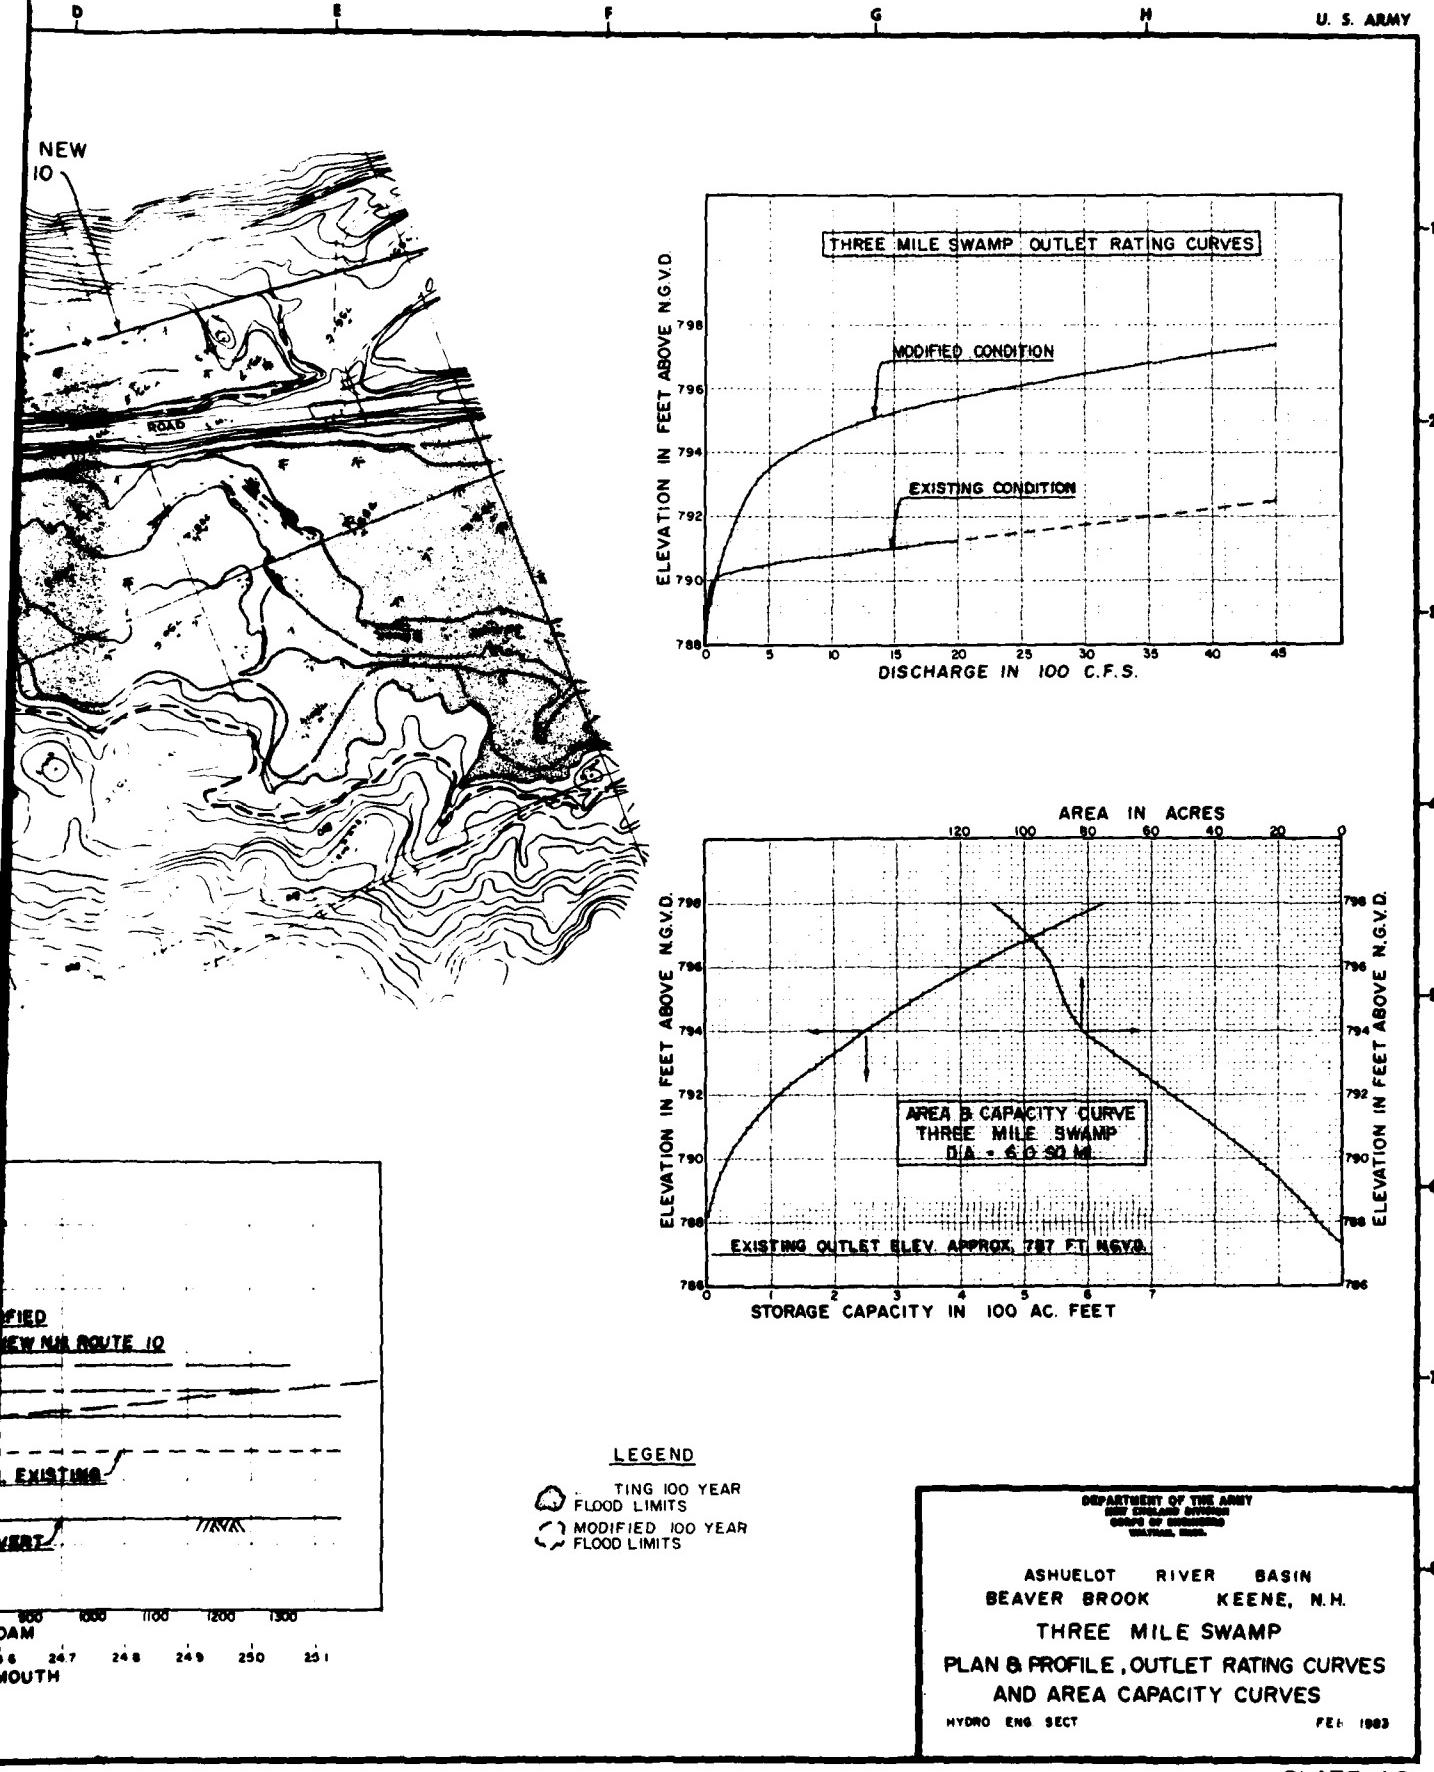

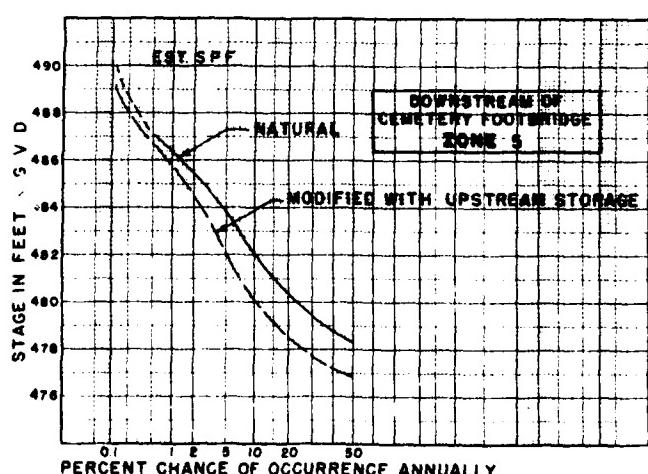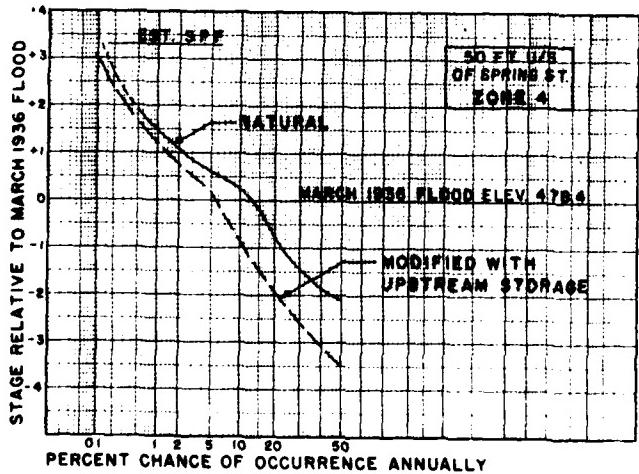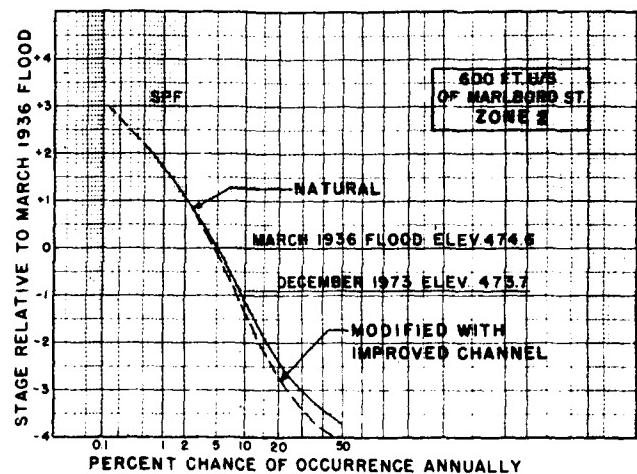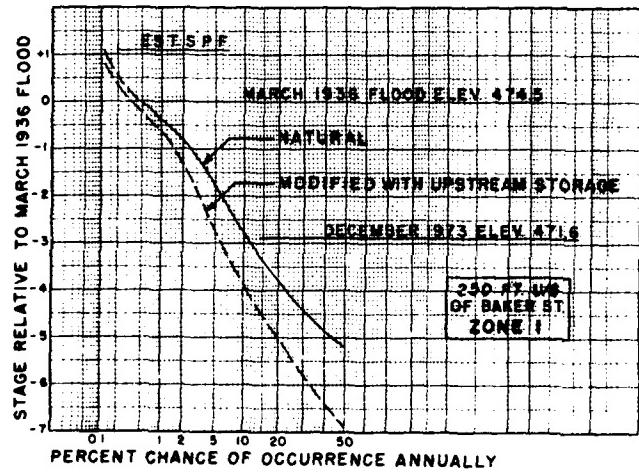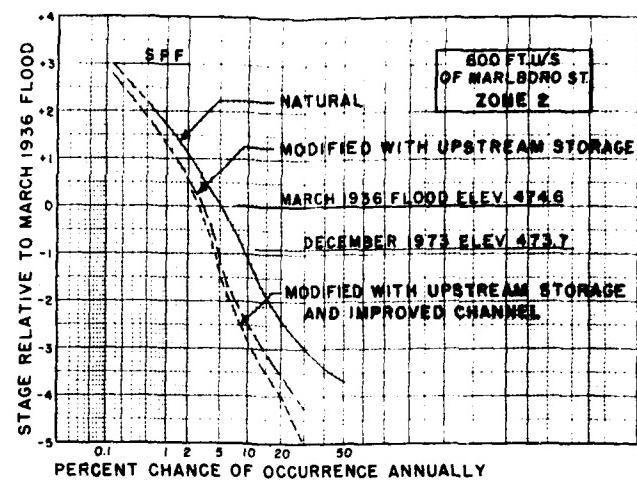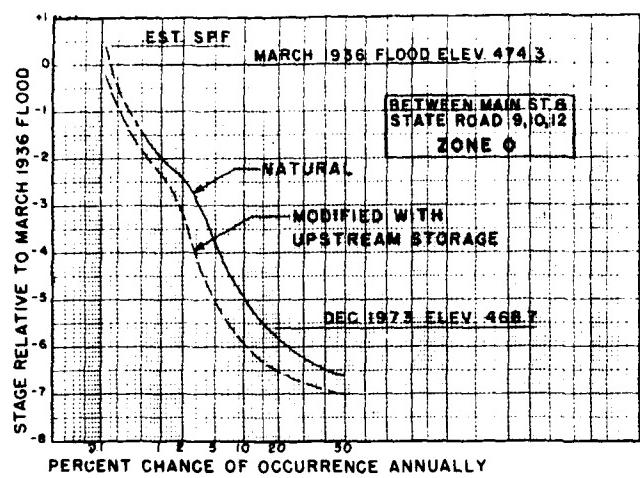

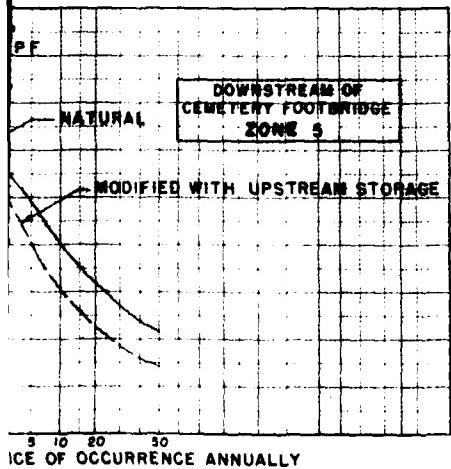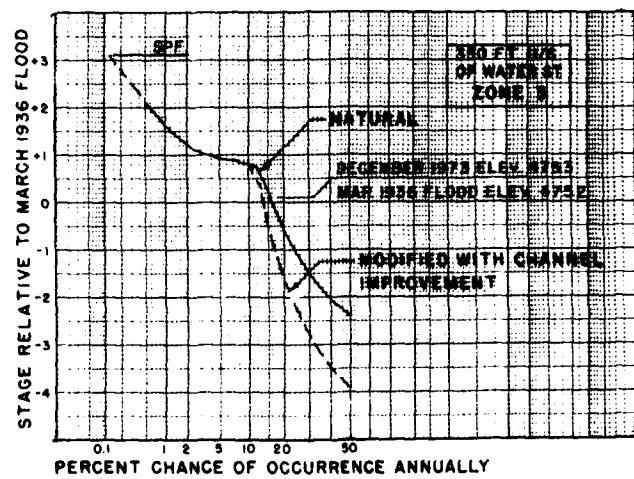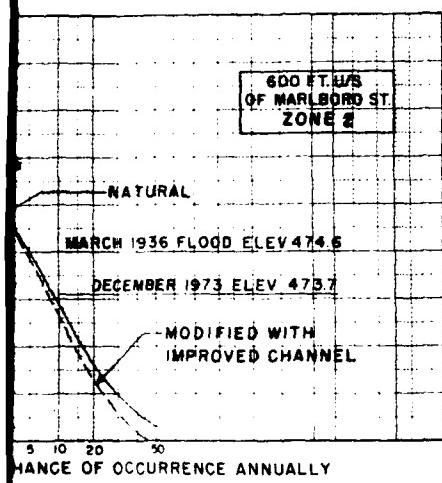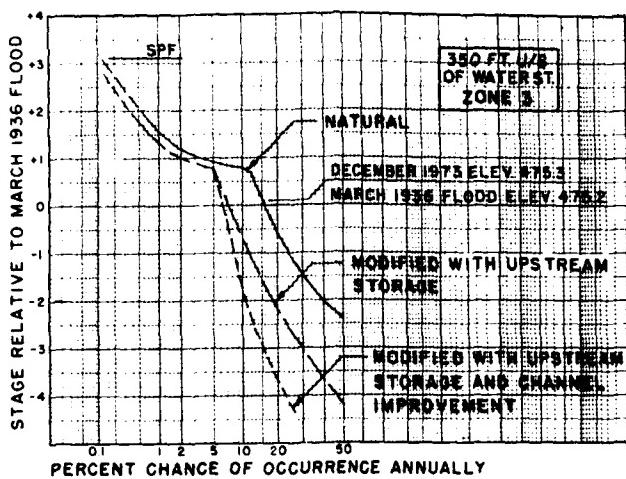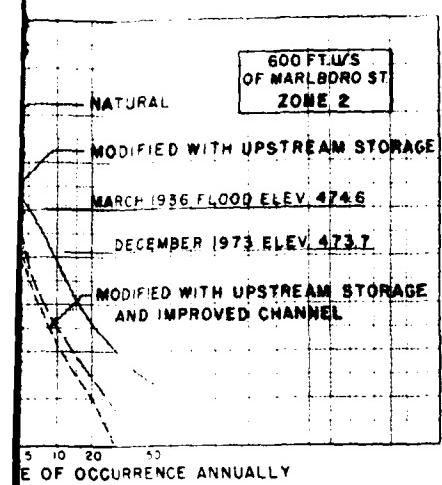

DEPARTMENT OF THE ARMY
 ENGINEER DEPARTMENT
 CORPS OF ENGINEERS
 WASHINGTON, D.C.
 ASHUELLOT RIVER BASIN
 BEAVER BROOK KEENE, N.H.
 STAGE FREQUENCY CURVES
 NATURAL AND MODIFIED
 HYDRO ENG SECT
 FEB. 1963

PLATE A-9

2

SECTION B

GEOTECHNICAL AND DESIGN CONSIDERATIONS

BEAVER BROOK LOCAL PROTECTION
CONNECTICUT RIVER BASIN
KEENE, NEW HAMPSHIRE
GEOLOGY, EMBANKMENTS AND FOUNDATIONS

TABLE OF CONTENTS

<u>Paragraph</u>	<u>Subject</u>	<u>Page No.</u>
	A. <u>PERTINENT DATA</u>	
1 thru 6	Pertinent Data	B-1
	B. <u>INTRODUCTION</u>	
7	Location and Description of Project	B-2
8	General Notes	B-2
9	Elevations	B-2
	C. <u>TOPOGRAPHY, GEOLOGY AND SEISMICITY</u>	
10	Topography	B-2
11	Geology	B-3
12	Seismicity	B-3
	D. <u>SUBSURFACE INVESTIGATIONS</u>	
13	Subsurface Explorations	B-3
14	Laboratory Tests	B-4
15	Presentation of Data	B-5
	E. <u>CHARACTERISTICS OF DAM, DIKES AND CHANNEL FOUNDATION MATERIALS</u>	
16	Distribution and Description of Materials	B-5
17	Shear Strength	B-7
18	Permeability	B-7
19	Consolidation	B-8
	F. <u>DISTRIBUTION AND DESCRIPTION OF MATERIALS FROM REQUIRED EXCAVATIONS</u>	
20	General	B-8
21	Dam, Stilling Basin and Discharge Channel Excavations	B-8
22	Channel Improvement	B-9
	G. <u>CHARACTERISTICS OF EMBANKMENT MATERIALS</u>	
23	General	B-9
24	Filter Design	B-9
25	Random Fill	B-9

26	Impervious Fill	B-9
27	Gravel Fill	B-10
28	Class I Gravel Bedding	B-10
29	Class II Gravel Bedding	B-11
30	Filter Stone	B-11
31	Shear Strength and Permeability Characteristics	B-11
32	Rock and Concrete Materials	B-11

H. DESIGN OF DIKES AND DAM

33	Criteria	B-11
34	Materials for Embankment Construction	B-12
35	Selection of Dike Sections	B-12
36	Seepage Control	B-12
37	Dike Sections	B-13
38	Embankment Stability	B-13
39	Settlements	B-14
40	Construction Considerations	B-14
41	Environmental Considerations	B-16
42	Methods of Placement and Compaction	B-16
43	Slope and Channel Protection	B-17
44	Concrete Dam	B-19

LIST OF PLATES

<u>Plate No.</u>	<u>Title</u>
B - 1	Plan of Explorations & Geologic Log Profiles
B - 2	Selected Test Data - Foundation Materials - Dam And Dike A
B - 3	Gradation Specifications - Gravel Bedding and Gravel Fill
B - 4	Filter Studies - Stilling Basin
B - 5	Filter Studies - Class II Stone Protection, Gravel Bedding and Impervious Fill
B - 6	Materials Usage Chart (Preliminary)
B - 7	Soil Test Results - Table 1
B - 8	Rock Test Results - Table 2
B - 9	Field Log of Test Boring No. A
B - 10	Field Log of Test Boring C
B - 11	Field Log of Test Boring D
B - 12	Field Log of Test Boring E

A. PERTINENT DATA

1. Purpose. Local Flood Protection
2. Location.

State - New Hampshire
County - Cheshire
City - Keene

3. Design Storm

- a. Dam & Dikes

Frequency -	SPF
Freeboard -	2 ft.

- b. Channel

Frequency -	approx. 10 year flood
Freeboard -	none

4. Concrete Gravity Dam

Top Elevation Spillway -	varies 787 to 794 NGVD
Top Elevation Abutments -	799 NGVD
Top Width	5 feet
Slopes	
Upstream	Vertical
Downstream	4V on 3H
Total length -	251 feet
Overflow length -	200 feet

5. Dike Embankments

Type	Dike A Earthfill with Stone Protection	Dike B Earthfill-topsoiled and seeded
Top elevation	799 NGVD	799 NGVD
Maximum height above streambed	17 feet	9 feet
Max. height above landside toe	8 feet	9 feet
Slopes: Riverside	1V on 2H	IV on 2.5H
Landside	1V on 2H	IV on 2.5H
Total Length	1150 feet	180 feet
Top width	12 feet	12 feet

6. Channel Improvement

Length	1750 feet
Bottom width	17 feet
Side slopes	1V on 2H

B. INTRODUCTION

7. Location and Description of Project

The Beaver Brook Flood Damage Reduction Project in the City of Keene, N.H. is located on Beaver Brook, a tributary of the Ashuelot River which in turn is a tributary of the Connecticut River. The flood control project consists of an upstream concrete gravity dam with adjacent earthfill dikes along the Route 10 highway located about 2.6 miles above the center of the city. In addition, a channel improvement consists of the widening of about 1750 feet of the existing channel between Marlboro and Water Streets in the center of the city. The locations, arrangements, and pertinent details of the structures are shown on Plates 4 through 10.

8. General Notes

Programs of subsurface investigations and soils engineering studies were undertaken for the design of the Beaver Brook Project. The subsurface investigations included geological studies, subsurface explorations and laboratory test programs carried out to determine the distribution and characteristics of foundation materials and to determine soil and bedrock conditions relevant to excavation operations and the design and construction of the embankments and concrete structures. Soil and rock engineering studies, based on the data obtained from the subsurface investigations, were conducted to develop safe and economical earthwork and foundation designs and construction methods.

9. Elevations

All elevations mentioned in this report are in reference to National Geodetic Vertical Datum (NGVD), which is the mean sea level of 1929.

C. TOPOGRAPHY, GEOLOGY & SEISMICITY

10. Topography.

The Beaver Brook project area is located within the New England Upland section of the New England physiographic province. The upland is generally characterized by a hilly terrain with occasional monadnocks that is dissected by narrow valleys. With elevations ranging from 500 feet NGVD to over 2,500 feet NGVD, a landscape with steep slopes is common. Glaciation has extensively modified the pre-glacial bedrock topography by erosion and deposition of glacial materials. Elevations near the project site range between 780 feet NGVD and 830 feet NGVD.

11. Geology.

a. Surficial. Pleistocene age, glacial deposits dominate the surficial geology of the area. Glacial till, a heterogeneous product of direct deposition, generally blankets the bedrock surface. In the area, the till has occasionally been molded into low hill features known as drumlins. The east-west valley of the Ashuelot River to the north was dammed by glacial till masses creating a temporary glacial lake, in which fine grained sediments were deposited. This lake may have spilled over the present divide into the north-south valley of Beaver Brook. The till in the lower sides of the Beaver Brook valley is overlain by remnants of gravelly terraces which were built by melt water streams. Recent alluvial deposits are found in valleys and floodplains.

b. Bedrock. The bedrock in the region is principally Devonian in age and consists primarily of granite and gneiss. Mica schist of the Littleton Formation fingers between these rocks along the valley of Beaver Brook. This zone of rock contacts probably accounts for a largely structural origin of the valley. Bodies of pegmatite frequently occur within the local bedrock formations. The strike of the foliation is generally N 20°E while the dip varies between 25 and 60° SE.

12. Seismicity.

The Beaver Brook area is located entirely within Zone 2 of the seismic zone map of the United States. This is a modification of the seismic risk map developed by the Environmental Science Administration and the Coast and Geodetic Survey and it is contained in Engineering Regulation 1110-2-1806 dated 30 April 1977. In accordance with this directive, a coefficient of 0.05g is recommended for use in any preliminary evaluation of the seismic stability of the dam. A detailed seismic evaluation will be performed during final design efforts.

Detailed remote sensing and fault compilation did not reveal the presence of a major or capable fault within a 75 mile radius of the project area. The nearest event with an epicenter based on non-instrumental data occurred approximately five miles from the site in 1854 with an intensity of IV MM (Modified Mercalli). The nearest event with an epicenter based on instrumental data occurred approximately 20 miles from the site in 1966 and had an intensity of V MM.

D. SUBSURFACE INVESTIGATIONS

13. Subsurface Explorations

a. Dam and Dikes. In March 1982, a preliminary subsurface investigation program, consisting of four borings, was performed. The borings were continuously driven into overburden to recover either 2 or 2 1/2 inch diameter samples. Upon refusal, the borings were advanced into bedrock to obtain up to 15 feet of NX size (2 1/8 inch I.D.) cores. Locations of the borings are shown on Plates 4 and 5.

In 1964, 35 test borings were drilled at the original Beaver Brook Dam and reservoir location. Although the original site is approximately 1,000 feet downstream from the present site, the results from these borings are useful in determining the local subsurface conditions. Records of these borings are contained in the Beaver Brook survey report dated July 1965.

b. Channel. No subsurface investigations were performed along the areas of the proposed channel improvements. Foundation conditions were inferred from the borings at the dam site, observations made from field reconnaissance trips, and from the well records and geologic logs of nine wells in the area. The well records and logs are contained in the 1973 U.S.G.S. report "Hydrologic Data of the Ashuelot River Basin, New Hampshire"

c. Future Explorations

(1) Dam and Dikes. At least ten more borings and several test pits will be required in the foundation areas of the concrete dam and dike embankments in order to determine the depth to an adequate bearing stratum for the concrete dam and training walls and seepage and shear strength characteristics for the dike foundation soils. Pressure testing of the bedrock will be required in borings along the centerline of dam. The borings in the dam foundation area will also be used to locate old channel fillings, gorges in bedrock surface, depth of weathered and decomposed bedrock and to determine the extent and characteristics of materials from required excavations. Machine probes will also be utilized along the centerline of the dam to assist in defining a sound and firm bedrock surface. About 20 foundation probes and a few shallow borings will be required along the riverside toe of the Dike A embankment to determine the depth of soft organic materials. About 10 probes and one boring will be required in the foundation area of the Dike B embankment to determine the depth of organics and other unsuitable materials.

(2) Channel. At least three test pits will be required along various reaches of the channel to determine the character of materials for design and construction purposes. A few shallow borings may also be required where utility lines are to be relocated.

14. Laboratory Tests.

All laboratory tests were performed in accordance with the procedures described in Corps of Engineers Manual EM 1110-2-1906 "Laboratory Soils Testing". All soil samples were visually classified in accordance with the Unified Soil Classification System. Grain size analyses, Atterberg Limit determinations, specific gravity and water contents were performed on selected samples to confirm the visual classifications and to provide more precise data where required. Tests on the rock samples included limited petrographic analyses and the determinations of specific gravity, percent absorption, and unconfined compressive strengths.

15. Presentation of Data.

The geological sections along the centerline of the proposed dam and dike are shown on Plate No. B-1. The results of laboratory soil and rock tests are shown on Tables 1 and 2 (Plates B-8, B-9), respectively.

E. CHARACTERISTICS OF DAM, DIKES AND CHANNEL FOUNDATION MATERIALS

16. Distribution and Description of Materials

a. General. The concrete dam will be built on the site of an existing dam (called Three Mile Swamp Dam). The existing dam consists of an earth embankment about six feet high with a supporting downstream rubble wall. The existing dam forms a long shallow impoundment about three to four feet deep behind the dam. The newly reconstructed State Route 10 embankment is located adjacent to the dam and runs the length of the valley. Dike A will be constructed adjacent and parallel to the highway embankment while Dike B will close a low swampy area north of the highway. Portions of the channel improvement will be built on areas of man-made land formed by filling during the last 100 years or so. There is no exact record of the timing and type of filling that has taken place. The filling was generally uncontrolled and the type of fill encountered in these areas is very heterogeneous.

b. Subsurface Water. Subsurface water levels in the proposed dam and dike foundation areas fluctuate with the level of the adjacent brook and pond, but generally will be found within five feet of the ground surface. Subsurface water levels in the channel areas fluctuate with the level of the adjacent brook.

c. Dam and Dike Foundations. As indicated by the Geologic Log Profile on Plate B-1, the overburden varies from about five feet in thickness on the left abutment to only one foot in the vicinity of the existing brook to about 15 feet adjacent to the highway embankment and under the proposed Dike A embankment. The overburden materials consist of a capping of about 6 to 12 inches of topsoil and forest litter overlying primarily glacial materials which in turn overlie schist and granitic bedrock.

Weathered to decomposed bedrock varying from 2 to 7 feet in thickness was encountered in the right abutment and under the existing brook.

The materials in the left abutment glacial till deposits consist of brown to gray-brown, loose to moderately compact, gravelly silty medium to fine sands and silty medium to fine sands (SM). Gravel contents range from 5 to 30 percent while silt contents range from 25 to 45 percent.

Underlying the topsoil in the right abutment and in the valley to the north of the brook, there is a 4-foot layer of gray brown moderately compact, gravelly silty medium to fine sand (SM, till). These sands overlie a 4 foot layer of gray, moderately compact, medium to fine sandy clay (CL, till). Underlying these deposits is a 5 foot zone of a more pervious gray brown, moderately compact gravelly silty sand (SM) and silty sandy gravel (GM) containing cobbles and boulders.

Further upstream (a distance of about 200 feet) the overburden in the dike foundation area consists of gray, moderately compact to compact sandy clay (CL, glacial till). Sand contents of the clays range from 35 to 45 percent. Liquid limits run from 26 to 32 percent while plastic limits range from 16 to 18 percent.

No explorations were made in the foundation areas for the upper reaches of Dike A or for Dike B across the swampy area. Surficial evidence of the soils along Route 10 indicates that foundation materials grade into outwash sands and gravels in the upper reaches of Dike A. The swampy area, high water table and information from highway construction drawings indicate a shallow layer of organics over glacial till for the foundation area of Dike B.

d. Channel. In general, foundation conditions along Beaver Brook are defined by a relatively thick overburden cover, primarily glacial material, overlying bedrock.

Based on the geologic logs of nine wells in the general area, an idealized stratigraphic column would consist of four members. The upper twenty feet is characterized by sand of alluvial and glacial origin. The underlying ten feet consists of glacially-derived silt and sand. Underlying this layer is a variably-thick (40 to 70 feet) unit of silt and clay. The basal member is a compact till, consisting mainly of silt, gravel, and sand. Bedrock in the area is primarily granite with some schist. The bedrock surface was encountered generally at depths greater than 50 feet.

e. Characteristics of Foundation Bedrock

(1) General. The underlying bedrock at the dam consists primarily of interbedded granite and biotite schist. The bedrock in the left abutment is a white to dark gray sequence of interbedded granite and biotite schist. In general, the rock in this area is hard, fresh to slightly weathered, fine to medium-grained, and massive (granite) to well-foliated (schist). Bedrock in the right abutment is a white to dark gray, hard, fresh to weathered, medium to coarse grained well-foliated, biotite schist. The upper foot of rock is very weathered. Interbedded granite and biotite schist comprise the bedrock underlying the proposed dike. Weathered to decomposed bedrock up to seven feet thick was encountered adjacent to the existing brook.

(2) Bedrock Foundation for Dam. The severe weathering of portions of the bedrock at foundation grades may require more than the usual foundation treatment to remove loose blocks and slabs and to clean out weathered zones and seams. The strike of the bedrock is at approximately right angles to the centerline of the dam while the bedrock dips steeply in a southerly direction, which will result in an irregular surface when excavated.

Rock removal and filling of depressions with concrete may be required to establish a uniform base surface for the dam. Rock removal will be accomplished by line drilling and light blasting with jack hammers, and by barring and wedging with hand tools. The bedrock surface will be cleaned with jets of air or water or a combination thereof prior to placing concrete. With adequate treatment the rock will be satisfactory for support of heavy structural loads. Grouting of the bedrock under the centerline of dam will be considered during the final design phase in order to control seepage and maintain a permanent pool, and to control the development of seepage pressures under the toe.

17. Shear Strength.

No samples of foundation materials for this project were tested for shear strength. The shear strength parameters tabulated below have been estimated on the basis of visual examination of the samples, their grain-size distribution curves, data from exploration logs and experience with similar materials.

FOUNDATION SOIL	ESTIMATED SHEAR STRENGTH PARAMETERS	
	ϕ , DEGREES	C, PSF
<u>Dam & Dikes</u>		
Gravelly silty sand (SM)	30	0
Sandy clay (CL) (Till)	30	0
Organic soils	0	100 to 200
Weathered and decomposed bedrock	25 to 30	0
<u>Channel</u>		
Alluvial sands	30	0
Existing fills	25	0

18. Permeability.

Permeability tests were not performed on samples of the foundation soils since the relative permeability characteristics can be judged with sufficient accuracy by visual examination of the samples, their grain size distribution curves and experience with similar materials. It is estimated that the vertical coefficients of permeability will be within the following ranges:

<u>Material</u>	<u>Coefficient of Vertical Permeability (Kv)</u>
<u>Dam & Dikes</u>	
Gravelly silty sands (SM)	0.5 to 5×10^{-4} cm/sec
Sandy clay (CL)	0.1 to 1.0×10^{-4} cm/sec
Weathered and decomposed bedrock	0.1 to 10×10^{-4} cm/sec
<u>Channel</u>	
Alluvial sands	50 to 150×10^{-4} cm/sec
Existing Fills	10 to 100×10^{-4} cm/sec

19. Consolidation.

Consolidation tests were not performed on samples of foundation soils. All soft and compressible surficial deposits will be removed prior to the construction of the dike embankments. The consolidation characteristics and natural densities of the foundation soils are such that no significant post-construction foundation settlement is anticipated under the proposed embankment loadings.

F. DISTRIBUTION AND DESCRIPTION OF MATERIALS FROM REQUIRED EXCAVATIONS

20. General.

The major excavations for this project are those for the concrete dam, stilling basin and discharge channel and for the downstream channel improvement. All suitable materials from the excavations for the dam features will be used to the extent practical in the permanent work. These materials will be used in random fill zones in the dike embankments, in backfills for the concrete structures, and in temporary cofferdams. All suitable materials from the excavations for the channel improvement will be used to the extent practicable to fill low areas adjacent to the channel. Excess and unsuitable materials shall be removed from the sites and spoiled in waste areas furnished by the city.

21. Dam, Stilling Basin and Discharge Channel Excavations.

Excavations for the dam and spillway will consist principally of gravelly silty medium to fine sands and silty medium to fine sands (SM), medium to fine sandy clays (CL) and silty sandy gravel (GM) with cobbles, glacial till. The random fill material from these excavations will be variable with silt contents of the sands ranging from 15 to 45 percent and gravel contents ranging from 5 to 30 percent. Silt contents of the gravels range from 5 to 15 percent while sand contents of the clay range from 35 to 45 percent. The depth and characteristics of the soils in the discharge channel are not known, but probably are similar to those in the dam foundation area. Since some of the materials will be below the water table, it is expected that drying back of these materials will be necessary.

22. Channel Improvement.

Excavations for the channel improvement will consist principally of sands, silty sands and silty gravelly sand (SP, SP-SM, SM) with some trash fill. Suitable material will be used in random fill zones along the channel. Excess and unsuitable materials shall be removed from the site and spoiled.

G. CHARACTERISTICS OF EMBANKMENT MATERIALS

23. General.

The major portions of the materials from the required excavations will not be suitable for use in construction of the compacted impervious fill and gravel fill portions of the dike embankment. The suitable materials from these excavations will be used to the extent practicable as random fill material. In view of the relatively high cost of developing government furnished borrow areas and the implications involved in acquiring land for borrow areas, it has been decided to have the contractor furnish all embankment materials other than those available from the required excavations.

24. Filter Design.

The gradation requirements for gravel fill, gravel bedding and filter stone materials have been established in accordance with the filter design criteria set forth in Engineering Manual for Civil Works Construction, EM 1110-2-1913, Design and Construction of Levees. Typical filter design studies (gradation ranges) are shown on Plate Nos. B-4 through B-5.

25. Random Fill.

The suitable embankment material from the required excavations of the dam, stilling basin, and discharge channel will include a wide range of soils from weathered bedrock to gravelly silty sands and sandy clays. In view of the variability of the materials and the impracticability of separating the various soil types during construction, it is planned to use the material in random fill zones in the dike embankments and for certain backfill zones for the dam and other concrete structures. Random fill material for the channel improvement will not contain significant quantities of cinders, ashes, topsoil and similar material and will be free of stumps, trash and large pieces of debris. For design purposes, the densities, permeability coefficients and shear strength parameters selected for impervious fill material have been used for the random fill material.

26. Impervious Fill.

Impervious fill will be furnished by the contractor and will consist of approved, natural, reasonably well graded, gravelly silty sand and

sandy clay. It is estimated that compacted impervious fill material will have an average coefficient of permeability of less than 1×10^{-4} cm/sec and will develop shear strength parameters in excess of $\phi = 30$ degrees within the anticipated applied stress range for all conditions. Experience with similar materials on other projects indicates that placement moisture contents can be maintained within two percentage points of optimum with moderate moisture control and that in place compacted dry densities will be in the order of 120pcf. The material will be required to meet the following gradation limits:

<u>Sieve Size (U.S. Std)</u>	<u>Percent Passing by Dry Weight</u>
6 inch	100
3 inch	85-100
No. 4	70-95
No. 40	35-70
No. 200	20-45

27. Gravel Fill.

Gravel fill shall consist of approved contractor furnished well graded sandy gravel composed of tough, durable particles of natural sand and gravel. The material shall meet the following gradation limits:

<u>Sieve Size (U.S. Std)</u>	<u>Percent Passing by Dry Weight</u>
6 inch	100
1 inch	45-90
No. 4	15-70
No. 16	7-50
No. 200	0-5

(In addition, not more than 10 percent, by dry weight, of the component passing the No. 4 sieve shall pass the No. 200 sieve.)

28. Class I Gravel Bedding.

Gravel bedding shall consist of bank-run reasonably well graded, cobbly, sandy gravel composed of tough, durable particles of natural sand and gravel. The material shall meet the following gradation limits:

<u>Sieve Size (U.S. Std)</u>	<u>Percent Passing by Dry Weight</u>
6 inch	100
1 inch	50-90
No. 4	25-70
No. 16	15-50
No. 200	0-5

(In addition, not more than 10 percent, by dry weight, of the component passing the No. 4 sieve shall pass the No. 200 sieve.)

29. Class II - Gravel Bedding.

The material shall meet the following gradation requirements.

<u>Sieve Size (U.S. Std)</u>	<u>Percent Passing by Dry Weight</u>
9 inch	100
2 inch	60-90
No. 4	15-60
No. 16	7-40
No. 200	0-5

(In addition, not more than 10 percent, by dry weight, of the component passing the No. 4 sieve shall pass the No. 200 sieve.)

30. Filter Stone.

Filter stone shall be furnished by the contractor and shall consist of hard, durable and sound quarried rock fragments. The material shall be well graded with fragments varying in size from 3 inches to 5 inches. The material may contain a maximum of 20 percent, by dry weight, of particles retained on a 5 inch grizzly and a maximum of 15 percent, by dry weight, of particles that pass the 3-inch sieve. The filter stone material shall not contain particles with a maximum dimension greater than 8 inches. No stone shall have a minimum dimension less than 2 inches.

31. Shear Strength and Permeability Characteristics.

On the basis of the above gradation and specifications it is estimated that gravel fill, gravel bedding and filter stone materials will develop angles of internal friction of at least 30 degrees and will have coefficients of permeability between 20×10^{-4} and 100×10^{-4} cm/sec.

32. Rock and Concrete Materials.

More than 3,900 cubic yards of Class I Stone Protection and 3,700 cubic yards of Class II Stone Protection are needed for this project. There are two known commercial sources for stone protection materials located north of the city of Keene, within 20 miles. Concrete aggregate is available from commercial suppliers in the tri-state area within a 35 mile radius of the project site.

H. DESIGN OF DIKES AND DAMS

33. Design Criteria.

Current design criteria as set forth in the pertinent sections of the Engineering Manual for Civil Works Construction EM 1110-2-1913 "Design and Construction of Levees" have been followed in the design of dikes for this project.

34. Materials for Embankment Construction.

a. Materials from Required Excavations. It is estimated that there will be about 29,000 cubic yards of required earth excavations for this project. About 17,000 cy will be excavated from the dam and dike areas and about 11,000 cy from the channel improvement. Of the materials from these excavations, about 4,000 cubic yards will be suitable for use in the random fill zone of the dikes and certain backfills around concrete structures. About 1,000 cubic yards of material will be utilized in temporary cofferdams. About 25,000 cubic yards of material shall be removed from the site and spoiled. About 600 cubic yards of required rock excavations will be utilized as Stone Protection in the discharge channel. Future subsurface investigations will determine more accurately the characteristics of the foundation materials and materials from required excavations. Once these characteristics are more accurately defined, the design may be modified to utilize more materials from required excavations.

b. Materials Furnished by Contractor. All dam and dike materials other than random fill materials and Stone Protection for the dam discharge channel will be furnished by the contractor.

c. Materials Usage. A chart showing the proposed utilization of materials from the required excavations and of materials furnished by the contractor is shown on Plate B-7. The quantities shown are subject to change as more detailed quantity estimates are developed during the preparation of plans and specifications for the project.

35. Selection of Dike Sections.

The sections for various reaches of the dikes developed as a result of design studies are shown on Plates 5 and 6. The selection of the sections was influenced by the foundation conditions, the availability and characteristics of earth and gravel materials from required excavations and other sources, the proximity of Route 10, seepage control requirements, stream erosion, ice action and construction considerations. In general, the Dike A embankment will consist of a large reservoir side toe of gravel fill, a large central zone of compacted impervious fill, a smaller zone of compacted random fill above elevation 795 and a shallow landside pervious toe drain of compacted gravel fill. The embankment will be protected by layers of stone protection and gravel bedding on the reservoir side slopes and by seeded topsoil on the landside slopes. Dike B will consist of a large section of dumped and compacted random fill. The embankment will be protected by seeded topsoil.

36. Seepage Control

a. General. The design hydrostatic head for the dike has been taken as that produced by the SPF (El 797) on the waterside and a water level at the ground surface on the landside. On this basis, the design hydraulic head will range from 2 to about 6 feet.

b. Seepage Through the Dike. Seepage through Dike A will be controlled through the arrangement, sizes and differences in permeabilities between the impervious fill zone and those of the landside gravel fill zone and the relatively long seepage path through the random zone above elevation 795. Seepage through Dike B will be controlled by the relatively long seepage path through the random fill zone.

c. Foundation Seepage. Seepage and uplift pressure at the landside toe above elevation 795 will be controlled by the length of the seepage path. In the reach from Sta 0+00 to Sta 10+00 for Dike A where the hydraulic head is between 2 and 6 feet, a shallow toe drain has been provided to intercept seepage and prevent softening of the landside toe.

37. Dike Sections

a. Dike Stations 0+00 to 4+00. Dike A in this reach will have a gravel fill (dumped and compacted) waterside toe. Its height on the landside will average about 8 feet while its height on the waterside will average about 17 feet. All organic materials in the pond bottom within the dike foundation area will be excavated to insure embankment stability against shear failure. The section will consist of dumped impervious and gravel fills placed in water below elevation 787 and compacted impervious and gravel fills above that elevation. The bottom of the pervious foundation drain will extend into the foundation materials by 2 feet.

In order to utilize materials from required excavations, compacted random fill will be placed above elevation 795 where hydraulic heads are low. Stone protection will be placed on the riverside as the dike will be subjected to water and ice action and to increase stability during drawdown.

b. Dike Stations 4+00 to 11+80. The dike in this reach is also constructed parallel and continuous to the highway. Its height on the landside will average about 5 feet while its height on the waterside will average 11 feet. The dike section will be similar to the reach from stations 0+00 to 4+00 except that the height of the embankment is less. The dike will have a small waterside gravel fill toe. Below elevation 795 the section will consist of compacted impervious fill with compacted random fill above Elev. 795. No toe drain is provided in this reach because of low differential heads and long seepage path. Stone protection will be placed on the riverside slopes as the dike will be subjected to ice action, and to increase stability during drawdown.

c. Dike B. Dike B will close off a low swampy area on the north side of Route 10 and will divert overland flow through an existing 36 inch culvert under the highway. The dike will reach a maximum height of about 9 feet. All organic material within the foundation area will be excavated to insure embankment stability and control seepage. The section will consist of dumped random fill below elevation 793 and compacted random fill above that elevation. All slopes will be topsoiled and seeded.

38. Embankment Stability.

a. General. A section at Sta 1+00 of the riverside portion of the dike, where the height of slope is about 18 feet was selected for stability analysis as being a section combining maximum embankment height with average foundation strengths. This section was analyzed for stability against shear failure by the circle method for the End of Construction, the Sudden Drawdown Condition and Intermediate Flood Stage Condition.

b. Selection of Design Values. The design unit weights and shear strength parameters have been selected on the basis of experience with similar materials on other projects and are tabulated below:

Material	Unit Weight (pcf)				Shear Strength					
	Sat	Moist	Dry	Sub.	θ (degrees)	C(psf)	θ	C	θ	C
	40	0	40	0	40	0	40	0	40	0
1. Stone Protection	135	118	116	73						
2. Gravel Bedding & Comp. Gravel Fill	145	135	130	83	35	0	37	0	37	0
3. Dumped Gravel Fill	135	120	115	73	30	0	33	0	33	0
4. Comp. Impervious & Random Fills	140	135	120	78	30	0	30	0	32	0
5. Dumped Impervious & Random Fills	135	125	110	73	25	0	25	0	25	0
6. Foundation Soil	140	135	120	78	30	0	30	0	30	0

c. Results of Stability Analyses. The minimum factors of safety for a section of maximum height and average foundation strength are tabulated below. On the basis of the results of these analyses, it is considered that the selected embankment sections are safe against shear failure.

<u>Condition Analyzed</u>	<u>Minimum Factor of Safety</u>	<u>Criteria</u>
1. End of Construction	1.6	1.3
2. Sudden Drawdown from Max Pool (El. 797.0)	1.1	1.0
3. Intermediate Flood Stages 1.6(El. 791)		1.4

39. Settlements.

Except for the organic soils the foundation soils and fills are of low compressibility and no significant settlements are anticipated from these soils. All organic soils under portions of the riverside slopes will be removed prior to construction of the dikes. It is expected that settlement of the foundation soils and embankments will occur entirely during construction.

40. Construction Considerations.

a. Dewatering Construction Areas. All areas in which compacted fills are to be constructed will be dewatered. Along portions of the riverside toe of the dike A, there will be a gravel fill zone which will serve as a cofferdam. The lower portion of this zone will be dumped into 2 to 5 feet of water while the upper portion will be compacted. It is anticipated that the dewatering of the construction areas, in general, will be possible by the usual methods of construction drainage including open pumping. In the excavation for the dam, special methods such as well pointing may be necessary. Portions of the gravel bedding and stone protection for the channel realignment will be placed below water level without diversion or dewatering of the construction area. Above water level, these materials will be placed in the dry.

b. Rate of Embankment Construction. In general, the dikes will be constructed to their full width in reaches long enough to permit proper operation of compaction equipment. An exception to this requirement will be made to allow construction of the dumped gravel fill cofferdam in advance of the adjacent fill zones. It will be required that prior to certain flood seasons, all partially completed dike reaches will be completed to their full width including stone protection.

c. Control and Diversion of River During Construction of Concrete Dam

(1) General. Plate 13 schematically indicates a means by which Beaver Brook can be controlled and diverted during construction of the concrete dam including stilling basin and discharge channel.

(2) Stage I - The construction plan provides for excavation of a trapezoidal diversion channel on the left side capable of conveying a flow of at least 700 cfs (10 yr. freq. flow) with an upstream cofferdam to approximately Elev. 792. This plan will allow construction of the right side of the dam, including the stop log structure and the low flow weir (El. 787) during Stage II. The diversion channel will be excavated to final excavation grade. Bedrock will be removed at this stage so as to minimize damage (from blasting operations) to future concrete structures. The brook will be diverted to this side after completion of all earth and rock excavation in this area.

(3) Stage II - The right side of the dam including the stop-log structure and portions of the stilling basin and downstream channel will be constructed during this phase. The upstream and south side cofferdams will be constructed to Elev. 792.

(4) Stage III. During stage III, flow through the stop-log structure and over the low flow weir will produce a capacity in excess of 700 cfs with the upstream cofferdam to approximately El. 794 NGVD. This plan provides for construction of the left side of the dam with only a minimum of rock blasting required. Special rock excavation may be required adjacent to the previously constructed monolith to minimize damage from vibration effects.

41. Environmental Considerations.

The duck nesting season takes place in the existing pond during May and June. A relatively stable pool must be maintained at about elev. 787 during construction to insure a successful nesting season. A low earth and rockfill overflow weir will be constructed about 120 feet upstream of the existing dam (where reservoir narrows) to maintain a wildlife conservation pool at elev. 787 NGVD. All earthwork shall be planned and conducted to minimize the duration of exposure of unprotected soils. Such methods as necessary shall be utilized to effectively prevent erosion and control sedimentation.

42. Methods of Placement and Compaction

a. Spreading. Materials for fills shall be spread with bulldozers or other approved equipment or by hand to form uniform loose layers of the following thicknesses:

Material	Maximum Loose Layer Thickness (Inches)	
	General	Restricted Areas
Comp. Impervious Fill	6	4
Comp.. Random Fill	6	4
Comp. Gravel Fill	8	4
Uncompacted Random (channel improvement)	12	—

b. Compaction. Materials for compacted fills shall be compacted as follows according to its fill type:

<u>Fill Type</u>	<u>Compaction</u>
Comp. Impervious	At least 6 coverages of the tread of the heavy tractor.
Comp. Random	At least 4 coverages of the tread of the heavy tractor or at least 8 coverages of the tread of the light tractor.
Comp. Gravel	At least 6 passes of the large vibratory roller.

c. Compaction in Restricted Areas. In restricted areas, impervious and random (dike embankment) fills shall be compacted by at least four coverages of the tamping foot of the power tamper. Random (channel improvement) and gravel fill in restricted areas shall be compacted by a plate vibrator or the small vibratory roller.

d. Equipment. Compaction equipment shall conform to the following requirements and shall be used as prescribed in subsequent paragraphs.

(1) Heavy Tractor. A "heavy tractor" to be used for compacting fill material shall be a standard commercial make crawler type tractor weighing not less than 35,000 pounds and exerting a tread pressure of not less than 9 pounds per square inch. The tractor shall be equipped with standard width treads.

(2) Light Tractor. A "light tractor" to be used for compacting fill material shall be a standard commercial make crawler type tractor weighing between 7,500 and 12,000 pounds and having a width of 5 1/2 feet or less, measured between the outside edges of the crawler tracks.

(3) Small Vibratory Roller. A vibratory roller shall be a unit designed for the compaction of soil or rock by vibration and shall be the product of a manufacturer nationally recognized for the design and production of such equipment. The roller shall have a double drum having a width of 25 inches or more. The roller shall weigh more than 1700 pounds and shall be self-propelled with forward and reverse speeds.

(4) Large Vibratory Roller. The vibratory roller shall be equipped with a smooth steel compaction drum and shall be operated at a frequency of vibration during compaction operations between 1100 and 1500 vpm. Vibratory rollers may be either towed or self-propelled and shall have an unsprung drum weight that is a minimum of 60 percent of the roller static weight. Rollers for compacting fill shall have a minimum static weight of 8000 pounds, a minimum dynamic force of 16,000 pounds when operating at 1400 vpm, and an applied force not less than 5000 pounds nor greater than 9000 pounds per foot of compaction drum length.

(5) Power Tamper. A power tamper shall be an approved pneumatic or mechanical tamper designed for the compaction of soils and the product of a manufacturer nationally recognized as a specialist in the design and manufacture of such equipment. Jackhammers or similar equipment not specifically designed for the compaction of earth material will not be approved. The tamper shall deliver no more than 1000 blows per minute and in addition shall have a circular tamping foot not more than 6 inches in diameter and shall be of a type that can operate satisfactorily at angles of up to 45 degrees to the vertical.

(6) Plate Vibrator. A plate vibrator shall be a plate surface vibrator designed for the compaction of soils by vibration and the product of a manufacturer nationally recognized as a specialist in the design and manufacture of such equipment. The surface contact plate shall be between 18 and 21 inches in width.

43. Slope and Channel Protection.

a. Stilling Basin. Layers of Class I Stone Protection, filter stone and Class I gravel bedding will be constructed downstream from the stilling basin for the dam to provide protection against stilling basin exit velocities of approximately 9 feet/sec. and high turbulence levels in

the flows. These layers have been designed in accordance with the criteria for stone sizes for riprap and channel bottom and side slopes downstream from stilling basins as set forth in Hydraulic Design Chart 712-1.

b. Dike. The riverside slopes of dike A will be protected from stream erosion and ice action by layers of slope protection and gravel bedding. The landside slopes of dikes will be topsoiled and seeded while the top will have a gravel maintenance road. The same stone sizes as used in the stilling basin (Class I) will be specified for the Dike A slopes between stations 0+00 and 11+00.

c. Channel Improvement. Hydraulic analysis for erosion control of channel improvement indicates that vandal-proof stone sizes are adequate for streambank protection between Marlboro and Water Streets. Velocities along the channel at the toe of slopes are 3 to 4 fps and about 5 fps at bridges. Due to the low energy-gradient on this brook, it is feasible to terminate stone protection on the slope at about the 2-year flood level (water depth at 4 feet above channel invert). The slopes above the stone protection will be topsoiled and seeded with flood tolerant grasses. Full bank protection will be provided within 50 feet upstream and downstream of bridges to provide protection against accelerated flow velocities at these locations.



d. Layer Thickness and Gradation Range. The layer thickness, gradation range (assuming unit weight of stone as 165pcf) and other pertinent data are shown in the following table:

<u>Class</u>	<u>Basic Layer Thickness (inches)</u>	<u>Percent Lighter By Weight (SSD)</u>	<u>Limits of Stone Weight (lbs)</u>
I (max) (Stilling Basin)	36	100	Bet. 250 & 1000
		50	Bet. 120 & 300
		15	Less than 150
		0	2 (min)
I (Dike A)	24	100	Bet. 250 & 1000
		50	Bet. 120 & 300
		15	Less than 150
		0	2 (min)
II (Channel)	18	100	Bet. 150 & 400
		50	Bet. 60 & 90
		15	Less than 40
		0	2 (min)

44. Concrete Dam.

The dam will consist of a centrally located 200 foot wide overflow spillway with weir crests at three different elevations (Elevs. 787, 792 and 794) and non-overflow concrete abutments. The height of the spillway will vary from 8 to 15 feet above the top of stilling basin (El. 779) and about 10 to 18 feet above the bedrock surface. The entire concrete dam will be founded on a firm and sound bedrock surface.. Rock excavation will be required for the left side of the stilling basin. A horizontal concrete slab will be required on the right side to construct the stilling basin at Elev. 779. The concrete slab will also be founded on bedrock as the elevation of the bedrock surface in the area of the stilling basin slab only varies from about Elev. 778 to 775. As described in paragraph 16e.(2), the severe weathering of portions of the schist and granite bedrock at foundation grades may require more than the usual foundation treatment to produce a sound and firm bedrock surface.



The left side training wall will be partially excavated in bedrock while the right training wall will be founded on bedrock or glacial till. Future explorations will determine the depth to bedrock or a suitable earth bearing stratum. A grout curtain will be considered in final design in order to maintain the permanent pool during low flows.

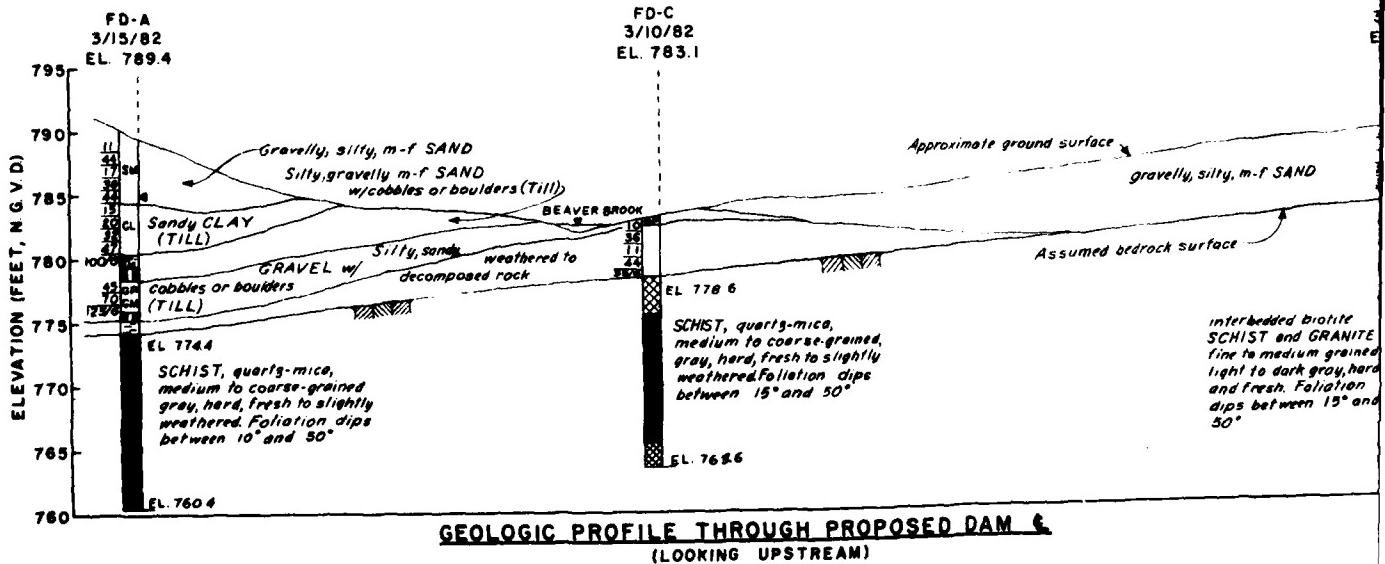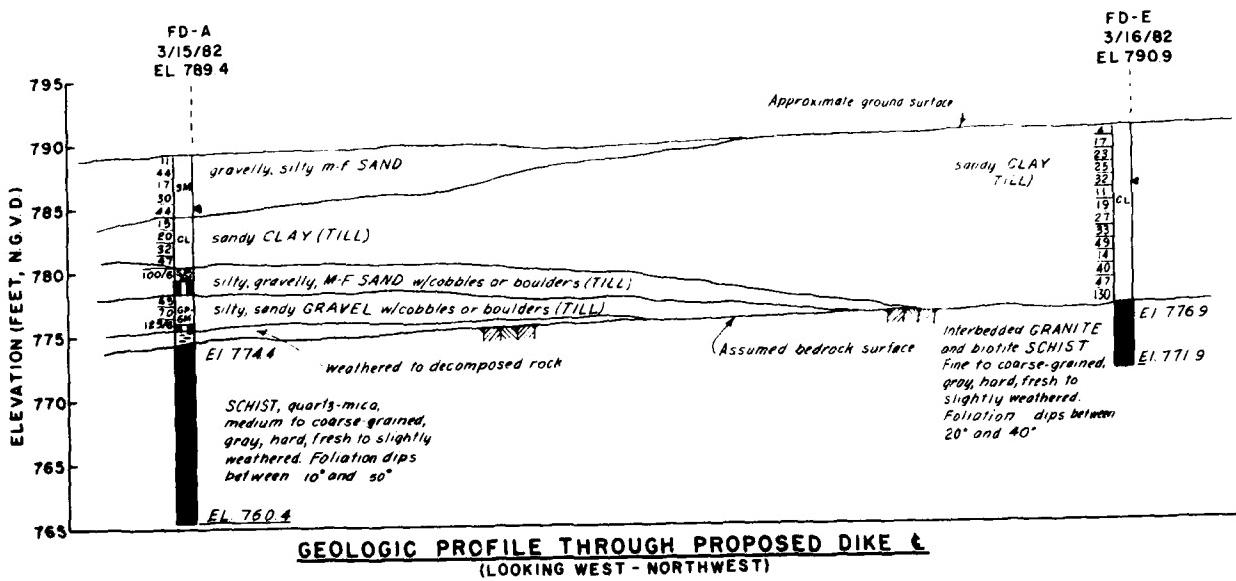

NOTES

1. Boundaries between materials are approximate.
2. Topsoil cover, up to one foot thick, not shown.

FD-E
3/16/82
EL 790.9

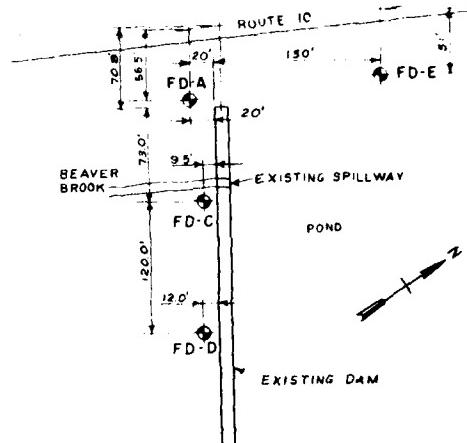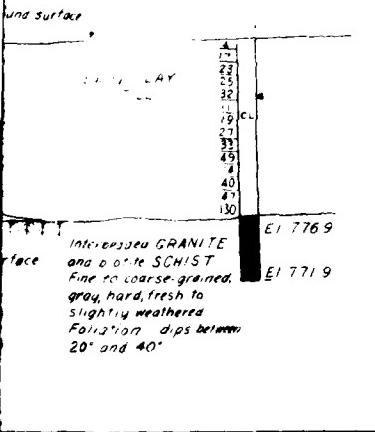

LOCATION PLAN OF EXPLORATION

SCALE: 1" = 50'

50 0 50 100

LEGEND FOR GRAPHIC LOGS

FD-610 Type and number of exploration.


1/7-15/54 Observation Well installed & period of observation

1/15/54 Month/Day/Year exploration completed

N15,000 W9,878 Location by coordinate.

EL 789.4 Elevation of ground surface at time of exploration

- Maximum artesian head.
- ▲ Subsurface water level.
- Artesian flow encountered.
- Range of subsurface water level during observation period.
- Bottom of observation well.
- Group letter symbol according to Unified Soil Classification System.
- NR No Recovery or unsatisfactory soil samples recovered.
- NS Not Sampled (Core drilled, blasted and/or wash bored)
- Number of blows per foot of penetration using a 500 pound hammer, falling freely on average drop of 18 inches to drive a sample spoon of 2" D or 2 1/8" I.D. in size, equipped with bevelled and sharpened drive shoe.
- Blow count not recorded, or not considered representative.
- Cobble or boulder (Core drilled)
- Coarse gravel or nested cobbles and boulders. (Core-drilled and/or blasted and chopped)
- EL 481.4 Elevation of bedrock surface.
- Rock core recovery 0-25 %
- Rock core recovery 25-50 %
- Rock core recovery 50-75 %
- Rock core recovery 75-90 %
- Rock core recovery 90-100 %
- EL 481.4 Elevation at bottom of exploration

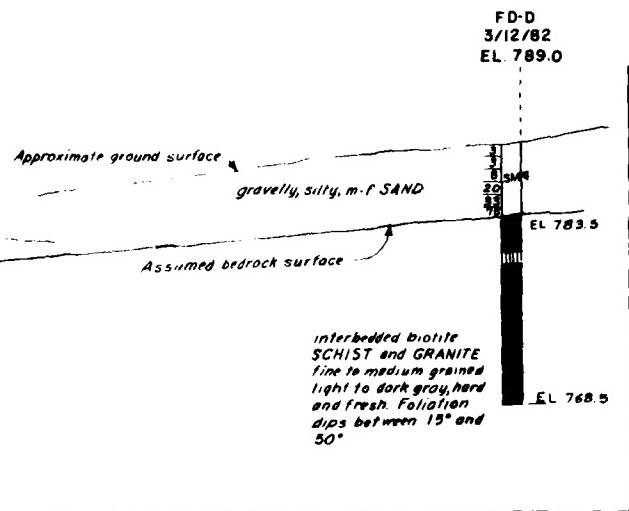

distances between materials are approximate.
No cover, up to one foot thick, not shown

GRAPHIC SCALES

VERT. 1" = 5'	0	5	10	
HORIZ. 1" = 10'	10	0	10	20

DES BY DR BY CR BY
E.B. E.B. C.P.

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
CORPS OF ENGINEERS
WALTHAM, MASS.

PLAN OF EXPLORATIONS AND GEOLOGIC LOG PROFILE

BEAVER BROOK, KEENE, N.H.

Plate No. B-1

2

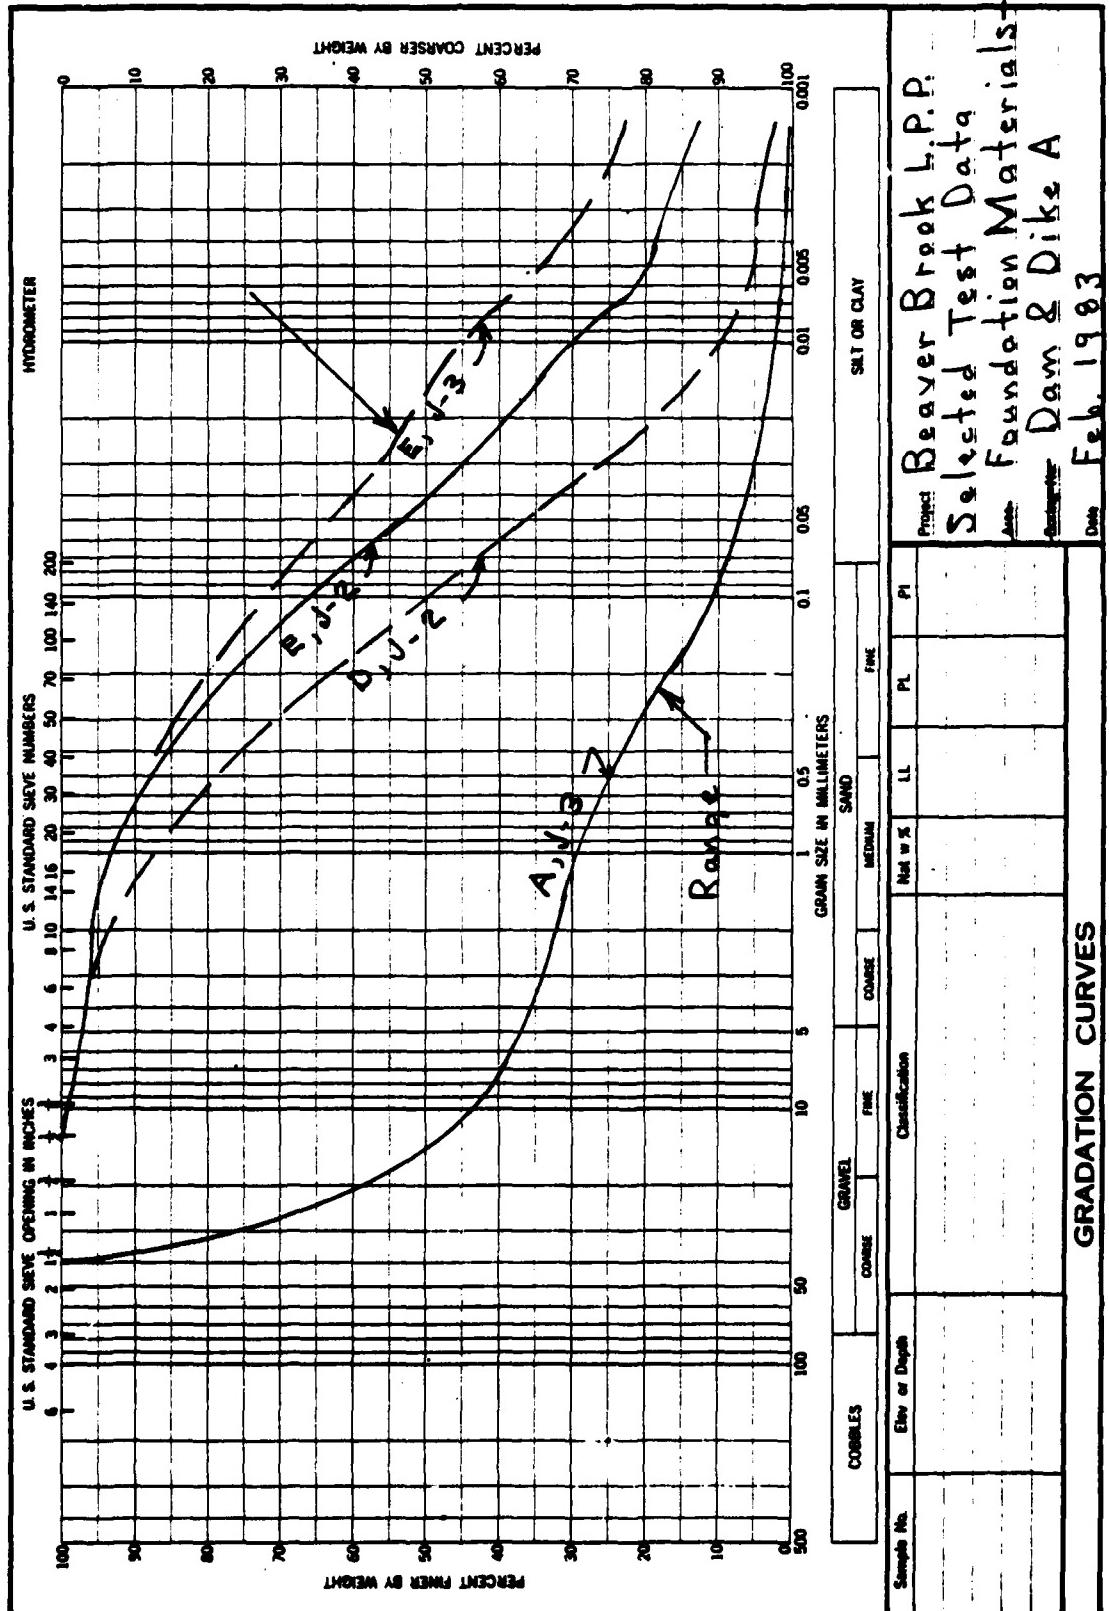


Plate No. B-2

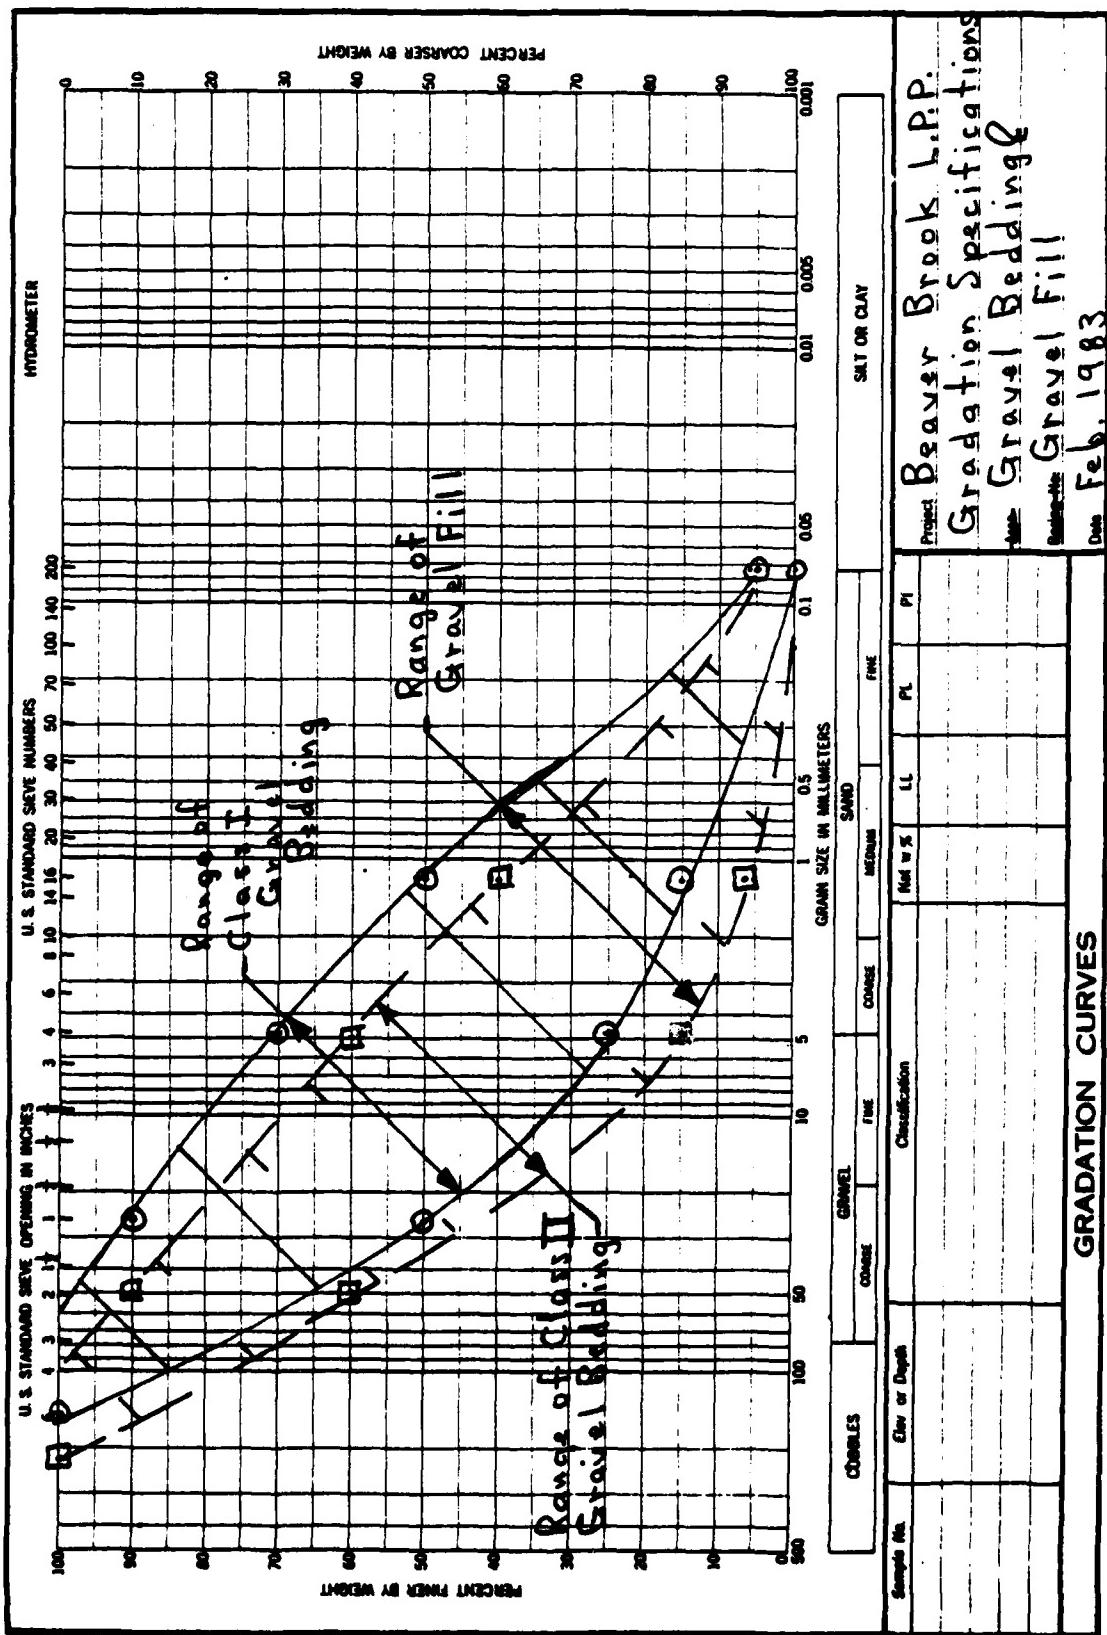
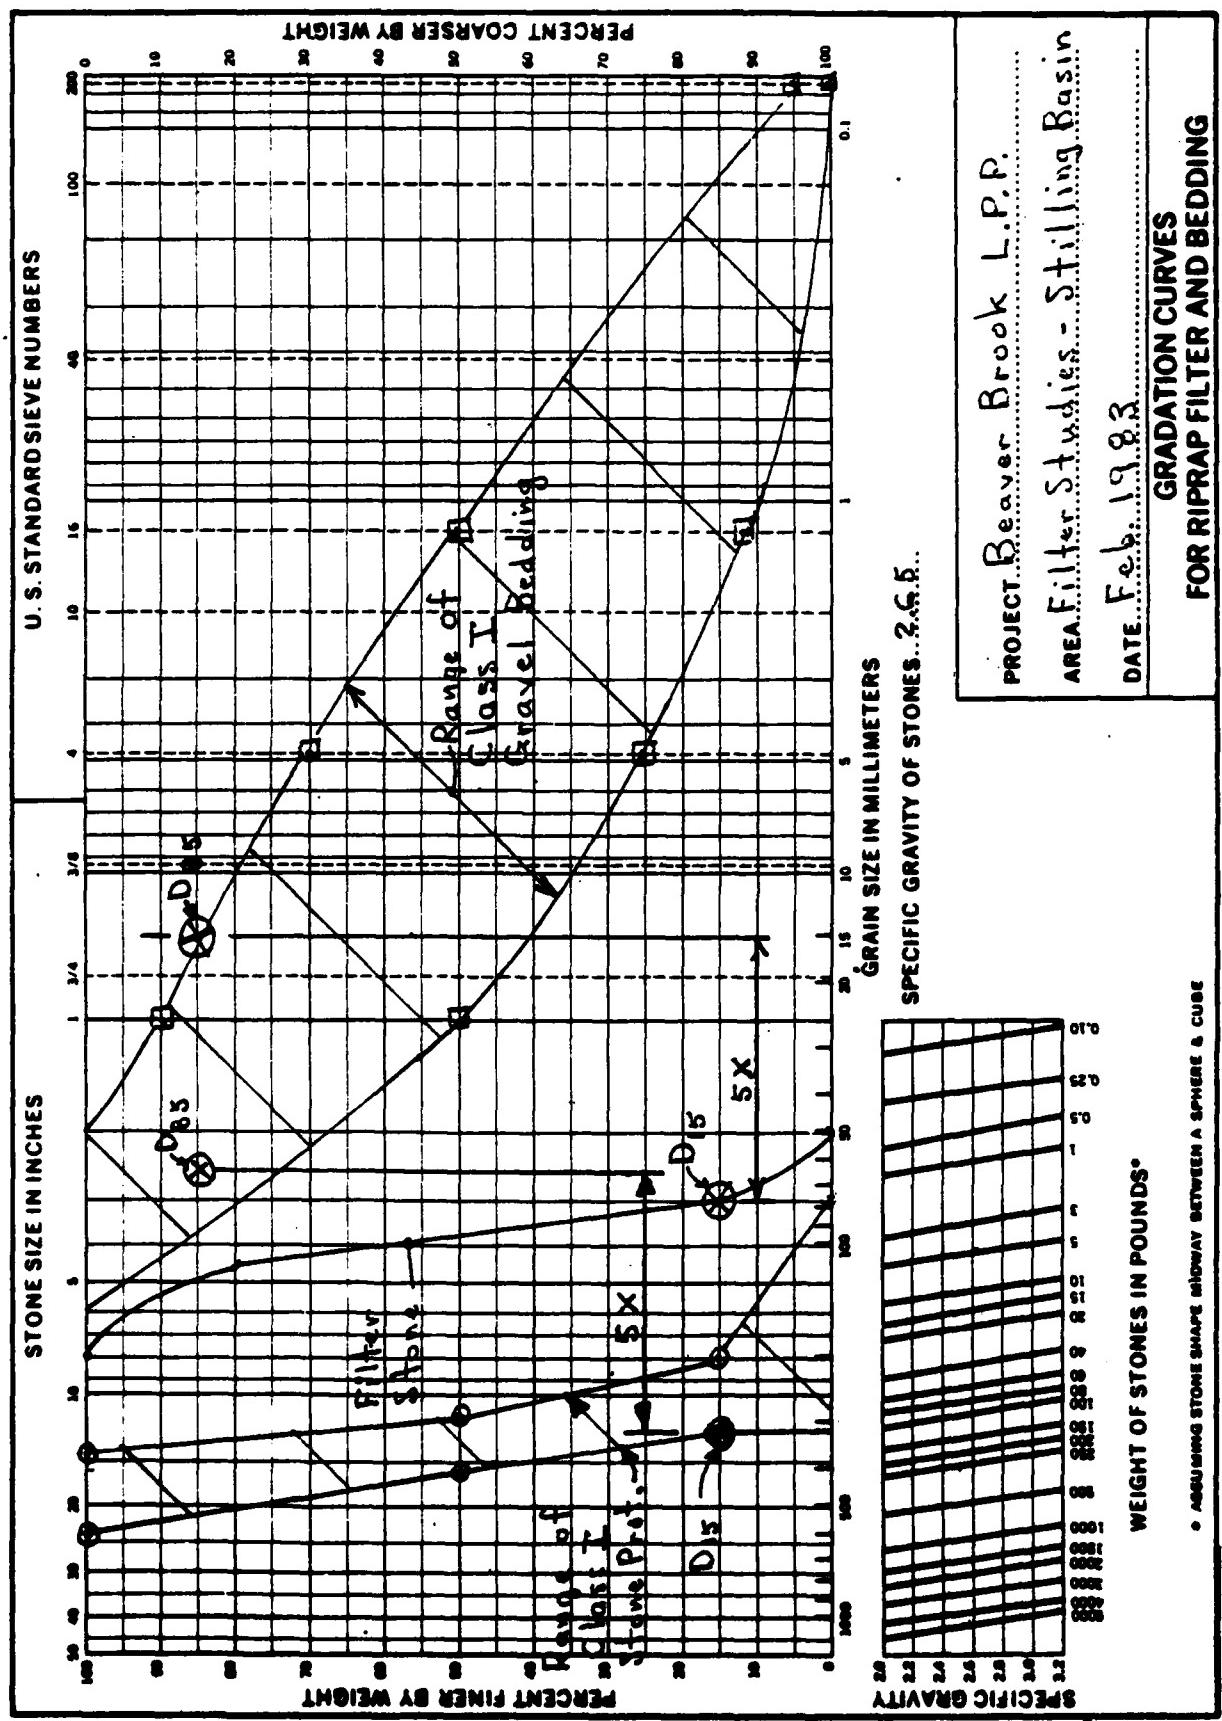


Plate 2. E-3



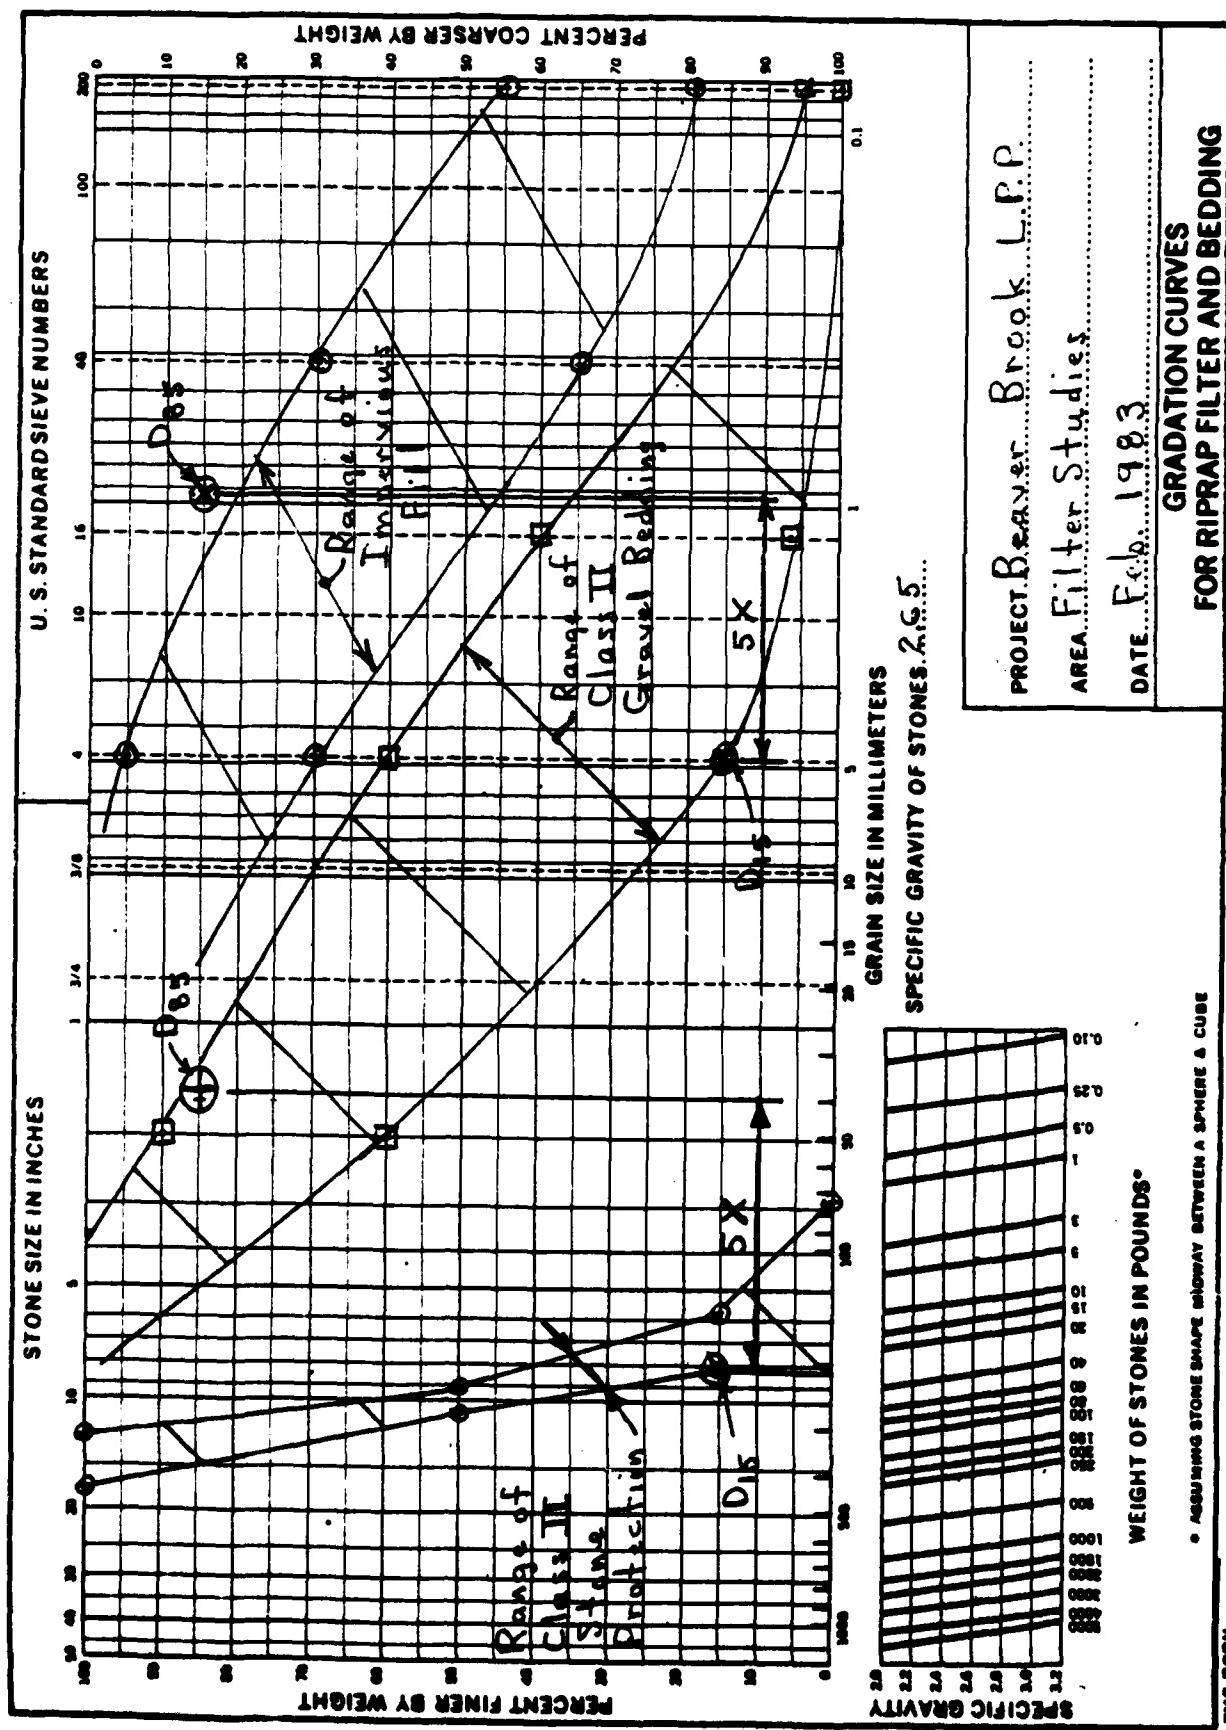


Plate No. B-5

Unclassified Excavation -

Dam & Dikes

Dike A = 10,800 cu

Dike B = 1,300

Dam = 6,100

Total = 18,200 cu

3,600 cu

Temp. Coff., Waste,
Topsoil
14,600 cu

Unclassified Excavation - Channel Improvement

Total = 10,500 cu

1,000 cu

Rock Excavation
Dam-Stilling
Basin = 600 cu

B.F.
1.2

Stone Protection
Dam Discharge
Channel = 700 cu

Stripping
& Waste
9,500 cu

MATERIAL TO BE FURNISHED
BY CONTRACTOR

Gravel Fill
Dike A
5,800 cu

Gravel Bedding
Dike A = 1,500
Dike B = 400
Channel = 2,100
Total = 4,000 cu

Topsoil
Dike A = 4,200
Dike B = 800
Channel = 1,500
Total = 6,500 cu

Impervious Fill
Dike = 7,500 cu

500cy

Balance Factor
0.8

Random Fills
Dike A = 1900cy
Dike B = 1000
Total = 2900cy

500cy

Balance Factor
0.8

Random Fill
Channel = 800cy

500cy
ste
500cy

BE FURNISHED
TRACTOR

Stone Protection
1. Class I SP
Dike A = 3,500
Dam = 700
SubTotal = 4,200cy

2. Class II SP
Channel = 3,400cy
Total 7,600cy

ious Fill
7,500cy

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION
CORPS OF ENGINEERS
WALTHAM, MASS

J H	BEAVER BROOK L.P.P.
D E S . B Y	MATERIALS USAGE
J D	CHART
D R . B Y	(PRELIMINARY)
J H	GEOTECH. ENG. BR. SCALE:
C R . B Y	SK. NO. DATE: 2/16/83

SOIL TESTS RESULTS

MED 510 * PROVIDENCE VIBRATED DENSITY TEST

TABLE I
Plate No. B-7

ROCK TEST RESULTS

Results of Absorption, Specific Gravity, and Unit Weight (ASTM C-97) are summarized below:

Sample	Schist FD-A(17')	Schist FD-C(8')	Granite FD-D-7.5')
Bulk Specific Gravity	2.766	2.832	2.636
Bulk Specific Gravity (SSD)	2.776	2.842	2.644
Apparent Specific Gravity	2.792	2.860	2.657
Dry Unit Weight (SSD)	173.22	177.34	164.99
Percent Absorption	0.33	0.34	0.31

Results of Compressive Strength of Natural Building Stone (ASTM C-170) are summarized below:

Sample	FD-A(17')	FD-C(8')	FD-D(7.5')
Unconfined Compressive Strength (psi)	6,700	10,600	24,800

Table 2

U. S. ARMY
CORPS OF ENGINEERS
NEW ENGLAND DIVISION

FIELD LOG OF TEST BORING

Site Beaver Brook

Page 1 of 3 Pages

Boring No. A Desig. FD-623 Diam. (Casing) 4

Co-ordinates. N _____ E _____

Elevation Top of Boring	M.S.L.	Hammer Wt. <u>300</u>	Boring Started <u>9-12-82</u>
Total Overburden Drilled	Feet	Hammer Drop <u>18</u>	
Elevation Top of Rock	M.S.L.	Casing Left <u>0</u>	Boring Completed <u>3-15-82</u>
Total Rock Drilled	Feet	Subsurface Water Data	Page _____
Elevation Bottom of Boring	M.S.L.	Obs. Well	<u>4.5'</u>
Total Depth of Boring	Feet	Drilled By <u>Briggs Engineering</u>	
Core Recovered <u>86</u> % No. Boxes <u>1</u>		Mfg. Date Drill <u>1980</u> Acker - Bombarier	
Core Recovered <u>14</u> Ft. <u>NX</u> Diam. <u>2 1/2</u> in.		Inspected By: <u>NA Lannan</u>	
Soil Samples <u>2</u> In. Diam. <u>7</u> No.		Classification By: <u>NA Lannan</u>	
Soil Samples	In. Diam.	Classification By:	<u>SP</u> <u>Lannan</u> <u>1982</u> <u>666-666</u>

DEPTH ft	CORE/SAMPLE			BLOWS PER FT. CORE REMOVED	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
	n	2	No.			
0		1	2	0	Drove 2" solid spoon sampler from 0' to 5' and recovered 18"	TOPSOIL
1				11		
2		44			Drove 4" casing to 5' and washed out casing with 3" roller bit	SANDY SILT slightly plastic, no cohesion, to fine sand, gray, stiff, damp, contains gravel, sandy infill
3		1A	2"	1		
4		2	2"	5		
5		2	2"	15	Drove 2" solid spoon sampler from 5 to 7.5' and recovered, 2'-4"	SANDY CLAY slightly plastic, no cohesion, to fine sand, stiff, gray, wet (CL) contains gravel.
6		2	2"	20	Bouncing refusal at 7.5' Drove 4" casing from 5 to 10' and washed casing with 4" roller bit. Could	
7		2	2"	32	not roller bit past	
8		2	2"	47		
9		2A	2"	9		
				100 ft		
				10.0'		

GENERAL REMARKS:

Site Beaver Brook Keene NH					Boring No. A	Page 2 of 3
DEPTH feet	CORE SAMPLE NO.	CORE SIZE inches	SLOW PER FT. TIME MINUTE	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS	
					10	15
0-2				Cored from 10' to 11' with NX double tube barrel and recovered 6"		
2-3	1	NX	10 15	Cored 11' with NX double tube barrel and recovered 6" Cored cobble. Drove 2" solid barrel sampler from 11.0 to 13.5' Battering refusal at 13.5' Recovered 20". Cored. thick boulder with roller bit & drove 4" coring bit 14.0' Refusal at 14"	Extra-sandy SILTY GLEY SUBANGULAR GRANULAR FOLIATED FRESH	(GP-60) COARSE SUBANGULAR GRANULAR FOLIATED FRESH
3-4	2	2"	11 12.5 13.5			TOP OF ROCK AT 14'
4-5	3	2"	11 12.5 13.5	Cored from 10 to 15' with NX double tube barrel and recovered nothing		
5-6				Cored from 15 to 20' with NX double tube barrel and recovered 60"	Biotite Schist, foliated, fresh to slightly weathered, hard, medium to coarse grained	
6-7	2	NX	15 20		18.8 foliation plane 19.7-17 gneiss vein	
7-8					17.5 foliation plane 18.0 ft w/ gneiss coating	
8-9					19.0 Foliation pt. joint	
9-10					19.4 ft w/ gneiss coating	
10-11					21.0 Foliation pt. joint	
11-12					22.75 Foliation plane pt	
12-13						
13-14						
14-15						
15-16						
16-17						
17-18						
18-19						
19-20						
20-21						
21-22						
22-23						
23-24						
24-25						
25-26						
26-27						
27-28						
28-29						
29-30						
30-31						
31-32						
32-33						
33-34						
34-35						
35-36						
36-37						
37-38						
38-39						
39-40						
40-41						
41-42						
42-43						
43-44						
44-45						
45-46						
46-47						
47-48						
48-49						
49-50						
50-51						
51-52						
52-53						
53-54						
54-55						
55-56						
56-57						
57-58						
58-59						
59-60						
60-61						
61-62						
62-63						
63-64						
64-65						
65-66						
66-67						
67-68						
68-69						
69-70						
70-71						
71-72						
72-73						
73-74						
74-75						
75-76						
76-77						
77-78						
78-79						
79-80						
80-81						
81-82						
82-83						
83-84						
84-85						
85-86						
86-87						
87-88						
88-89						
89-90						
90-91						
91-92						
92-93						
93-94						
94-95						
95-96						
96-97						
97-98						
98-99						
99-100						
100-101						
101-102						
102-103						
103-104						
104-105						
105-106						
106-107						
107-108						
108-109						
109-110						
110-111						
111-112						
112-113						
113-114						
114-115						
115-116						
116-117						
117-118						
118-119						
119-120						
120-121						
121-122						
122-123						
123-124						
124-125						
125-126						
126-127						
127-128						
128-129						
129-130						
130-131						
131-132						
132-133						
133-134						
134-135						
135-136						
136-137						
137-138						
138-139						
139-140						
140-141						
141-142						
142-143						
143-144						
144-145						
145-146						
146-147						
147-148						
148-149						
149-150						
150-151						
151-152						
152-153						
153-154						
154-155						
155-156						
156-157						
157-158						
158-159						
159-160						
160-161						
161-162						
162-163						
163-164						
164-165						
165-166						
166-167						
167-168						
168-169						
169-170						
170-171						
171-172						
172-173						
173-174						
174-175						
175-176						
176-177						
177-178						
178-179						
179-180						
180-181						
181-182						
182-183						
183-184						
184-185						
185-186						
186-187						
187-188						
188-189						
189-190						
190-191						
191-192						
192-193						
193-194						
194-195						
195-196						
196-197						
197-198						
198-199						
199-200						
200-201						
201-202						
202-203						
203-204						
204-205						
205-206						
206-207						
207-208						
208-209						
209-210						
210-211						
211-212						
212-213						
213-214						
214-215						
215-216						
216-217						
217-218						
218-219						
219-220						
220-221						
221-222						
222-223						
223-224						
224-225						
225-226						
226-227						
227-228						
228-229						
229-230						
230-231						
231-232						
232-233						
233-234						
234-235						
235-236						
236-237						
237-238						
238-239						
239-240						
240-241						
241-242						
242-243						
243-244						
244-245						
245-246						
246-247						
247-248						
248-249						
249-250						
250-251						
251-252						
252-253						
253-254						
254-255						
255-256						
256-257						
257-258						
258-259						
259-260						
260-261						
261-262						
262-263						
263-264						
264-265						
265-266						
266-267						
267-268						
268-269						
269-270						
270-271						
271-272						
272-273						
273-274						
274-275						
275-276						
276-277						
277-278						
278-279						
279-280						
280-281						
281-282						
282-283						
283-284						
284-285						
285-286						
286-287						
287-288						
288-289				</td		

LITERATURE

Giving No. A

Site: Beaver Brook Keene, NH				Boring No. A	Page <u>3</u> of <u>3</u>
DEPTH ft.	CORE/SAMPLE NO.	SIZE in.	DRILL NO.	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
25					
26	4 NX		25	Cored from 25 to 29 with NX double tube barrel and recovered 48"	
27			29		
28					
29					
30					
31					
32					
33					
34					
35					
36					
37					
38					
39					
40					
41					
42					
43					
44					
45					
46					
47					
48					
49					
50					
51					
52					
53					
54					
55					
56					
57					
58					
59					
60					
61					
62					
63					
64					
65					
66					
67					
68					
69					
70					
71					
72					
73					
74					
75					
76					
77					
78					
79					
80					
81					
82					
83					
84					
85					
86					
87					
88					
89					
90					
91					
92					
93					
94					
95					
96					
97					
98					
99					
100					
101					
102					
103					
104					
105					
106					
107					
108					
109					
110					
111					
112					
113					
114					
115					
116					
117					
118					
119					
120					
121					
122					
123					
124					
125					
126					
127					
128					
129					
130					
131					
132					
133					
134					
135					
136					
137					
138					
139					
140					
141					
142					
143					
144					
145					
146					
147					
148					
149					
150					
151					
152					
153					
154					
155					
156					
157					
158					
159					
160					
161					
162					
163					
164					
165					
166					
167					
168					
169					
170					
171					
172					
173					
174					
175					
176					
177					
178					
179					
180					
181					
182					
183					
184					
185					
186					
187					
188					
189					
190					
191					
192					
193					
194					
195					
196					
197					
198					
199					
200					
201					
202					
203					
204					
205					
206					
207					
208					
209					
210					
211					
212					
213					
214					
215					
216					
217					
218					
219					
220					
221					
222					
223					
224					
225					
226					
227					
228					
229					
230					
231					
232					
233					
234					
235					
236					
237					
238					
239					
240					
241					
242					
243					
244					
245					
246					
247					
248					
249					
250					
251					
252					
253					
254					
255					
256					
257					
258					
259					
260					
261					
262					
263					
264					
265					
266					
267					
268					
269					
270					
271					
272					
273					
274					
275					
276					
277					
278					
279					
280					
281					
282					
283					
284					
285					
286					
287					
288					
289					
290					
291					
292					
293					
294					
295					
296					
297					
298					
299					
300					
301					
302					
303					
304					
305					
306					
307					
308					
309					
310					
311					
312					
313					
314					
315					
316					
317					
318					
319					
320					
321					
322					
323					
324					
325					
326					
327					
328					
329					
330					
331					
332					
333					
334					
335					
336					
337					
338					
339					
340					
341					
342					
343					
344					
345					
346					
347					
348					
349					
350					
351					
352					
353					
354					
355					
356					
357					
358					
359					
360					
361					
362					
363					
364	</td				

U. S. ARMY
CORPS OF ENGINEERS
NEW ENGLAND DIVISION

FIELD LOG OF TEST BORING

Site Beaver Brook, Keene NH Page 1 of 3 Pages

Boring No. C Desig. ED-22-1 Diam. (Casing) 4.0"

Co-ordinates. N E

Elevation Top of Boring	M.S.L.	Hammer Wt.	<u>300 lb</u>	Boring Started	<u>3-9-62</u>
Total Overburden Drilled	Foot	Hammer Drop	<u>18 in</u>	Boring Completed	<u>3-12-62</u>
Elevation Top of Rock	M.S.L.	Casing Left	<u>0</u>		
Total Rock Drilled	Foot	Subsurface Water Data	<u> </u>	Page	<u> </u>
Elevation Bottom of Boring	M.S.L.	Obs. Well	<u> </u>		
Total Depth of Boring	Foot	Drilled By	<u>PLACE ENGINEERING</u>		
Core Recovered	%	Mfg. Des. Drill	<u>ACKER - TRACE MOUNTED</u>		
Core Recovered	ft.	Inspected By	<u>RONALD F. BURACKI</u>		
Soil Samples	in. diam.	Classification By	<u>RONALD F. BURACKI (M. L.)</u>		
Soil Samples	in. diam.	Classification By	<u>J. R. GREGG (ED-22-1)</u>		

DEPTH feet ft. /'	CORE/SAMPLE NAME	SIZE INCHES	DEPTH CORE RECV'D	BLOWS PER FT. CORE	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
15	S-1 lot 1	2.0"	0.0 to 0.5'	10	DROVE 2.0" ID X 5.0' SOLID SPONG SAMPLER FROM GROUND SURFACE TO 0.5" USING 300 lb HAMMER DROPPED 18". BOUNCING REFUSAL AT 0.5". RECOVERED APPROXIMATELY 1.3".	SURFACE: SURFACE FEATURE OBSCURED BY 30" OF SNOW. DEPTH OF WATER AT BORING LOCATION WAS 1.2' BENEATH ICE AND SNOW. SEVERAL LARGE COBBLES WERE VISIBLE IN WATER AT BORING LOCATION. <u>BROWN, SANDY (GP-6M)</u> <u>S-1: SILTY GRAVEL</u> , coarse TO FINE SUBANGULAR GRAVEL, NO-PEAT, CONCRETE CHIPS, 0-10% UNDULATES PLATES, SATURATED, BROWN; (0-5').
46	S/A lot 1	2.0"	0.5'	36	DROVE 4.0" CASING FROM GROUND SURFACE TO 4.5'. AT WHICH POINT BOUNCING REFUSAL WAS ENCOUNTERED. PROBE ATTEMPTED 2' FROM CASING TOWARD DAM CENTER LINE USING "AN" DRILL ROB. DRIVE RODS TO REFUSAL	<u>S-1A: DECOMPOSED SHIST,</u> HIGHLY MICACEOUS, COLOR BROWN.
49			1'	11	AT 5.5': ASSUMED TOP OF ROCK AND CORING OPERATIONS WERE STARTED FOLLOWING THE WASHING OUT OF THE CASING USING A ROLLER ROCK BIT.	<u>S-1B: HIGHLY WEATHERED</u> <u>SHIST,</u> 2" SEAM OF GRAVELLY SILT OVERLYING, LOW PLASTICITY, 30-50% FINE SURROUNDED GRAVEL. GRAY, (ML), MICACEOUS SHIST, THIN LAYERS OF QUARTZ TO 1/2" THICK, gray.
78	S-1B lot 1	2.0"	30'	44		
82		2.0"	45'	25/ 0.5'		
					GENERAL REMARKS: BREAKS ON CASING FOR 300 lb HAMMER DROPPED 24 in	

55 Test)

Boring No. C

B-10

SNC Beaver Brook Dam
Keene, NH

Boring No.

Page 2
of 2

DEPTH feet	CORE/SAMPLE NO.	TYPE NO.	LOGS NO. FT. REMOVED	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
5.0'		NX	45 to 75	Cored with NX double tube barrel from 4.5 to 7.5' and recovered 30"	SCHIST, gray, micaceous, fresh to slightly weathered, hard, medium to coarse grained 5.6-5.75 fractured zone 6' foliation plane gt 6.1-6.3 fractured zone 6.5 foliation plane gt
7.5'	RUN	NX	7.5 to 10	Cored with NX double tube barrel.. from 7.5' to 12.5' and recovered 60"	7' foliation plane gt 8.3 " " " 9.8 " " " 10.2 " " "
12.5'				Cored with NX double tube barrel from 12.5' to 17.5' and recovered 56"	12.8 foliation plane gt 12.5-13 highly fractured zone

Site: Beaver Brook Dam
Keene, NH

Boring No.

Report
No. 3

DEPTH ft. + 2'	CORE/SAMPLE NO. DIA.	SIZE mm. DIA.	COAT. THICK. mm.	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
13					13.25 Foliation plane gt
14	RN 3	NX	12.5 to 17.5	60"	14.25 Foliation plane gt
15					14.75 " " "
16					16. Foliation plane gt 16.25 " " "
17					
18	RN 4	N X	17.5 to 19.5	18"	Cored with NX double tube barrel from 17.5' to 19.5' and recovered 18"
19					17.5-19.5 Fractured zone
20				End of Boring at	19.5'

2" DIA. Test)

Boring No. C

U. S. ARMY
CORPS OF ENGINEERS
NEW ENGLAND DIVISION

FIELD LOG OF TEST BORING

Site Beaver Brook Dam Page 1 of 2 Pages

Boring No. D Desig. ED-82-2 Diam. (Casing) 4"

Co-ordinates. N _____ E _____

Elevation Top of Boring _____ M.S.L. Hammer Wt. 300 Boring Started 3-11-82
 Total Overburden Drilled 5.3 Feet Hammer Drop 18" Boring Completed 3-12-82
 Elevation Top of Rock _____ M.S.L. Casing Loft 0
 Total Rock Drilled 15 Feet Subsurface Water Date 275' Page _____
 Elevation Bottom of Boring _____ M.S.L. Obs. Well _____
 Total Depth of Boring 20.5 Feet Drilled By Krupp Engineering
 Core Recovered 04 % No. Boxes 1 Mfg. Due Drill Acker Bomber
 Core Recovered 14 ft. NX Diam. 2 1/2 in. Inspected By NA Lanney
 Soil Samples 2 1/2 in. Diam. 3 No. Classification By NA Lanney
 Soil Samples in. Diam. No. Classification By Krupp Engineering Lab

DEPTH	CORE/SAMPLE			SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
	No.	RE	SIZE		
0.5	1	2"	0	Drove 2" solid spoon sampler from 0 to 3.5'. Refusal at 3.5'. Recovered 18".	TOPSOIL SANDY SILT, slightly plastic, 20-25% sand, few roots, brown, saturated, granular, silty w/f sand (SM)
2	1A	2	0.5	Moved hole 6" and drove 4" casing to 4.5' and washed out casing with 3" roller bit	
4					
4.5	2	2"	4.5	Drove 2" solid spoon sampler from 4.5 to 5.5'. Refusal at 5.5'. Recovered 6"	Silty mt. sand (SM) shallow, slightly weathered, 10-20% fine sand, gray-brown, saturated with water
5.5				Top of soil at 5.5'	
6	Run 1	NX	5.5	Cored from 5.5 to 8.5' with NX double tube barrel and recovered 36"	GRANITE, light gray, sound, very hard, fine-grained, 6-6 30° joint
8	Run 2	NX	8.5	Cored from 8.5 to 9.5 with NX double tube barrel and recovered 30"	9.0 Rust stain joint
10					
GENERAL REMARKS:					

55 (Test)

Boring No. D

B-11.

Site Beaver Brook
Keene, NH

Boring No.

Page 5
of 2

DEPTH ft. m.	CORE/SAMPLE NO. Run	BLDG NO.	BLDG NO.	BLDG NO.	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
0.0					Cored from 9.5 to 14.5 with double tube NX core barrel and recovered 60"	
3	3	NX	14.5			Inter-bedded GRANITE (1.1) s and BIOTITE SCHIST, foliated, fresh, hard, medium to fine grained.
12						11.0 ftmt
14						11.7 foliation plane at 12.0 clay coated at
16	4	NX	14.5	15.5	Cored from 14.5 to 15.5 with double tube NX core barrel and recovered 11"	12.8 " " "
18	5	NX	15.5	20.5	Cored from 15.5 to 20.5 with NX double tube barrel Recovered 58	12.7 rust std at 13.0 clay coated at 14.3 ft 15.25-15.5 clay stain 16.5-17 highly fractured zone
20					End of Boring at 20.5'	19.25 Clay coated at 19.75 " " "
22						

2000' DEM Test

Boring No. D

U. S. ARMY
CORPS OF ENGINEERS
NEW ENGLAND DIVISION

FIELD LOG OF TEST BORING

Site Beaver Brook

Page 1 of 2 Pages

Boring No. 5 Design FD-224 Diam. (Casing) 4"

Co-ordinates. N _____ E _____

Elevation Top of Boring	M.S.L.	Hammer Wt. 300	Boring Started 3-15-82
Total Penetration Drilled	Foot	Hammer Drop 18'	
Elevation Top of Rock	M.S.L.	Casing Loft 0	Boring Completed 3-16-82
Total Rock Drilled	Foot		Subsurface Water Data _____ Page _____
Elevation Bottom of Boring	M.S.L.		Obs. Well _____
Total Depth of Boring	Foot		Drilled By Bridge Engineering
Core Recovered 100 % No. Boxes 1			Mfg. Des. Drill A.C.I.M. - Bomboiller
Core Recovered 5 ft. NX Diam. 2 1/8 in.			Inspected By N.A. Lanney
Soil Samples 2 1/2 in. Diam. 3 No.			Classification By N.A. Lanney
Soil Samples 2 in. Diam. 3 No.			Classification By Major Ned Hall Lab 6/1/82

DEPTH	CORE/SAMPLE			SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS
	No.	Size	Depth Core Recvd		
0	1	2 1/2	0	Drove 2 1/2" Solid barrel Sampler from 0' to 10' and recovered	TOPSOIL
10			1	17' 30"	
10	2	2 1/2	1	23'	SANDY CLAY, slightly plastic, coarse fine sand olive gray, stiff (CL) GLACIAL TILL
10			2		
10	3	2 1/2	2		
10			3		
10	4	2 1/2	4		
10			5	Drove 2" Solid barrel Sampler from 5' to 10' and recovered	SANDY CLAY, slightly plastic, coarse fine sand, traces of gravel, olive gray, stiff (CL) GLACIAL TILL
10			6	30' Drove 4" Casing to 10' and washed out casing with 3 1/2" chipping bit	
10	7	2 1/2	7		
10			8		
10	8	2 1/2	8		
10			9		
10	9	2 1/2	9		
10			10		
10	10	2 1/2	10		
10			11		
10	11	2 1/2	11		
10			12		
10	12	2 1/2	12		
10			13		
10	13	2 1/2	13		
10			14		
10	14	2 1/2	14		
10			15		
10	15	2 1/2	15		
10			16		
10	16	2 1/2	16		
10			17		
10	17	2 1/2	17		
10			18		
10	18	2 1/2	18		
10			19		
10	19	2 1/2	19		
10			20		
10	20	2 1/2	20		
10			21		
10	21	2 1/2	21		
10			22		
10	22	2 1/2	22		
10			23		
10	23	2 1/2	23		
10			24		
10	24	2 1/2	24		
10			25		
10	25	2 1/2	25		
10			26		
10	26	2 1/2	26		
10			27		
10	27	2 1/2	27		
10			28		
10	28	2 1/2	28		
10			29		
10	29	2 1/2	29		
10			30		
10	30	2 1/2	30		
10			31		
10	31	2 1/2	31		
10			32		
10	32	2 1/2	32		
10			33		
10	33	2 1/2	33		
10			34		
10	34	2 1/2	34		
10			35		
10	35	2 1/2	35		
10			36		
10	36	2 1/2	36		
10			37		
10	37	2 1/2	37		
10			38		
10	38	2 1/2	38		
10			39		
10	39	2 1/2	39		
10			40		
10	40	2 1/2	40		
10			41		
10	41	2 1/2	41		
10			42		
10	42	2 1/2	42		
10			43		
10	43	2 1/2	43		
10			44		
10	44	2 1/2	44		
10			45		
10	45	2 1/2	45		
10			46		
10	46	2 1/2	46		
10			47		
10	47	2 1/2	47		
10			48		
10	48	2 1/2	48		
10			49		
10	49	2 1/2	49		
10			50		
10	50	2 1/2	50		
10			51		
10	51	2 1/2	51		
10			52		
10	52	2 1/2	52		
10			53		
10	53	2 1/2	53		
10			54		
10	54	2 1/2	54		
10			55		
10	55	2 1/2	55		
10			56		
10	56	2 1/2	56		
10			57		
10	57	2 1/2	57		
10			58		
10	58	2 1/2	58		
10			59		
10	59	2 1/2	59		
10			60		
10	60	2 1/2	60		
10			61		
10	61	2 1/2	61		
10			62		
10	62	2 1/2	62		
10			63		
10	63	2 1/2	63		
10			64		
10	64	2 1/2	64		
10			65		
10	65	2 1/2	65		
10			66		
10	66	2 1/2	66		
10			67		
10	67	2 1/2	67		
10			68		
10	68	2 1/2	68		
10			69		
10	69	2 1/2	69		
10			70		
10	70	2 1/2	70		
10			71		
10	71	2 1/2	71		
10			72		
10	72	2 1/2	72		
10			73		
10	73	2 1/2	73		
10			74		
10	74	2 1/2	74		
10			75		
10	75	2 1/2	75		
10			76		
10	76	2 1/2	76		
10			77		
10	77	2 1/2	77		
10			78		
10	78	2 1/2	78		
10			79		
10	79	2 1/2	79		
10			80		
10	80	2 1/2	80		
10			81		
10	81	2 1/2	81		
10			82		
10	82	2 1/2	82		
10			83		
10	83	2 1/2	83		
10			84		
10	84	2 1/2	84		
10			85		
10	85	2 1/2	85		
10			86		
10	86	2 1/2	86		
10			87		
10	87	2 1/2	87		
10			88		
10	88	2 1/2	88		
10			89		
10	89	2 1/2	89		
10			90		
10	90	2 1/2	90		
10			91		
10	91	2 1/2	91		
10			92		
10	92	2 1/2	92		
10			93		
10	93	2 1/2	93		
10			94		
10	94	2 1/2	94		
10			95		
10	95	2 1/2	95		
10			96		
10	96	2 1/2	96		
10			97		
10	97	2 1/2	97		
10			98		
10	98	2 1/2	98		
10			99		
10	99	2 1/2	99		
10			100		
10	100	2 1/2	100		
10			101		
10	101	2 1/2	101		
10			102		
10	102	2 1/2	102		
10			103		
10	103	2 1/2	103		
10			104		
10	104	2 1/2	104		
10			105		
10	105	2 1/2	105		
10			106		
10	106	2 1/2	106		
10			107		
10	107	2 1/2	107		
10			108		
10	108	2 1/2	108		
10			109		
10	109	2 1/2	109		
10			110		
10	110	2 1/2	110		
10			111		
10	111	2 1/2	111		
10			112		
10	112	2 1/2	112		
10			113		
10	113	2 1/2	113		
10			114		
10	114	2 1/2	114		
10			115		
10	115	2 1/2	115		
10			116		
10	116	2 1/2	116		
10			117		
10	117	2 1/2	117		
10			118		
10	118	2 1/2	118		
10			119		
10	119	2 1/2	119		
10			120		
10	120	2 1/2	120		
10			121		
10	121	2 1/2	121		
10			122		
10	122	2 1/2	122		
10			123		
10	123	2 1/2	123		
10			124		
10	124	2 1/2	124		
10			125		
10	125	2 1/2	125		
10			126		
10	126	2 1/2	126		
10			127		
10	127	2 1/2	127		
10			128		
10	128	2 1/2	128		
10			129		
10	129	2 1/2	129		
10			130		
10	130	2 1/2	130		
10			131		
10	131	2 1/2</			

SITE Beaver Brook
Keene NH

Boring No.

Page 2
of 2

Site: Beaver Brook Keene, NH					Boring No.	E	Page <u>2</u> of <u>2</u>
DEPTH feet below surface	DEPTH in. 2'	CORE/SAMPLE NO.	DIAM. IN. 2"	DRILL NO. 2	SAMPLING AND CORING OPERATIONS	CLASSIFICATION OF MATERIALS	
10	10	10	14	Drove 2" solid barrel samples from 10 to 14' and took sample Recovered 24" Drove 4" casing to 13.5' and washed out Casing with Chopping bit	CLAYEY SILT , slightly to hard plastic, 13-19% sand & 3% gravel, stiff, dark gray-green GLACIAL TILL sandy, clay (CL) with gravel		
12	12	13	2"	14	40		
14	14				47		
16	16	N	14			TOP OF ROCK AT 14' GRANITE, slightly weathered, hard, fine-grained, clay filled joints 14-14.5 fractured zone 15.5-16, 16.5-17 fractured zones 12.5 joint 13.0 joint 18.5, 19 joints	
18	18	X	19				
20	20						
						END OF BORING AT 19'	

SECTION C

ECONOMIC ANALYSIS

Economic Analysis

Beaver Brook

Keene, NH

Table of Contents

<u>Subject</u>	<u>Page No.</u>
Methodology	C-1
Flood Losses	C-1
Character of the Flood Area	C-1
Recurring Losses	C-2
Growth and Development	C-3
Costs	C-4
Benefits	C-4
Flood Damage Reduction Benefits	C-4
Floodwarning Benefits	C-4
Affluence Benefits	C-5
Summary of Benefits	C-7
Justification	C-8

ECONOMICS OF THE SELECTED PLAN

This section presents the economic analysis of the flood control plans selected for detailed evaluation. The methodology of the benefit-cost analysis is explained; the annual costs and benefits are presented; and, the benefit-cost ratio is calculated. The contents of this section focus on those facets of the proposed improvements which can be quantified in dollar values.

METHODOLOGY

The economic analysis of the proposed improvements provides an essential function in the evaluation of a comprehensive flood control program for the project area. Comparing the average annual costs (i.e. interest, amortization and operation and maintenance) to an estimate of the average annual benefits, which are anticipated to occur over the 100-year life of the project, provides a measure of the economic viability of project alternatives. The benefits should equal or exceed the costs for the Federal government to participate in the project.

The development of costs and benefits in this report follows standard Corps of Engineers practice. The value of all goods and services used in the project is estimated on the cost side, while on the benefit side, damages prevented are estimated. The assessment of damages prevented is based on flood damage surveys which provide dollar estimates of both physical and nonphysical losses related to various stages or elevations of flooding. These losses are then related to stage-frequency data which result in expected losses on an annual basis. Annual benefits are calculated by determining the reduction in annual losses that would occur with the project.

The value of future benefits and costs are made comparable by conversion to an equivalent time basis using the Federal interest rate of 7-7/8 percent which is mandated by law for water resource projects. The net effect of converting benefits and costs in this manner is the development of comparable average annual values. All costs and benefits are expressed at February 1983 price levels.

FLOOD LOSSES

The potential flood damages for Keene were determined by damage survey specialists who estimated the physical and nonphysical losses to properties in the flood plain based on various elevations of flooding. The flood plain area of Keene was divided into six zones for purposes of analysis. The divisions were based upon hydrologic considerations.

Character of the Flood Area

The floodprone area along Beaver Brook extends from its confluence with the Branch River upstream about 6.8 miles to the north corporate

limit of Keene. The flood damage zones have been numbered 0 through 5. The zone farthest downstream has been numbered Zone 0, with Zones 1 through 5 proceeding upstream.

Zone 0 starts at the confluence of Beaver Brook and the Branch River and extends a distance of 800 feet upstream to the Rt. 101 Bypass. Losses to both residential and commercial properties have been experienced in this zone. Zone 1 extends 2350 feet from the Rt. 101 Bypass to Marlboro Street and also encompasses residential and commercial losses. Zone 2 is the area from Marlboro Street to the B&M Railroad Bridge, a distance of 1400 feet. Damages to residential, commercial and industrial properties in this zone are approximately 21 percent of the total average annual losses. Zone 3 extends for a distance of 2350 feet between the B&M Railroad Bridge and Roxbury Street and like Zone 2 involves damages to residential, commercial, and industrial properties. Losses in Zone 3 make up 50 percent of the total average annual losses in the study area. Zone 4 extends 1200 feet from Roxbury Street to Beaver Street and sustains flood damages to residential properties. Zone 5 is the area upstream of Beaver Street to the corporate limit, a distance of 27,700 feet. Damage to residential, commercial, public and industrial properties in this zone account for about 15 percent of the total average annual losses.

Table 1 summarizes property types by zones within the SPF flood plain.

Table 1
The SPF Flood Plain
Property Type per Zone
Beaver Brook, Keene, N.H.
(numbers of structures)

Zones	Residential	Commercial	Industrial	Public	Total
Zone 0	8	8	-	-	16
Zone 1	139	5	-	-	144
Zone 2	77	11	3	-	91
Zone 3	95	17	9	-	121
Zone 4	51	-	-	-	51
Zone 5	14	4	1	1	20
Total	384	45	13	1	443

Recurring Losses

Losses by stages referenced to the record flood level were tabulated for the floodprone area. When related to frequencies, recurring losses for various storms are obtained. Losses for each zone for 20, 50 and 100 year events are provided below. (Table 2)

Table 2
Recurring Losses
Beaver Brook
(\$000's, Feb. 1983 price level)

<u>Zones</u>	<u>Event</u>		
	<u>20 year</u>	<u>50 year</u>	<u>100 year</u>
0	\$51.0	\$148.0	\$180.6
1	16.9	63.1	99.9
2	301.9	1,134.3	1,798.0
3	1,244.6	1,435.9	1,664.1
4	134.2	205.4	281.2
5A	37.0	64.5	77.5
5B	158.6	209.5	260.7
TOTAL	\$1,944.2	\$3,198.2	\$4,362.0

Losses are fairly evenly distributed among the three major damage categories: residential, commercial, industrial. A small proportion of losses are experienced in the public category. Percent losses for these categories for each storm are presented below.

<u>Recurring Losses by category</u> (percent of total per event)			
	<u>20 year</u>	<u>50 year</u>	<u>100 year</u>
Residential	32.3%	30.6%	30.0%
Commercial	27.7	27.6	29.4
Industrial	38.4	40.4	39.3
Public	1.6	1.4	1.2

Growth and Development

Population projections have been provided by the City of Keene. These projections indicate modest growth of about 10 percent over the 40 year period from 1980 to 2020 and are shown below.

1990	23,500
2000	25,600
2010	-
2020	29,900

Although significant future development is likely throughout Keene, development in the Beaver Brook flood plain would be limited. This limitation is mostly a result of the lack of available land. Anticipated development near the flood plain would be in commercial uses, resulting from redevelopment activities in the central business district.

COSTS

First costs for each plan are presented in the main report. Investment costs were also included by adding the cost of interest during construction. Total investment costs for each plan are as follows: Plan A, \$1,704,300; Plan B, \$30,600; and Plan C, \$1,734,900. These costs are proportioned between the Federal government and non-Federal interests. This proportionment is also displayed in the main report.

Estimates of annual costs are based on a 100-year period of analysis at a 7-7/8 percent interest rate. Annual costs include expenditures for annual maintenance and funding for periodic replacement of equipment. Annual costs for Plan A are \$135,800; Plan B, \$5,300; and Plan C, \$141,100.

BENEFITS

Flood Damage Reduction Benefits

The main benefit accruing to the proposed project is flood damage reduction. The flood damage reduction benefits are determined by taking the difference between annual losses under the without project conditions and residual annual losses anticipated with the alternative plans. This includes both physical and nonphysical losses prevented for activities located within the flood plain. Table 3 shows the average annual losses expected without a project (the natural conditions), the average annual losses remaining with project alternatives (residual losses), and the average annual benefits attributed to the project. Residual losses and benefits have been categorized by project features; namely, flood storage, channel improvements and floodwarning. Average annual losses are the average losses estimated over a period of time based on the probability of occurrence of floods of different magnitudes. Sample stage-damage and damage-frequency relationships for Zone 1 are graphically displayed on Plates C-1 and C-2 at the end of this section.

Floodwarning Benefits

Benefits to a floodwarning plan are the reduction of flood damages by the movement of damageable goods and property when a floodwarning has been issued.

The actual dollar value of the benefit is measured as the difference between damages with and without the floodwarning plan. Individual damage survey sheets for the flood plain properties were consulted to determine the amount of recurring damage to potentially moveable items. Conditions along Beaver Brook would allow for 3 hours of lead time to prepare for the flood.

For residential properties the following assumptions were made: 1) 75 percent of total recurring residential losses are physical, 2) 10 percent of physical losses are to moveable contents, 3) 50 percent of these losses could be eliminated with floodwarning. These resulted in an annual benefit for residential properties in each zone as follows:

Reach 0	\$ 347
1	183
2	357
3	2,539
4	899
5a	35
5b	1,706
Total	\$6,066 - say \$6,100

For commercial and industrial properties, a similar set of assumptions were developed as follows: 1) 50 percent of physical damages are to contents and equipment, 2) 10 percent of contents could or would be moved once a floodwarning has been disseminated, 3) reduction in losses is halved by costs incurred with activating a preparedness plan. Annual benefits (losses prevented) for each zone are as follows:

Reach 0	\$40
1	-
2	1,036
3	2,714
4	-
5a	26
5b	112
Total	\$3,928 - say \$3,900

The total annual benefit for the floodwarning plan alone would approximate \$10,000. When acting in conjunction with structural elements as in Plan C, the floodwarning feature adds about \$5,430 to total project benefits.

Affluence Benefits

Affluence benefits are future benefits based on the rate of increase in the real value of flood-susceptible household contents. The OBERS regional growth rate for per capita income is used as the basis for increasing the real value of residential contents. OBERS information shows that per capita income in Cheshire County (non-SMSA part of BEA Economic Area 006) is expected to increase from \$4,800 in 1978 to \$14,000 in the year 2030. This amounts approximately to a 2-1/8 percent average annual compound growth rate.

Using WRC regulations as a guide, the value of contents may not exceed 75 percent of the structural value of the residence. Homes in the Beaver Brook flood plain include about half single family and half 2 or

more family dwelling units. Some single family homes are quite large; many of the 2 family homes were once single homes. Data provided by the city assessor places an average value of \$45,000 for the homes in the Beaver Brook area.

From an examination of damage survey sheets for residential properties, an average contents value is estimated at 40 percent of total structure value. The following equation therefore holds true:
 $.40X$ (growth factor) = $.75X$ where X = residential structure value.
Solving the equation for the growth factor reveals that the contents value can be expected to increase by a factor of 1.875. At an annual compound growth rate of 2-1/8 percent it will take approximately 30 years for the contents value to grow to 75 percent of the structural value of a residence. Since it will take 30 years from the 1978 survey date for content value to reach 75 percent of structural value, and project completion is anticipated in 1985, the affluence growth reaches the 75 percent level during the 23rd year of the project life.

Although potential contents losses can be expected to increase in the future, other losses to residential structures will remain relatively constant. As contents value reaches 75 percent of the structural value, the overall growth factor for total physical residential losses will amount to 1.25. This is shown below:

	<u>STRUCTURAL VALUE</u>	<u>CONTENT VALUE</u>	<u>TOTAL</u>
Present:	Y	$.4Y$	$= 1$
$.4Y$			
Future:	Y	$.75Y$	$= 1$
$.75Y$			

$$\begin{aligned}1.4Y \text{ (growth factor)} &= 1.75Y \\ \text{growth factor} &= 1.75Y + 1.4Y \\ \text{growth factor} &= 1.25\end{aligned}$$

This factor was applied to physical residential losses and annualized for both without and with project conditions. The increase in losses due to the application of the affluence factor in each zone is exhibited in the following table.

Table 4
Increased Losses and Benefits Due to Affluence
February 1983, price level
(no discounting)

Zone	<u>Increase in Annual</u>	<u>Increase in Annual</u>	<u>Increase in</u>
	<u>res. losses</u> <u>without project</u>	<u>res. losses with</u> <u>Storage & Channel</u>	<u>Benefits</u>
0	\$ 1,310	\$ 680	\$ 630
1	690	400	290
2	1,460	800	660
3	9,570	3,710	5,860
4	3,400	1,740	1,660
5	6,250	6,120	130
Total	22,680	13,450	9,230

These benefits are realized after the contents value reaches 75 percent of structural value during the 23rd year of project life. Therefore, the benefits are discounted at an interest rate of 7-7/8 percent and a 100-year project life.

These benefits are summarized below at the following points of reference: P_N - Existing Condition, P_1 - first year of project life, and P_{100} - last year of project life.

<u>Total discounted affluence benefits</u>		
$P_N - P_1$	\$2,155	
$P_1 - P_{100}$	3,475	
TOTAL	\$5,630	

Summary of Benefits

Flood damage reduction and affluence benefits are totaled for each plan and presented in Table 5 below.

Table 5
Summary of Estimated Annual Benefits
(February 1983 price level)

<u>Category</u>	<u>Plan A</u> <u>Storage &</u> <u>Channel</u>	<u>Plan B</u> <u>Floodwarning</u>	<u>Plan C</u> <u>Storage, Channel &</u> <u>Floodwarning</u>
Flood Damage Reduction	\$228,640	\$10,000	\$234,070
Affluence	5,600	-	5,600
TOTAL	\$234,240	\$10,000	\$239,670

JUSTIFICATION

The estimated annual costs, annual benefits and the ratio of benefits and costs for each plan is summarized in Table 6. This analysis indicates that each plan is economically justified. Plan C yields the highest net benefits.

Table 6
Summary of Economic Analysis

	<u>Plan A</u>	<u>Plan B</u>	<u>Plan C</u>
Average Annual Benefit	\$234,200	\$10,000	\$239,700
Average Annual Costs	135,800	5,300	141,100
Benefit-to-Cost Ratio	1.72	1.89	1.70
Net Benefits	\$98,400	\$ 4,700	\$ 98,600

AD-A143 375

BEAVER BROOK KEENE NEW HAMPSHIRE FLOOD DAMAGE REDUCTION
PROJECT SUPPORTIN..(U) CORPS OF ENGINEERS WALTHAM MA
NEW ENGLAND DIV FEB 84


2/2

UNCLASSIFIED

F/G 13/2

NL


END
DATE
FEB 10
84
F.G.

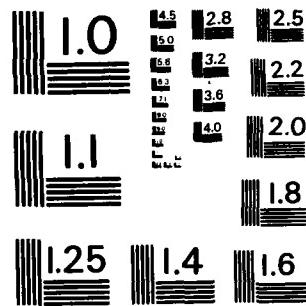

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS - 1963 - A

Table 3
Average Annual Losses, Residuals, and Benefits
Beaver Brook, Keene, NH
(\\$000's February 1983)

Zones	Natural Losses	Channel				Storage, Channel				(Plan C)			
		Residual		Storage		Residual		Storage & Channel		Residual		Storage, Channel	
		Losses	Benefits	Losses	Benefits	Losses	Benefits	Losses	Benefits	Losses	Benefits	Losses	Benefits
0	11.87	6.24	5.63	11.87	0	11.48	.39	6.24	5.63	6.04	5.83	.20	0
1	4.91	2.85	2.06	4.91	0	4.72	.19	2.85	2.06	2.75	2.16	.10	0
2	88.06	46.12	41.94	72.55	15.51	86.67	1.39	42.48	45.58	41.75	46.31	.73	3.64
3	249.42	125.94	123.48	204.69	44.73	244.17	5.25	101.33	148.09	99.19	150.23	2.14	24.61
4	24.08	12.31	11.77	24.08	0	23.18	.90	12.31	11.77	11.79	12.29	.52	0
5A	5.91	2.97	2.94	5.91	0	5.85	.06	2.97	2.94	2.95	2.96	.02	0
5B	62.86	50.29	12.57	62.86	0	61.04	1.82	50.29	12.57	48.57	14.29	1.72	0
TOTAL	447.11	246.72	200.39	386.87	60.24	437.11	10.00	218.47	228.64	213.04	234.07	5.43	28.25

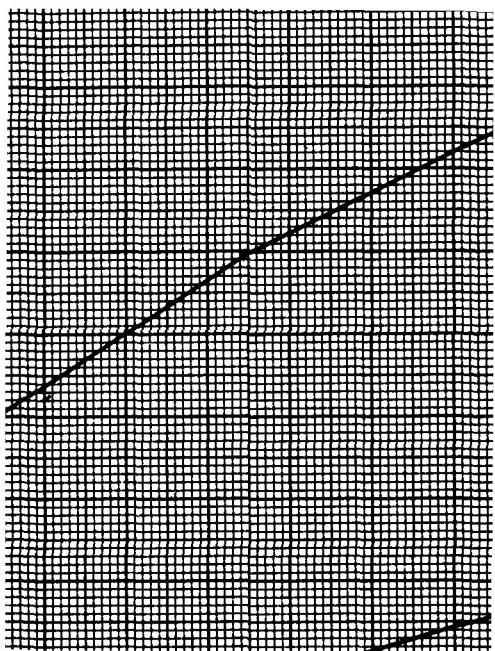



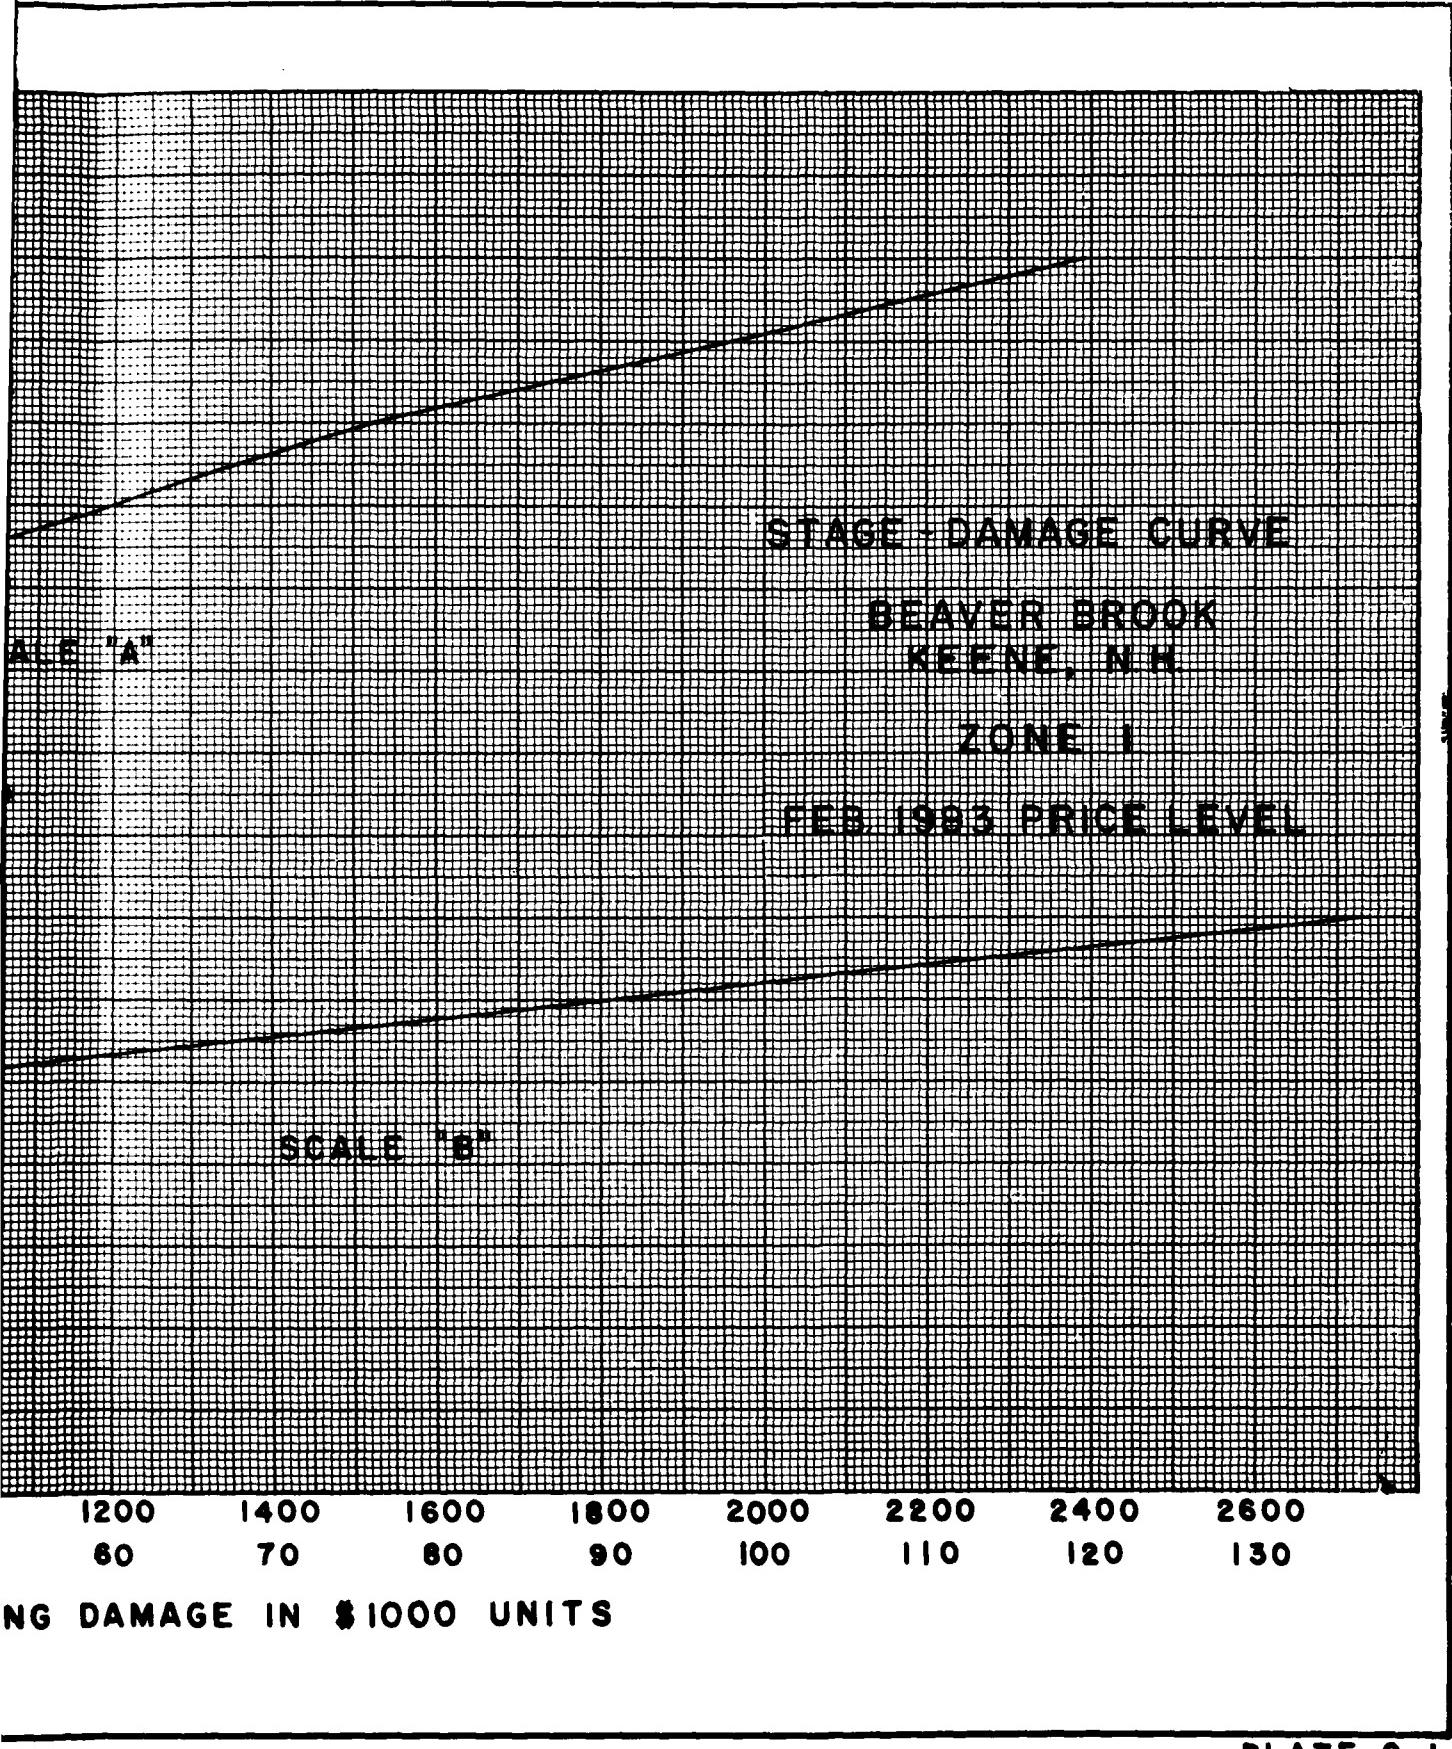


PLATE C-1

2

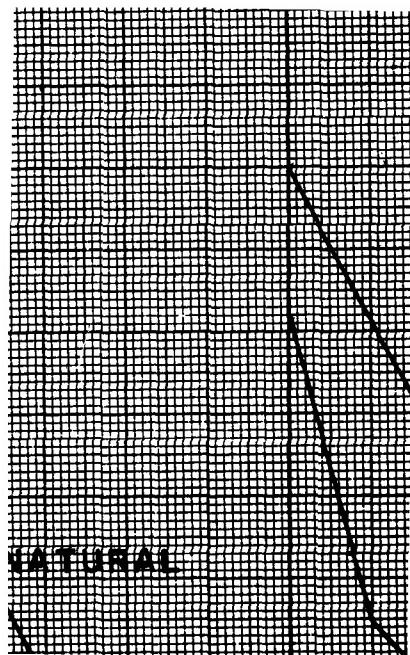

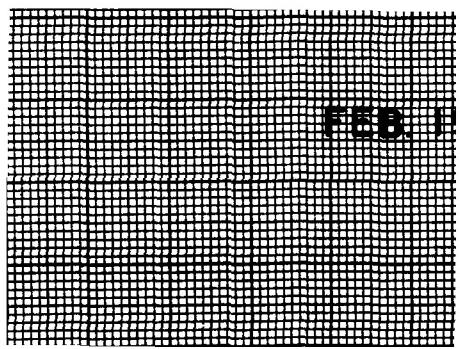

SECTION D

ARCHAEOLOGICAL RECONNAISSANCE REPORT

**AN ARCHAEOLOGICAL RECONNAISSANCE
FOR THE BEAVER BROOK LOCAL FLOOD PROTECTION PROJECT
KEENE, NEW HAMPSHIRE**

**PREPARED FOR: U.S. Army Corps of Engineers
New England Division
Waltham, Massachusetts**

**BY: John S. Wilson, Division Archaeologist
Richard S. Kanaski, Co-Investigator**

AUGUST 1982

TABLE OF CONTENTS

	<u>Page No.</u>
INTRODUCTION	1
RESEARCH DESIGN	2
Environmental Background	2
Prehistoric Background & Research Strategy	2
Historic Background & Research Strategy	3
RESULTS OF FIELD SURVEY	5
Prehistoric Survey of Three Mile Swamp	5
Historic Survey of Three Mile Swamp	5
ANALYSIS OF IMPACTS	7
BIBLIOGRAPHY	8

LIST OF FIGURES

<u>Figure No.</u>		<u>Following Page No.</u>
1	Project Location Map	1
2	Marlboro-Water Streets including Historic Period Data	1
3-9	Three Mile Swamp from South to North	1
10	Soils Map: Marlboro Water Streets	2
11	Photograph: Southwest from end of Gardner Street	2
12	Photograph: North from Myrtle Street	2
13	Photograph: North from Railroad Bridge	2
14	Photograph: Dam at Three Mile Swamp, N.E. to N.W.	2
15	Soils Map: Three Mile Swamp	2
16-21	Test Pit Profiles	5
22	List of Materials Recovered	5

INTRODUCTION

The following report has been prepared in conjunction with a Feasibility Report and Environmental Assessment for the Beaver Brook Local Protection Project. The project consists of channel improvements between Marlboro and Water Streets in downtown Keene, New Hampshire (Figures 1 & 2), and construction of a small dam and dike at Three Mile Swamp near the northeast corner of the city (Figures 1 & 3). The latter area is currently occupied by a dry laid fieldstone and earth dam. Normal water level in the swamp following project construction would be as at present, but during flood stages the new dam could hold a maximum of 10 feet additional depth. Therefore, the maximum includes all areas north of the proposed dam and below el. 797 (Figures 3-9) as well as construction areas at the dam and within the downtown channel improvement area.

RESEARCH DESIGN

Environmental Background

Marlboro Street to Water Street: The present environment of this vicinity is urban in character, with primarily industrial property. Soils within this area are classified as Ondawa fine sandy loam and Podunk fine sandy loam, both of which are moderately well drained and subject to occasional flooding (USDA Soil Conservation Service 1969) (Figure 10). However, field inspection revealed that this area is actually higher filled ground. The west bank from Marlboro Street up to the vicinity of Myrtle Street is a brushy bank behind a residential neighborhood, while the east bank is partially concrete lined and composed of fill adjacent to a modern factory (Figure 11). Both banks north of Myrtle Street to the railroad are fill comprising a parking lot (Figure 12) and mill yard, except two concrete-lined portions where a modern factory ell and access bridge cross the brook. The railroad bridge is a simple deck structure atop cut stone abutments. A portion of the east bank north of the railroad bridge is also of cut stone (Figure 13) but most resembles the area to the south, and is now used as mill yard. The Water Street bridge and a mill access bridge immediately to the south are typical small early 20th century concrete structures. A concrete factory foundation wall adjoins Water Street, along the west bank.

Three Mile Swamp: This area consists primarily of wetlands, with steep slopes to either side and scattered knolls of glacial outwash. The wetland consists primarily of Rumney and Scarboro fine sandy loams and muck and peat deposits (Figure 15). A thin strip of seasonally wet Ondawa fine sandy loam and Acton very stony fine sandy loam borders the eastern slopes, which consist of Canton very stony fine sandy loam with slopes exceeding 15%. Outwash deposits of Hinkley loamy sand occupy a narrow terrace west of Route 10 and small knolls within project area. All non-wetlands are wooded with considerable evidence of logging.

Prehistoric Background and Research Strategy: Studies in the Ashuelot Valley (Curran, 1980; Wilson, 1979) indicate considerable prehistoric occupation on glacial terraces near the river and the mouths of tributaries, but no professional archaeological work has previously been undertaken in the surrounding uplands. Recorded sites within the lower Ashuelot span the Paleo-Indian period to the mid-18th century (ca. 9000 BC - AD 1755) and appear to generally represent short-term occupations with a riverine orientation related to a mixture of aquatic and non-aquatic resources. Use of the valley as a transportation route may also have affected site location, given the steep uplands to either side. A contact period trail system ran up the main valley of the Ashuelot.

While riverine locations along the Ashuelot probably provided better locations for taking anadromous fish and may have produced more diverse and productive habitats for terrestrial flora and fauna (Curran, 1980;

17-22), areas such as Three Mile Swamp could have provided locations for hunting camps occupied as satellites of possible riverine (or earlier lakeshore) base camps or as units comprising part of a seasonal settlement round.

Conversations with Ms. Curran, who conducted the only major archaeological survey of the Ashuelot basin, and with Mr. Arthur Whipple, Sr., a noted collector in the area, revealed no knowledge of recorded sites within impact areas of the project. The nearest finds reported by Mr. Whipple were located at Woodland Cemetery, about 22 kilometers north of Water Street. Examination of the soils map and comparison with surface conditions during an initial walkover of the impact area at Three Mile Swamp confirmed the wetland character of the Rumney and Scarboro soil areas, and also revealed that the area of stony Acton soils extends further south than anticipated. Both the Acton and Ondawa soils are wet and forested with numerous tree throws. Due to these conditions, presence of prehistoric sites appears unlikely between the hills and wetlands. Similarly, steepness and stoniness removed the lower slopes of the hills from consideration for subsurface testing. The area of the proposed dike along Route 10 is disturbed ground and fill deposited during relocation of the highway in the 1970s.

This analysis leaves only one type of landform at Three Mile Swamp having high potential for presence of prehistoric sites, the isolated knolls of Hinkley loamy sand. It is these areas which were subjected to subsurface testing. Two knolls were tested in this manner.

Subsurface testing employed excavation of 50 cm. sq. shovel test pits at 10 m. intervals along a series of transects. On the larger of these two knolls, three transect, were excavated approximately 15 m. apart. Test pits on these were staggered to minimize distance between them. Where possible cultural material was located, additional test pits were excavated at 4 m. intervals nearby. Length of transects was limited by wetland margin and areas of extensive logging slash piles. Location of individual test pits was adjusted to avoid trees and slash piles. All soil was screened through 1/4 in. hardware cloth.

Due to the intensive disturbance of the project area between Marlboro and Water Streets no subsurface testing was undertaken in that area.

Historic Background

Examination at 19th century maps revealed evidence of industrial activity in the area between Marlboro and Water Streets (Figure 2). In 1877, the Taft & Co. pottery stood on the intersection of Foster and Myrtle Street, west of the project area (Rochwood, 1877). This firm may have operated as late as 1892 (Hurd), under tenants. At that time, the Wilkins toy factory stood south of the railroad on the opposite bank. Portions of this mill are still occupied, and the present owners have expanded west to the brook. These later additions have already been noted

in the section on Environmental Background (See Figure 11). The area northeast of the railroad and south of Water Street was occupied in 1892 by the New Hampshire Moulded Granite Co. (Hunt, 1892). This company may have built the retaining wall in this area (Figure 13) but none of its buildings bordered the brook.

As noted above the only structures indicated on 19th century maps which bordered Beaver Brook are the abutments for the small railroad bridge and retaining wall north of the east abutment. These are typical cut stone structures of little historic interest or archaeological potential.

Due to this limited historic period land use and evidence of considerable modern disturbance no subsurface testing for historic period sites was performed in the Marlboro to Water Streets portion of this project area.

Examination of 1858, 1877, and 1892 maps failed to reveal any indications of the earth fill and dry laid fieldstone faced dam at Three Mile Swamp (Figure 14). (Fagan, 1858; Rockwood, 1877; Hunt, 1892). Field work in this area concentrated on surface examination in hopes of better dating this feature and determining its purpose.

RESULTS OF THE FIELD SURVEY

Prehistoric Survey at Three Mile Swamp

A total of 19 test pits were excavated along 10 m. interval transects, 17 on three transects occupying a large knoll a short distance north of the dam, and the remaining two on a smaller knoll to the northeast. Most of the latter location was covered with dense timber slash, as were smaller areas on the larger knoll. Lower and smaller knolls to the northeast were even more disturbed by logging activity or construction and maintenance of a high tension line, and were not tested.

Horizonation generally consisted of approximately 15-20 cm of dark brown sandy loam over 10-15 cm of orange brown sandy loam, above a horizon of tan sand. Pebbles, cobbles and number roots were preserved throughout all profiles with occasional larger rocks of up to about 20 cm. dia. Most stone was a very friable mica-schist, with smaller pebbles of quartz and quartzite. Pits were excavated until gravel and large rocks precluded deeper testing, generally 40-50 cm below surface. Some variations in profiles occurred due to lenses of weathered schist which were frequently encountered (purple-orange in color) decayed roots (light gray in color), and occasional thin lenses of fairly recent charcoal, probably resulting from burned and buried timber slash (Figures 16-21).

Small amounts of possibly modified quartz and quartzite were encountered in 14 test pits. Analysis by the cultural resource staff indicates that they could either be result of natural splitting or of tool manufacture (Figure 22). Therefore, test pits at 4 m. intervals were excavated along the cardinal directions from 3 of the test pits. Test pit T-3:TP-0 had no south or east satellite pits, due to proximity of the badly eroded surface of a logging road in these directions and T-4:TP-0 had dense timber slash all round. None of the satellite pits produced any potential cultural material or features. Therefore, the materials found in T-1:TP-40, T-2:TP-22, and T-3:TP-0 appear to be either naturally modified or to represent isolated activity associated with prehistoric hunting stands or similar.

Historic Survey at Three Mile Swamp

A study of historic period maps and surface examination of the project area revealed no other historic period features, field survey consisted of examination of the present dam at the south end of the swamp (Figure 14). The dam is of earth fill with dry laid field stone on both faces. Though typical of 18th or early 19th century dam construction, this method was employed into the latter part of the 19th century for small dams. Traces of a concrete sluice frame indicates use in the late 19th or early 20th century. Careful examination revealed no evidence of any mill foundation associated with this dam. If any mill was associated with this dam, it was either built entirely on pilings and/or obliterated by flooding. In view of the relatively intact nature of the dam another

hypothesis seems more likely; that the dam was constructed to provide additional storage for mills downtown. As deforestation of uplands during the 19th century made watercourses more seasonally variable, many large firms or groups of firms built upland reservoirs to provide a reliable supply during seasons of low water. The apparent late 19th-early 20th century features of this dam somewhat support this hypothesis.

ANALYSIS OF IMPACTS

The only indications of possible prehistoric activity within the project impact area consist of a small amount of lithic material found in three non-adjacent test pits. Further testing within 4 m. of each of these find spots revealed no additional material. Therefore, it appears that this material is either the result of natural shattering of quartz and quartzite cobbles or representative of one or more isolated loci where artifact manufacture or retouching took place. Hunting stands would have been reasonable places for such activity areas. While such sites would theoretically be of interest; absence of any larger horizontal distribution, features, or diagnostic material severely limits any further archaeological potential of these loci. Therefore, it appears unlikely that any occasional flooding of the area behind the new dam would affect archaeological resources eligible for inclusion in the National Register of Historic Places.

The only historic period features potentially affected by project construction are the dam at Three Mile Swamp and railroad bridge abutments and retaining wall between Myrtle Street and Water Street. The dam does not have any associated mill foundation nearby, and may have been built to provide seasonal storage for factories downriver. It is of unexceptional design and has little archaeological potential. The bridge abutments and retaining wall also have little archaeological and potential or historic interest being typical examples of the period.

In conclusion no effect upon significant historic or archaeological resources is anticipated from construction or operation of the proposed Beaver Brook Local Protection Project.

BIBLIOGRAPHY

- Curran, M.L. 1980. "Prehistoric Settlement Patterns in the Lower Ashuelot River Valley, 1978." unpublished ms. N.H. Survey & Planning Project #93325.
- Fagan, L. 1858. Map of Cheshire Co., NH. Philadelphia, Smith & Morley.
- Hunt, D.H. & Co. 1892. Town & City Atlas of New Hampshire, New York, D.H. Hunt & Co.,
- Rockwood, C.H. 1877. Atlas of Cheshire Co., NH, New York, Comestock & Cline.
- USDA Soil Conservation Service. 1869. Soils Map of Keene, NH.
- U.S. Geological Survey. 1958. Keene, NH-VT 15' Quadrangle.
- Wilson, J.S. 1979. "A Cultural Resource Reconnaissance for the Operation & Maintenance of Surry Mountain Lake, Surry, NH" New England Division, U.S. Army Corps of Engineers.

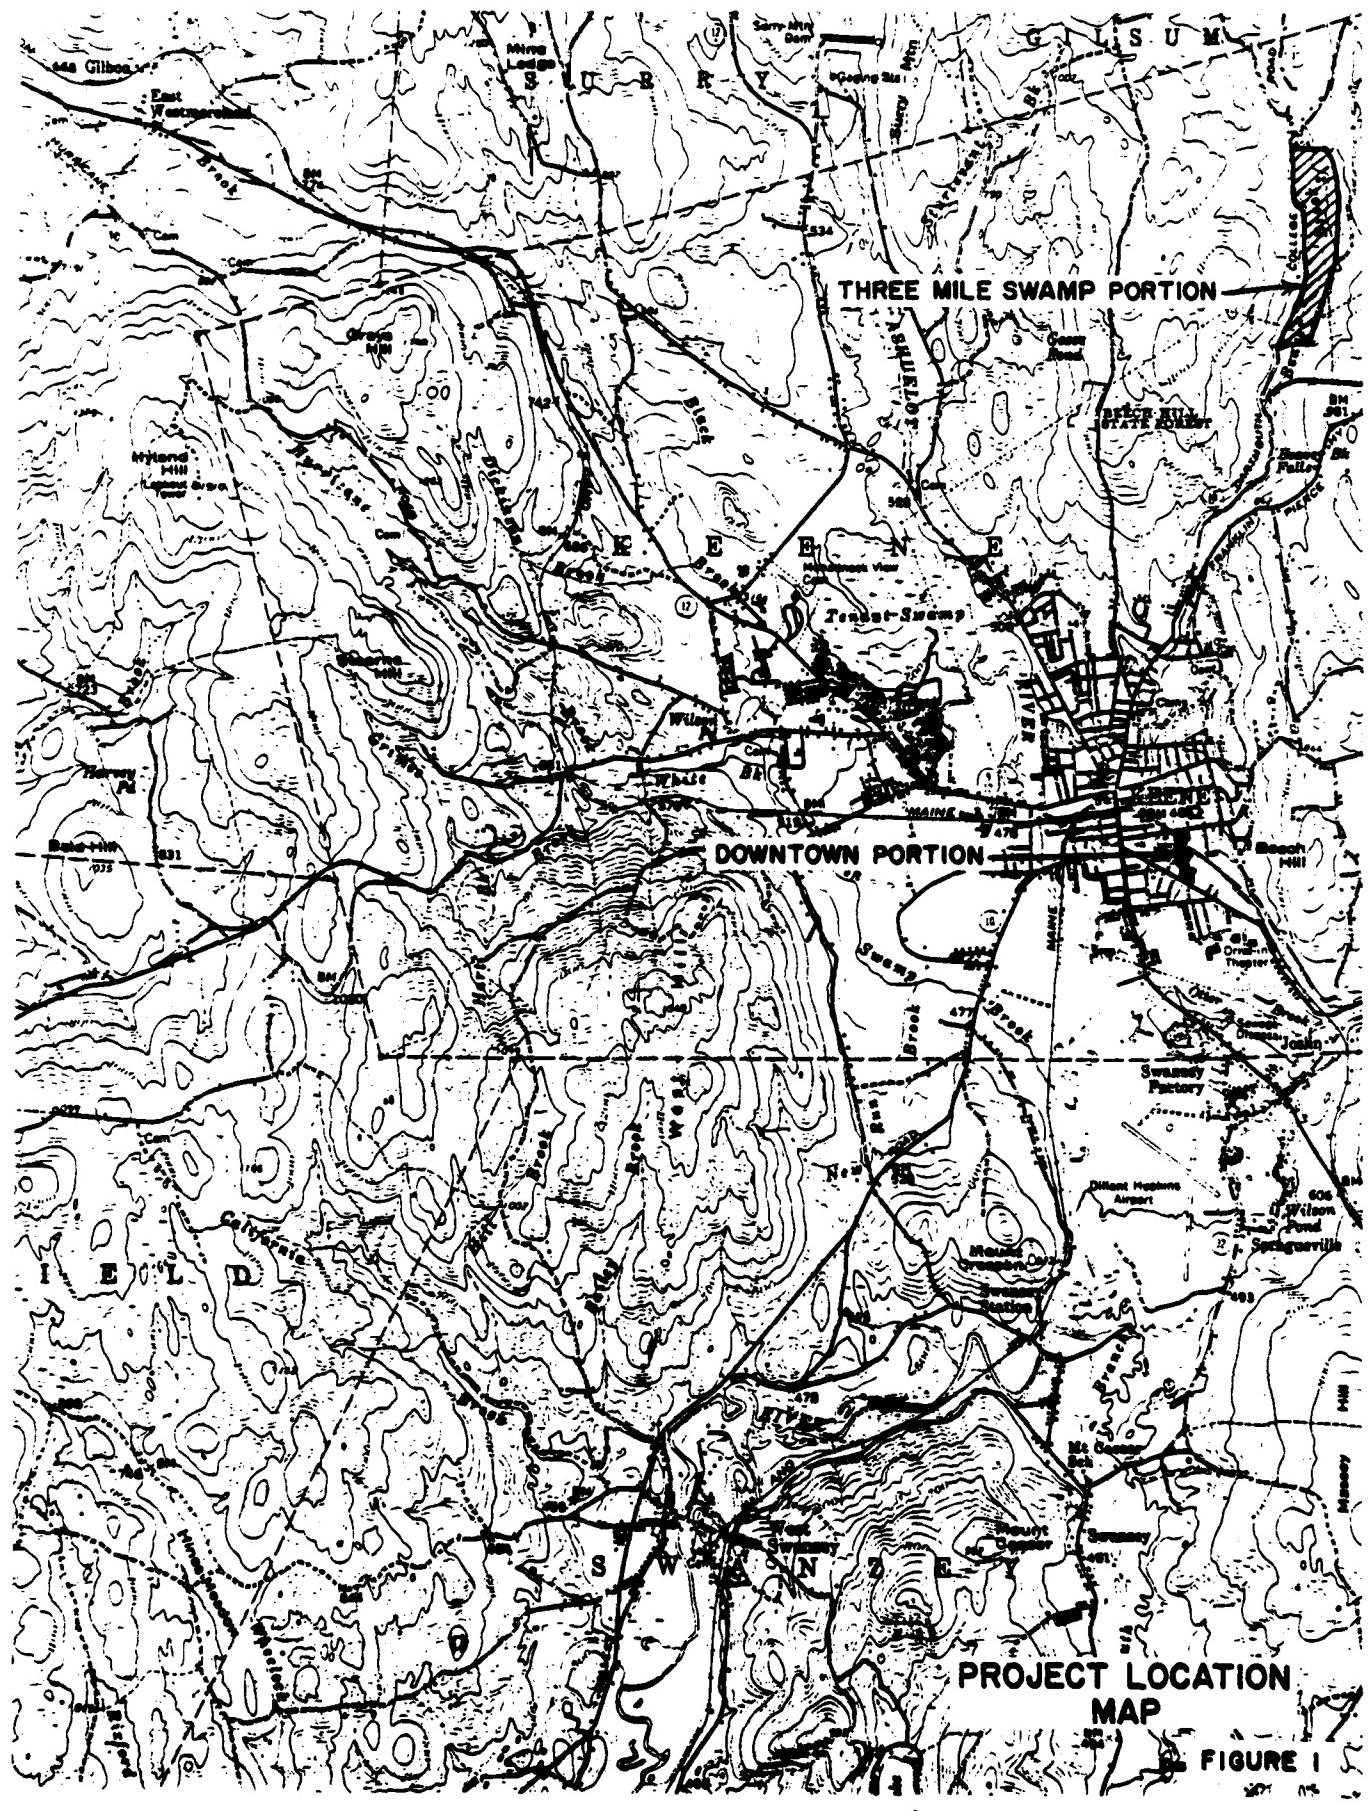


FIGURE 1

MARLBORO-WATER STREETS
INCLUDING HISTORIC PERIOD DATA

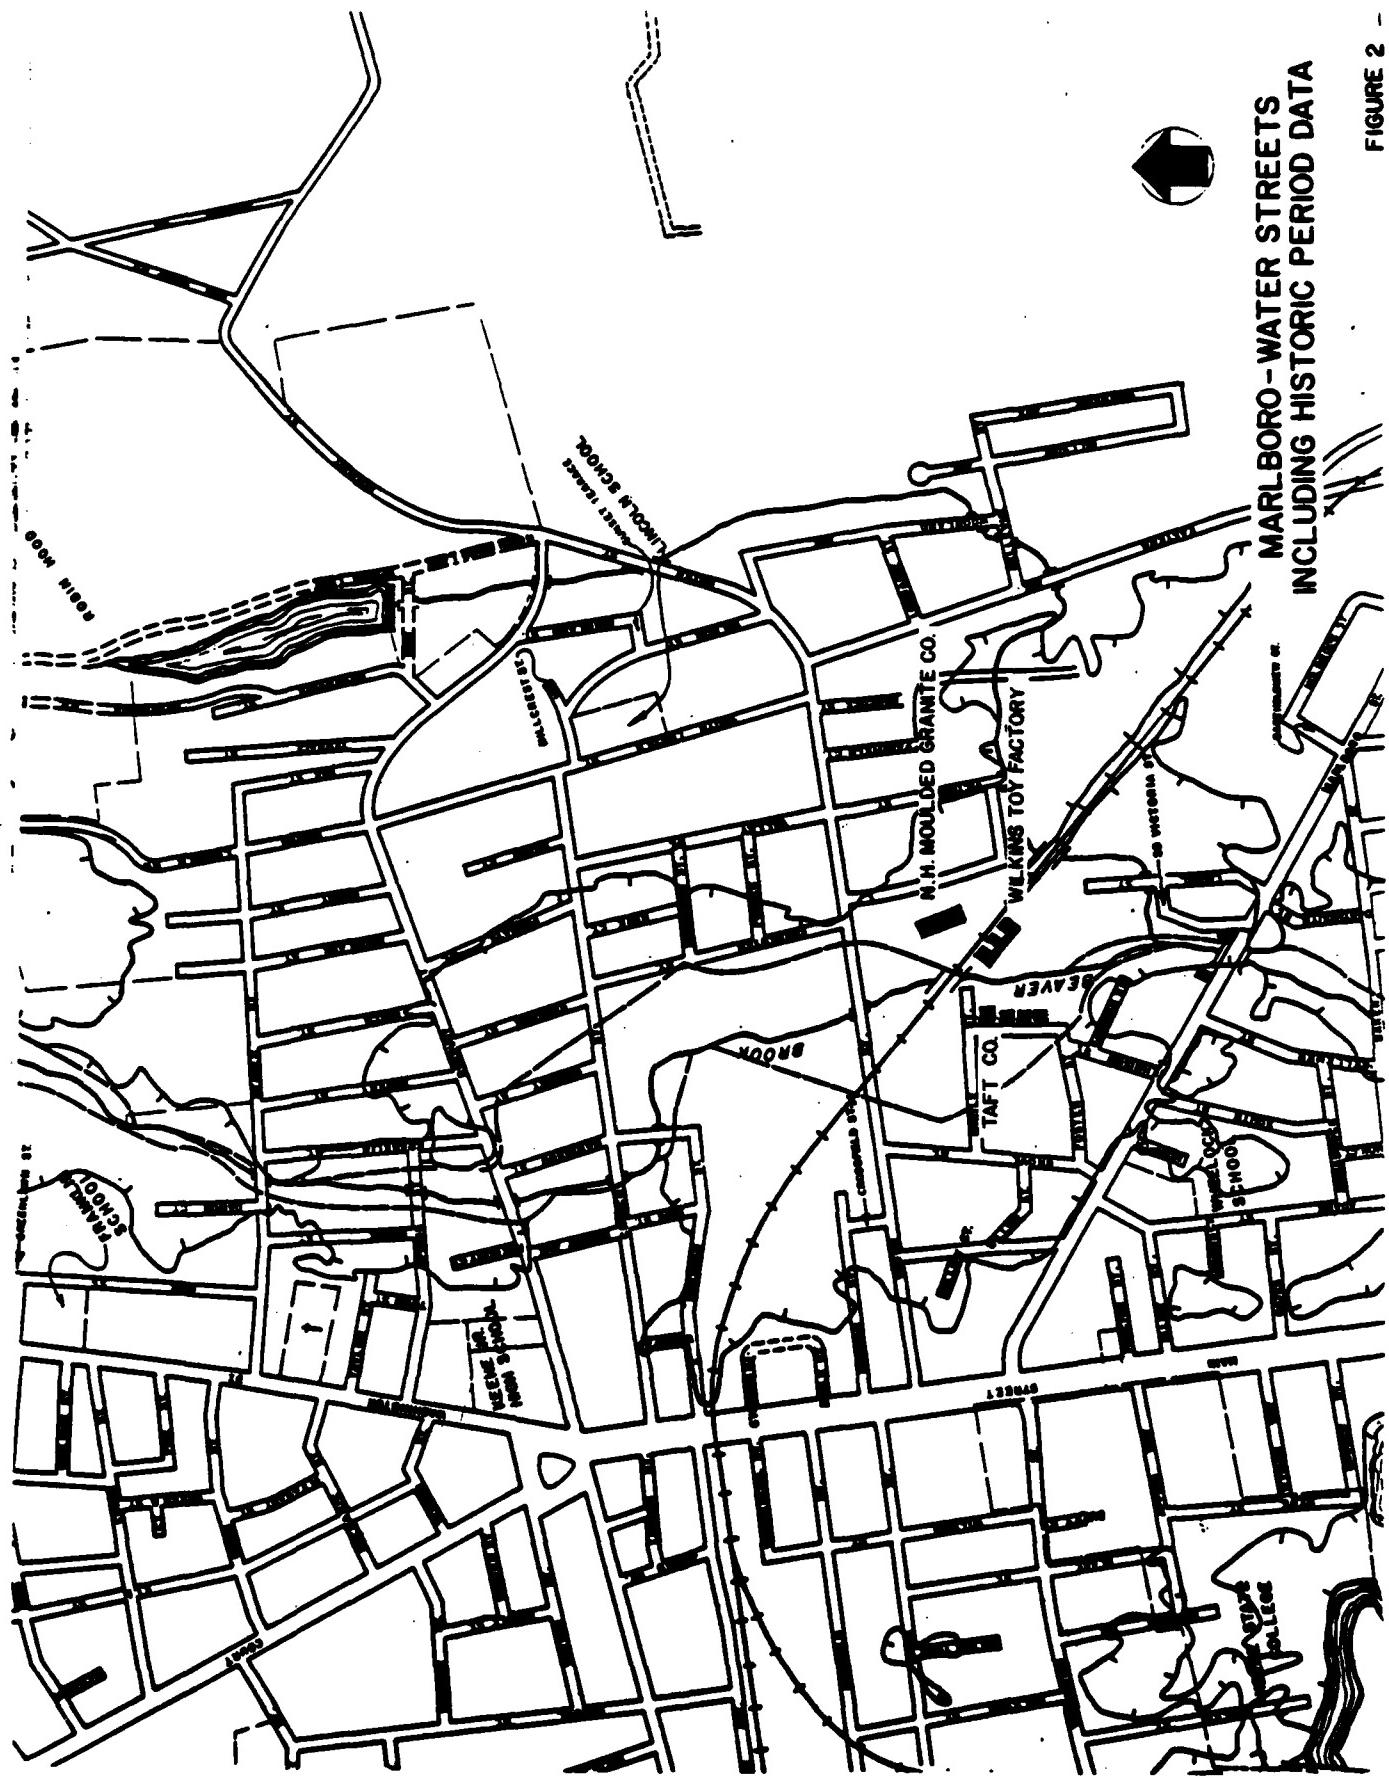


FIGURE 2

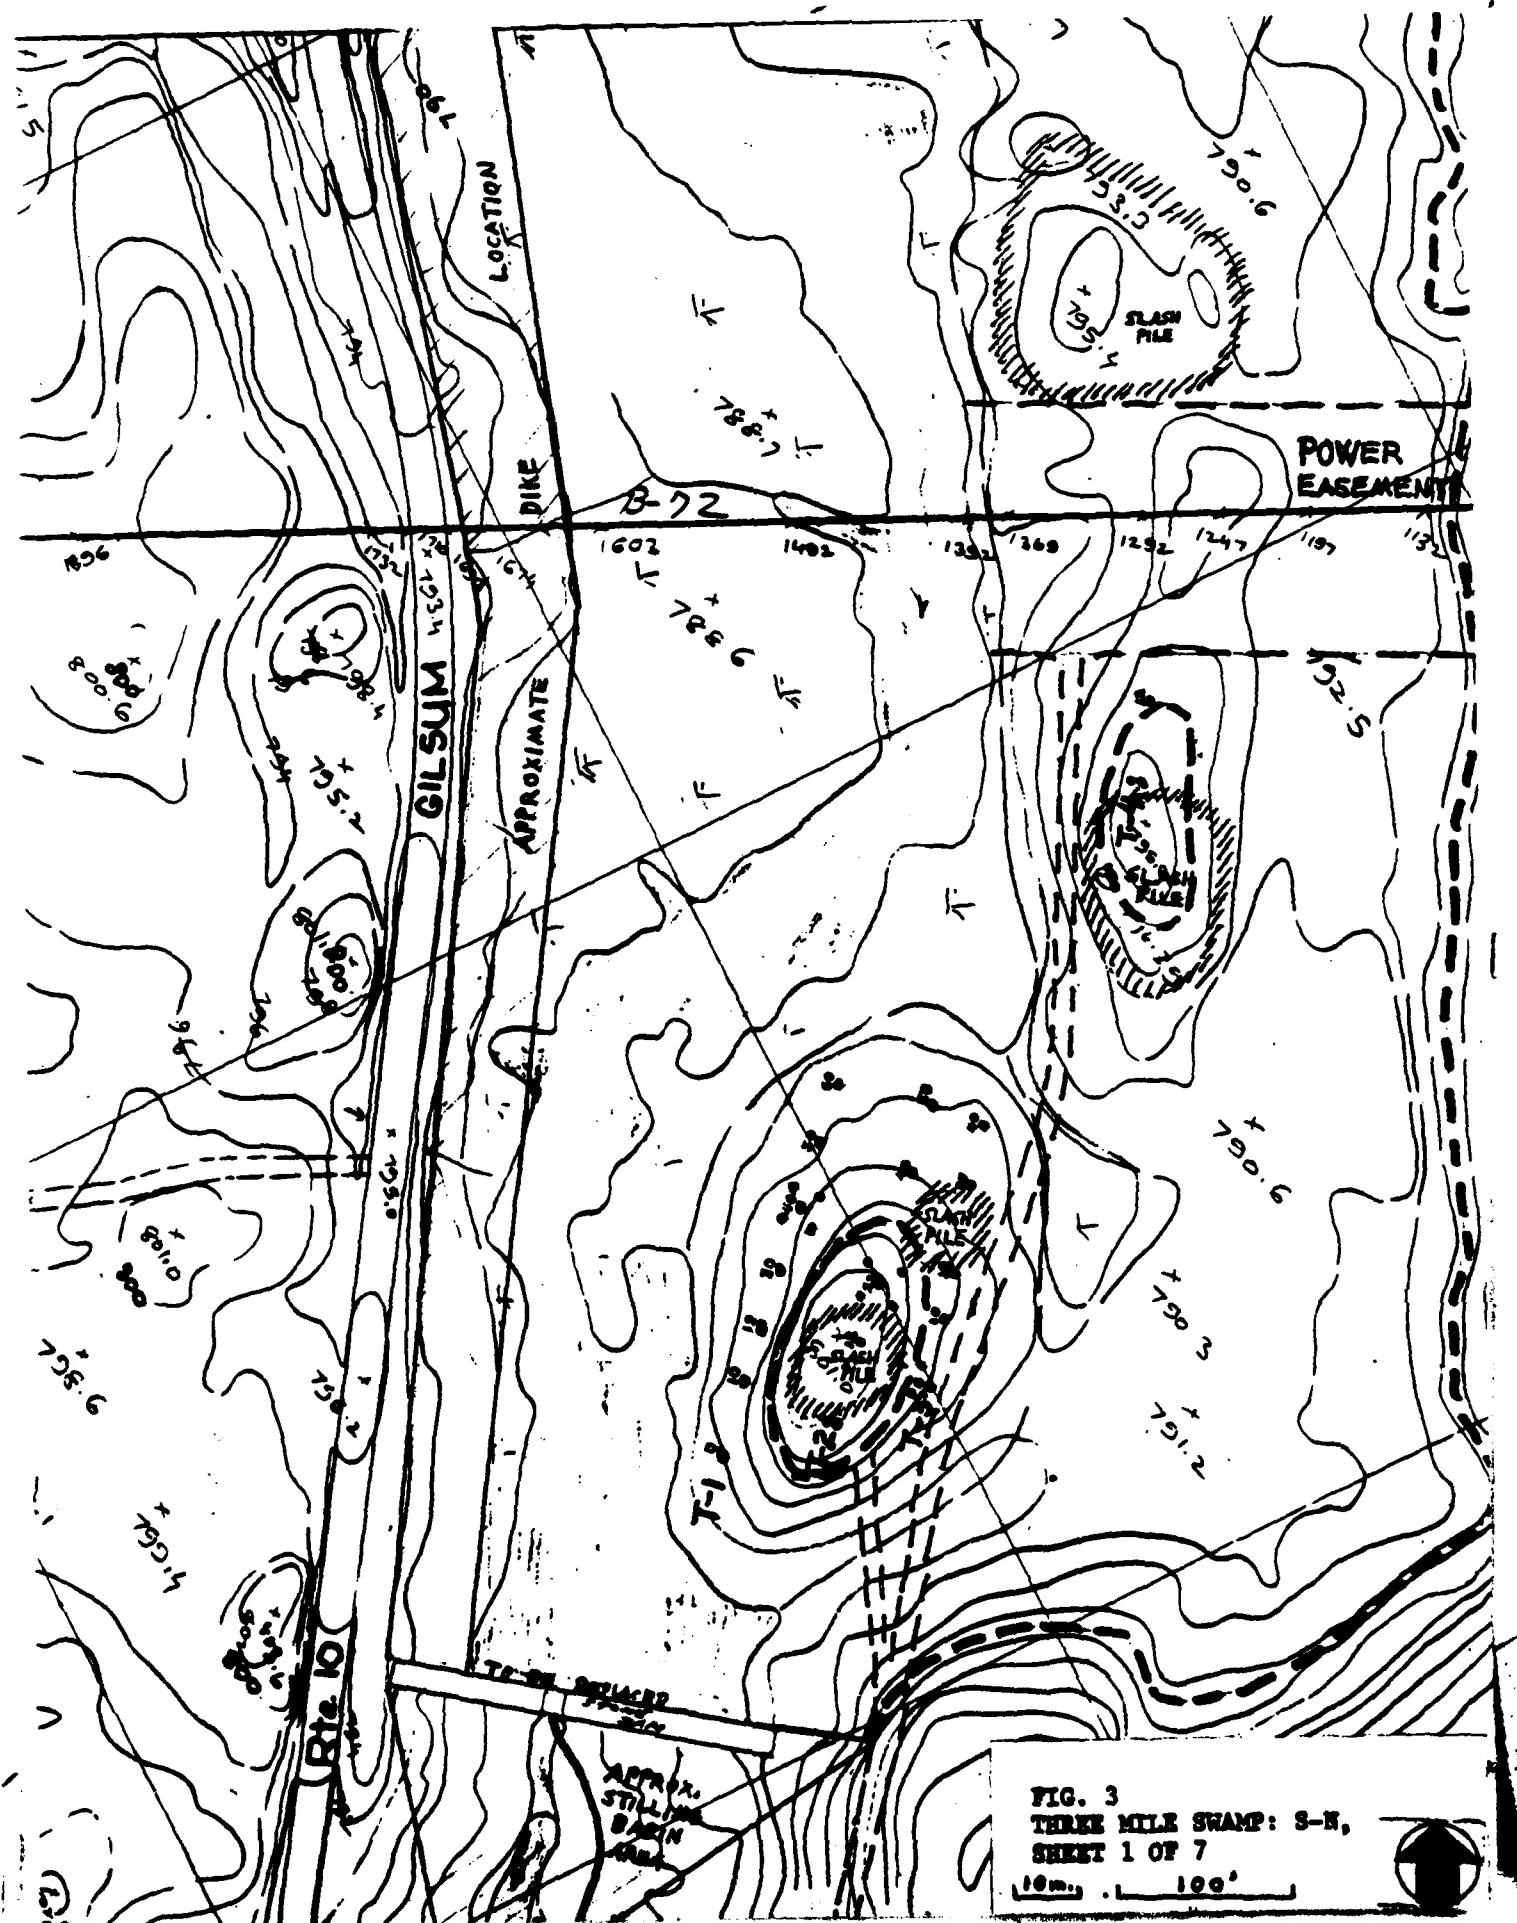


FIG. 3
THREE MILE SWAMP: S-N,
SHEET 1 OF 7
10m. 50m. 100'



FIG. 4
THREE MILE SWAMP: S-N.
SHEET 2 OF 7

100'

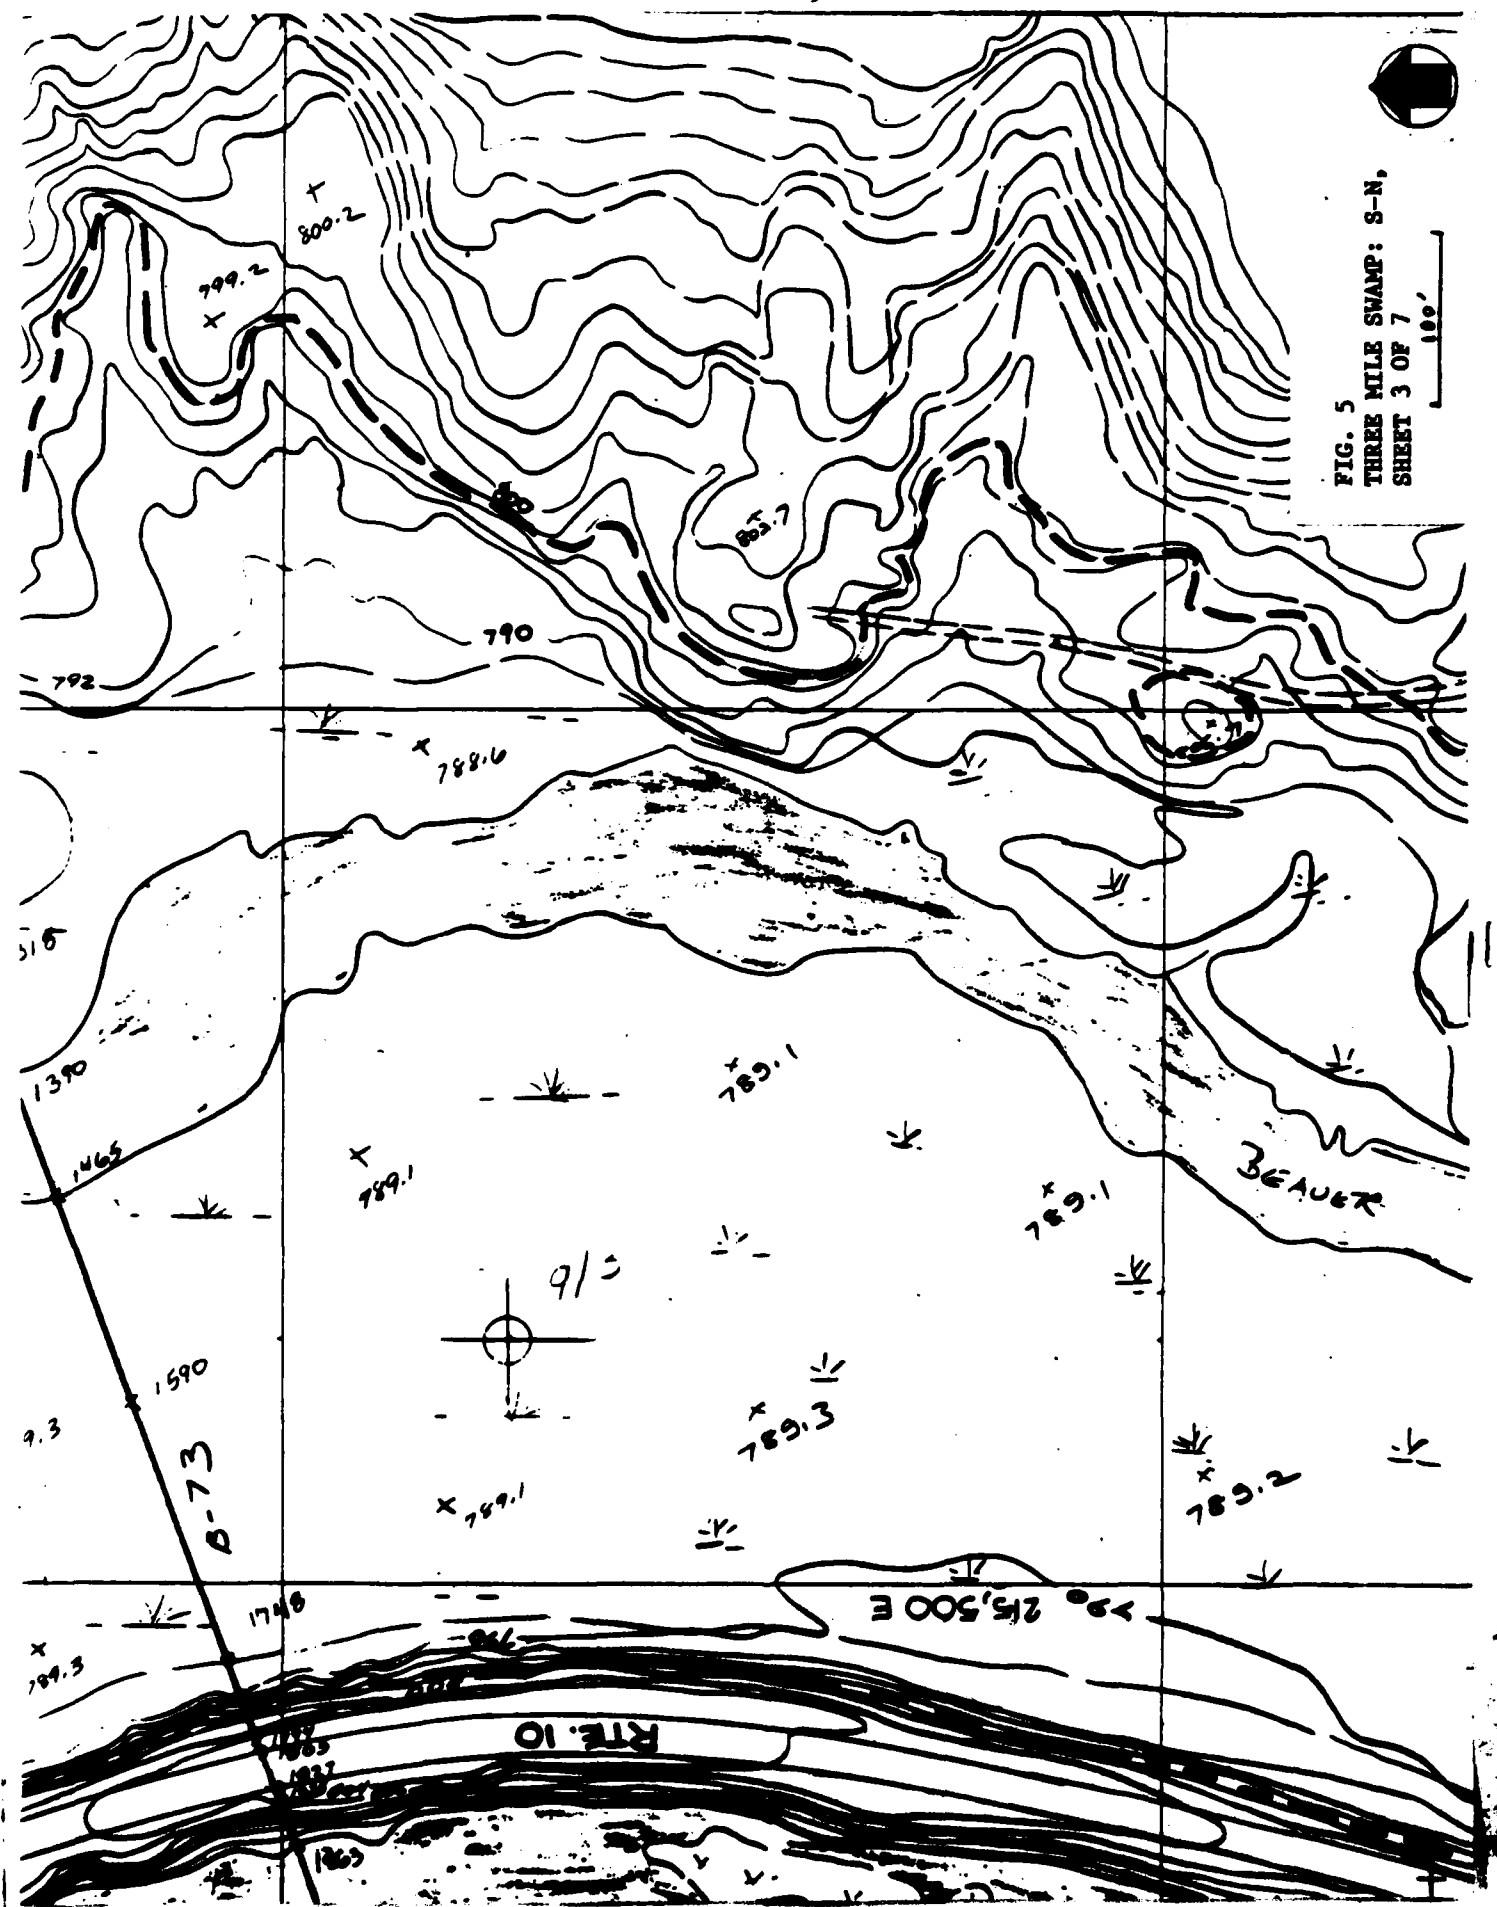


FIG. 5
THREE MILE SWAMP: S-N,
SHEET 3 OF 7

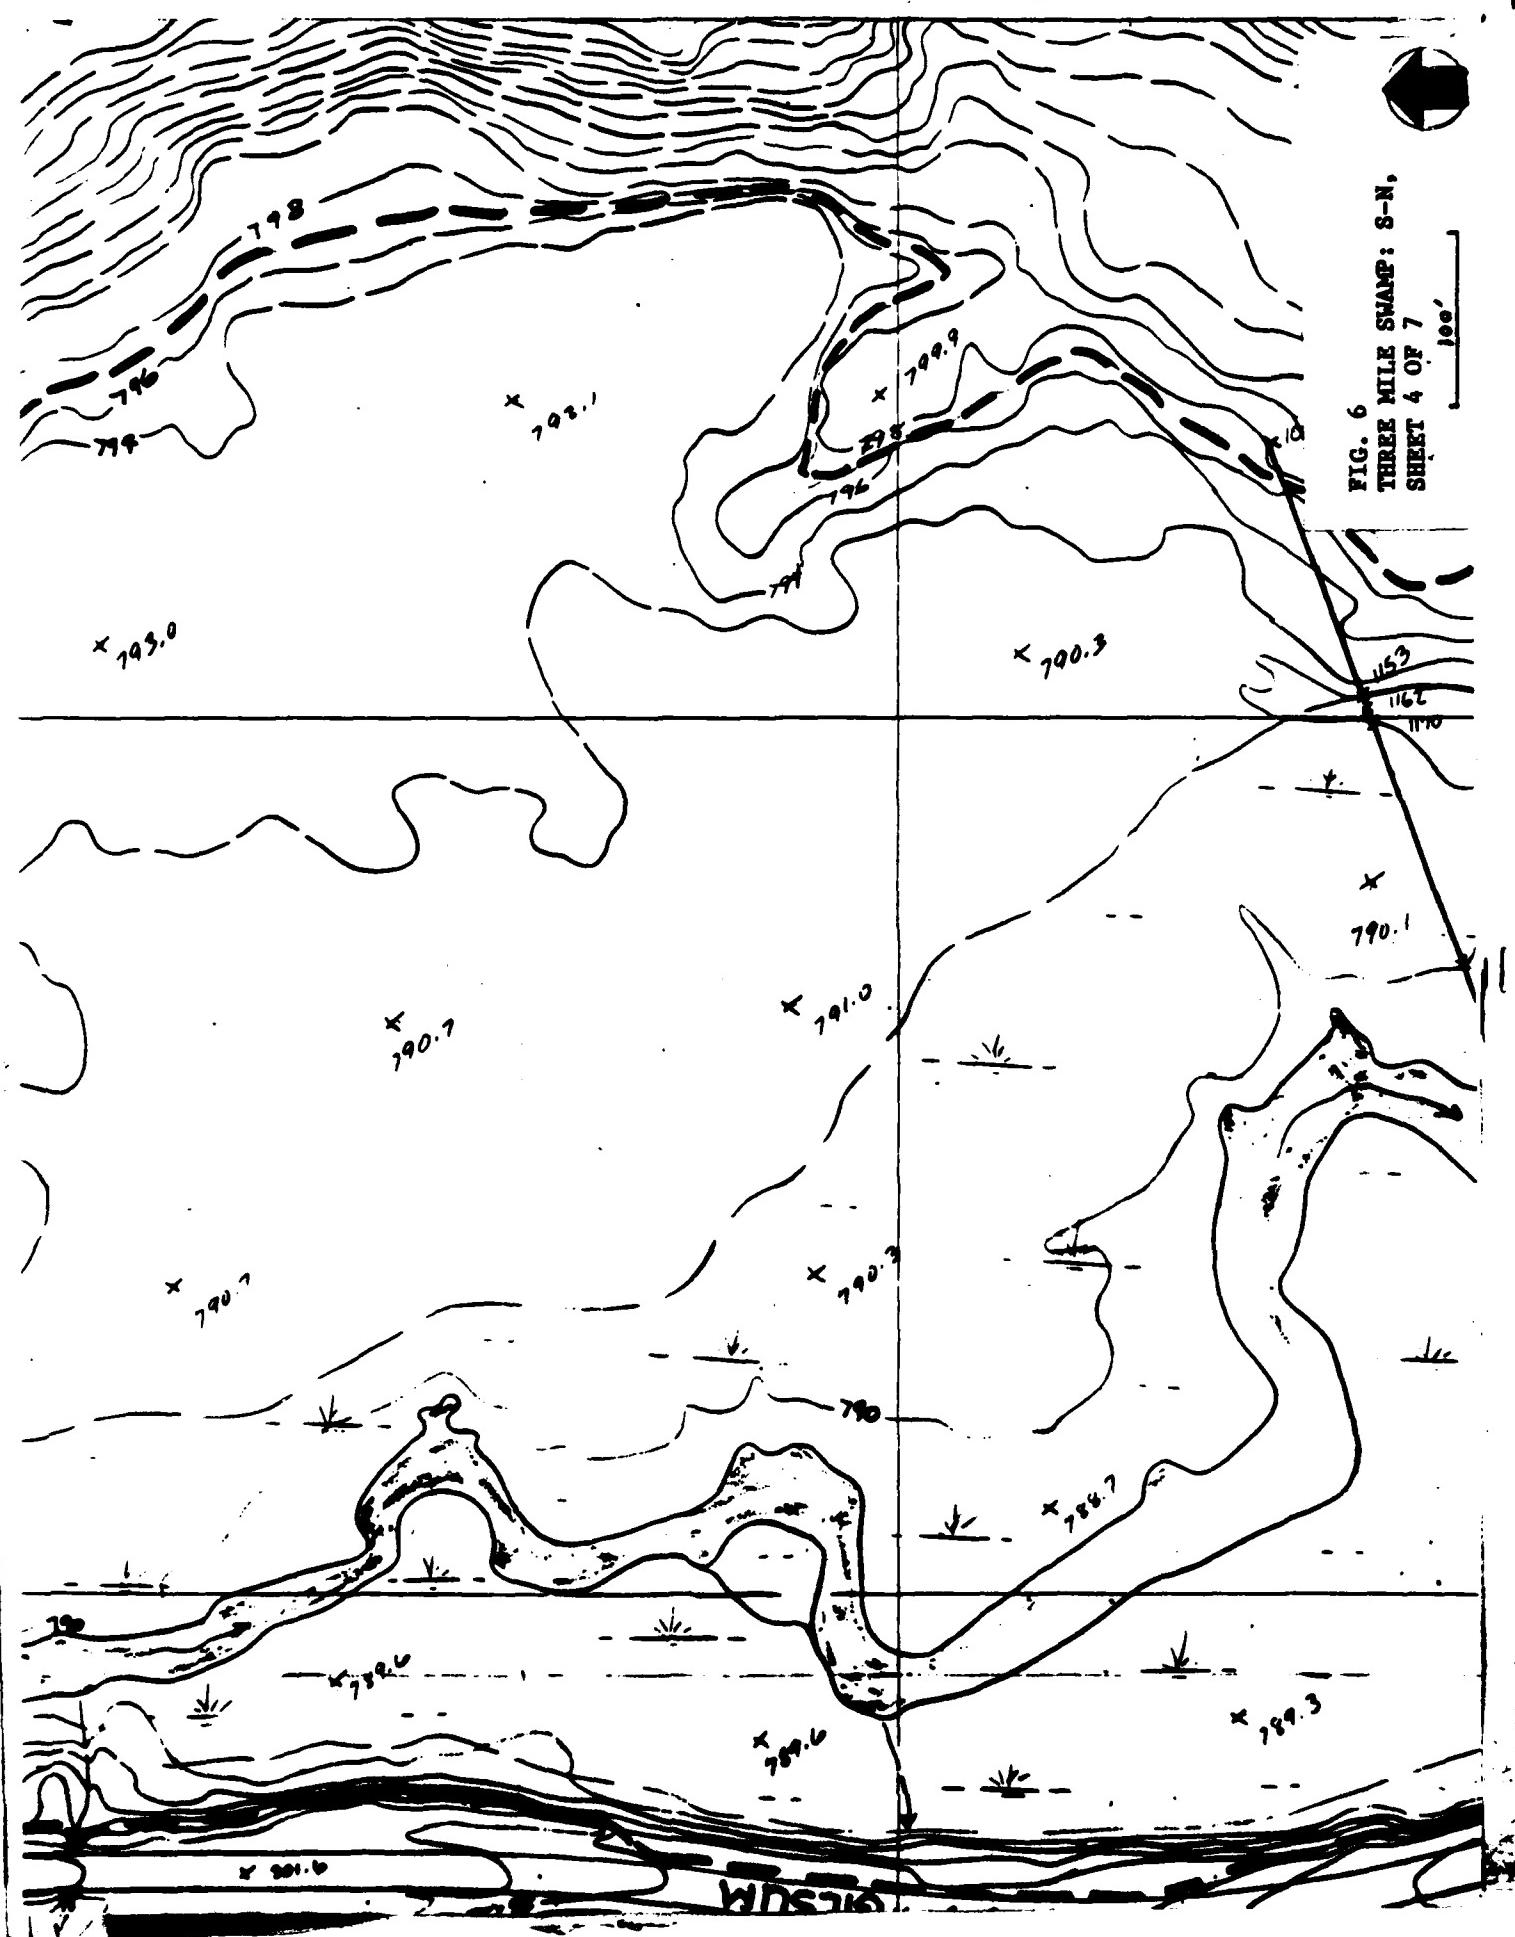


FIG. 6 THREE MILLS SAME: S-N,
SHIRT 4 OF 7

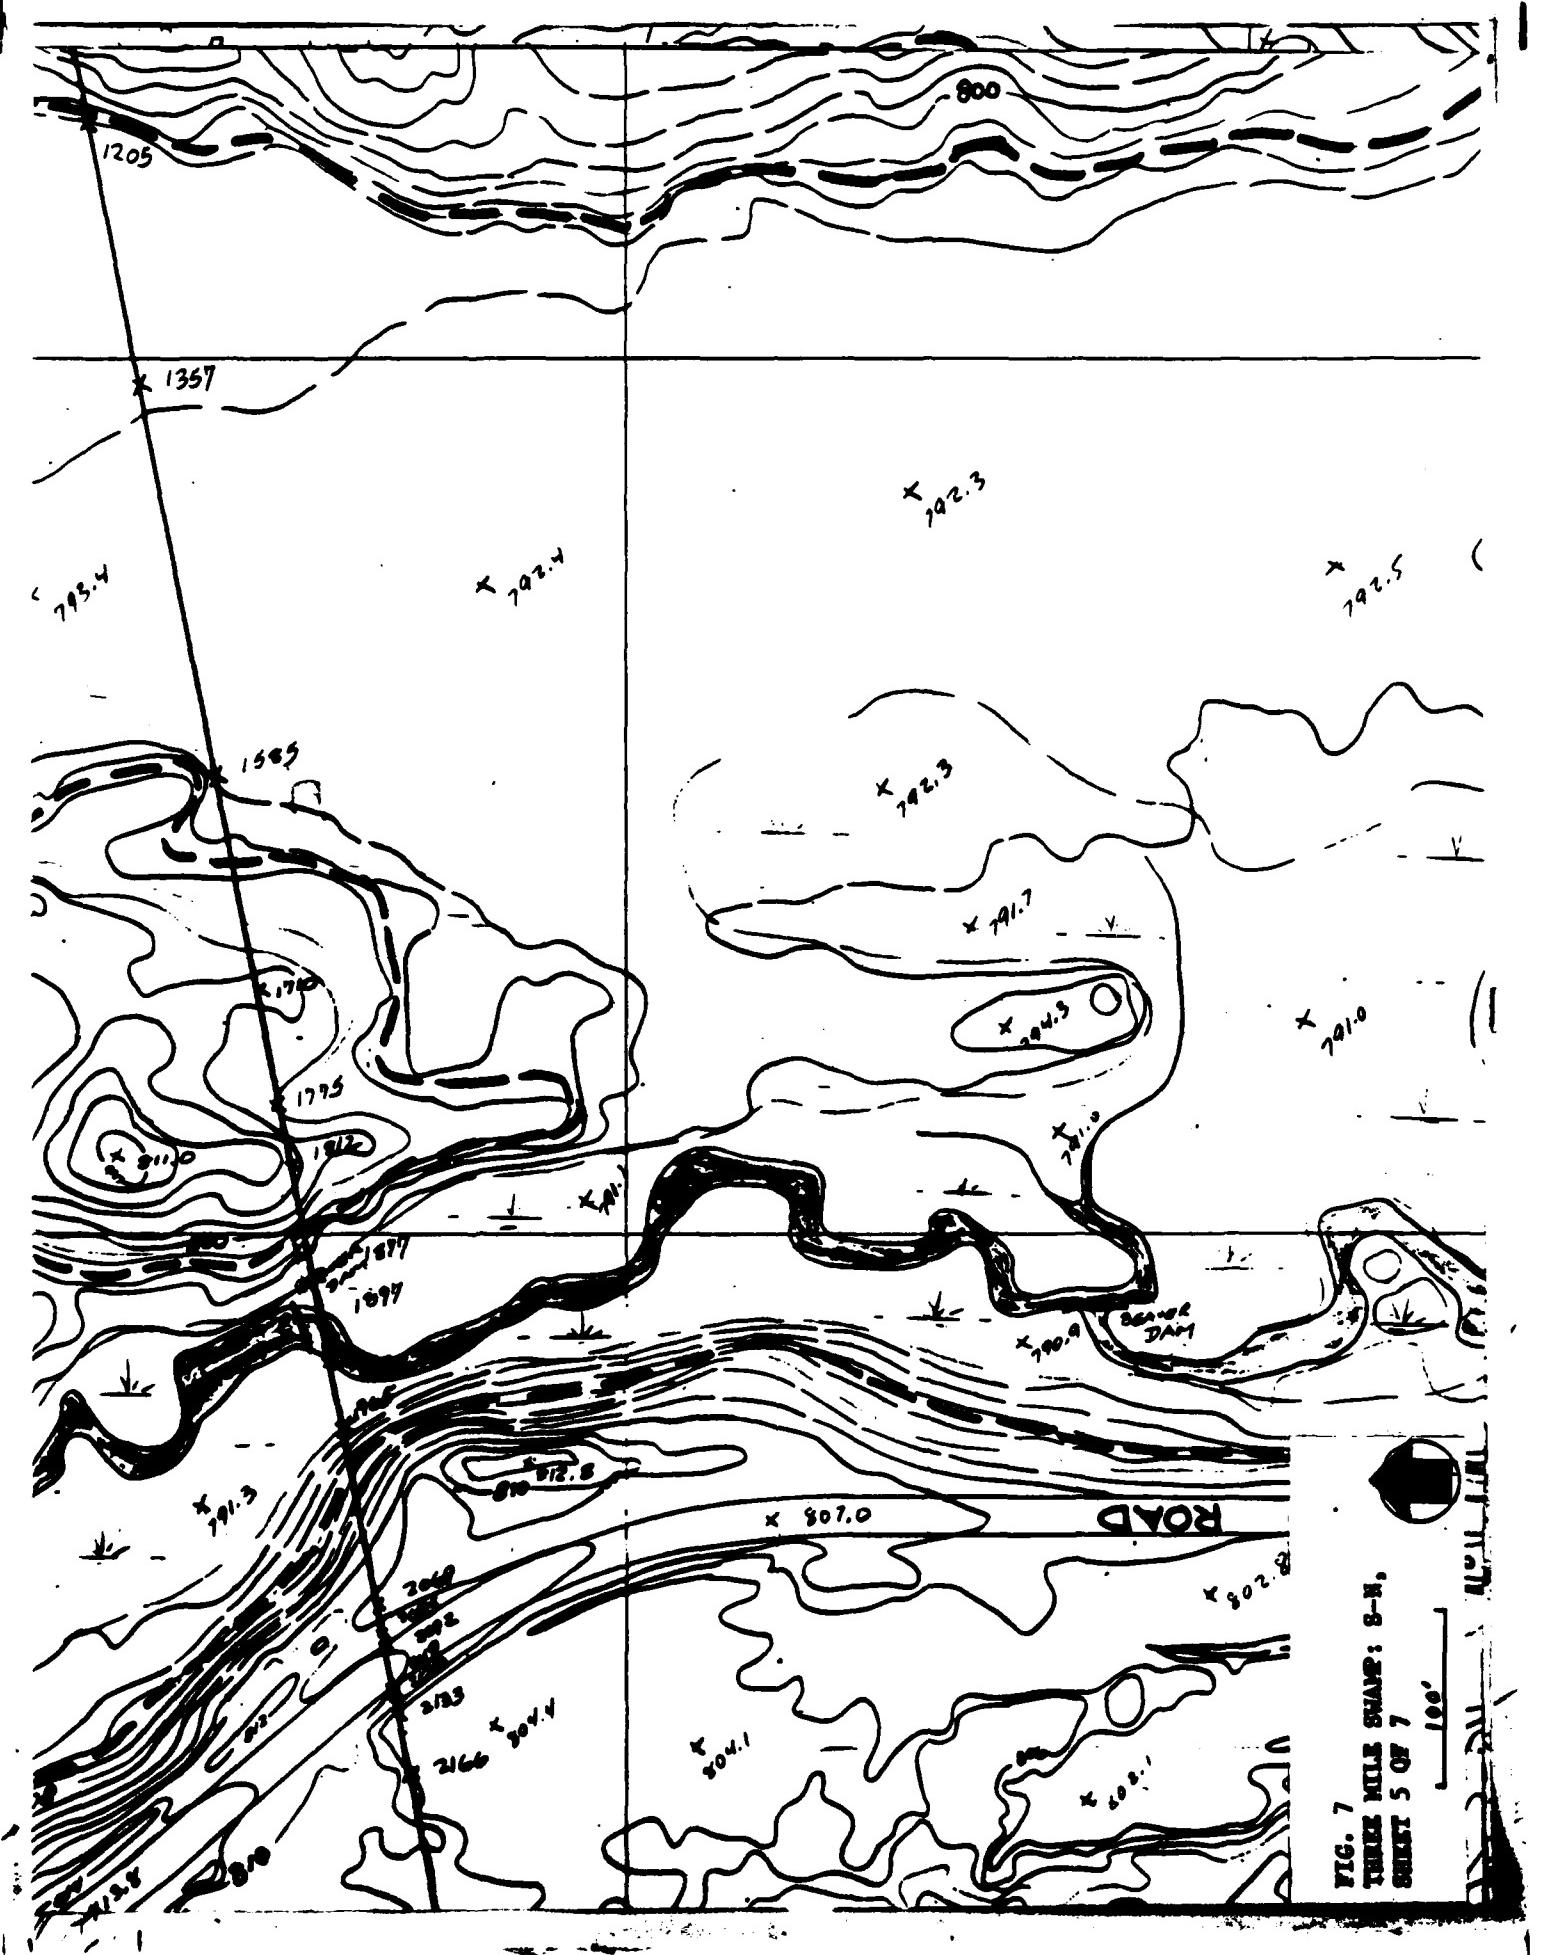


FIG. 7
TYPICAL MILLS SQUARE: 8-11.


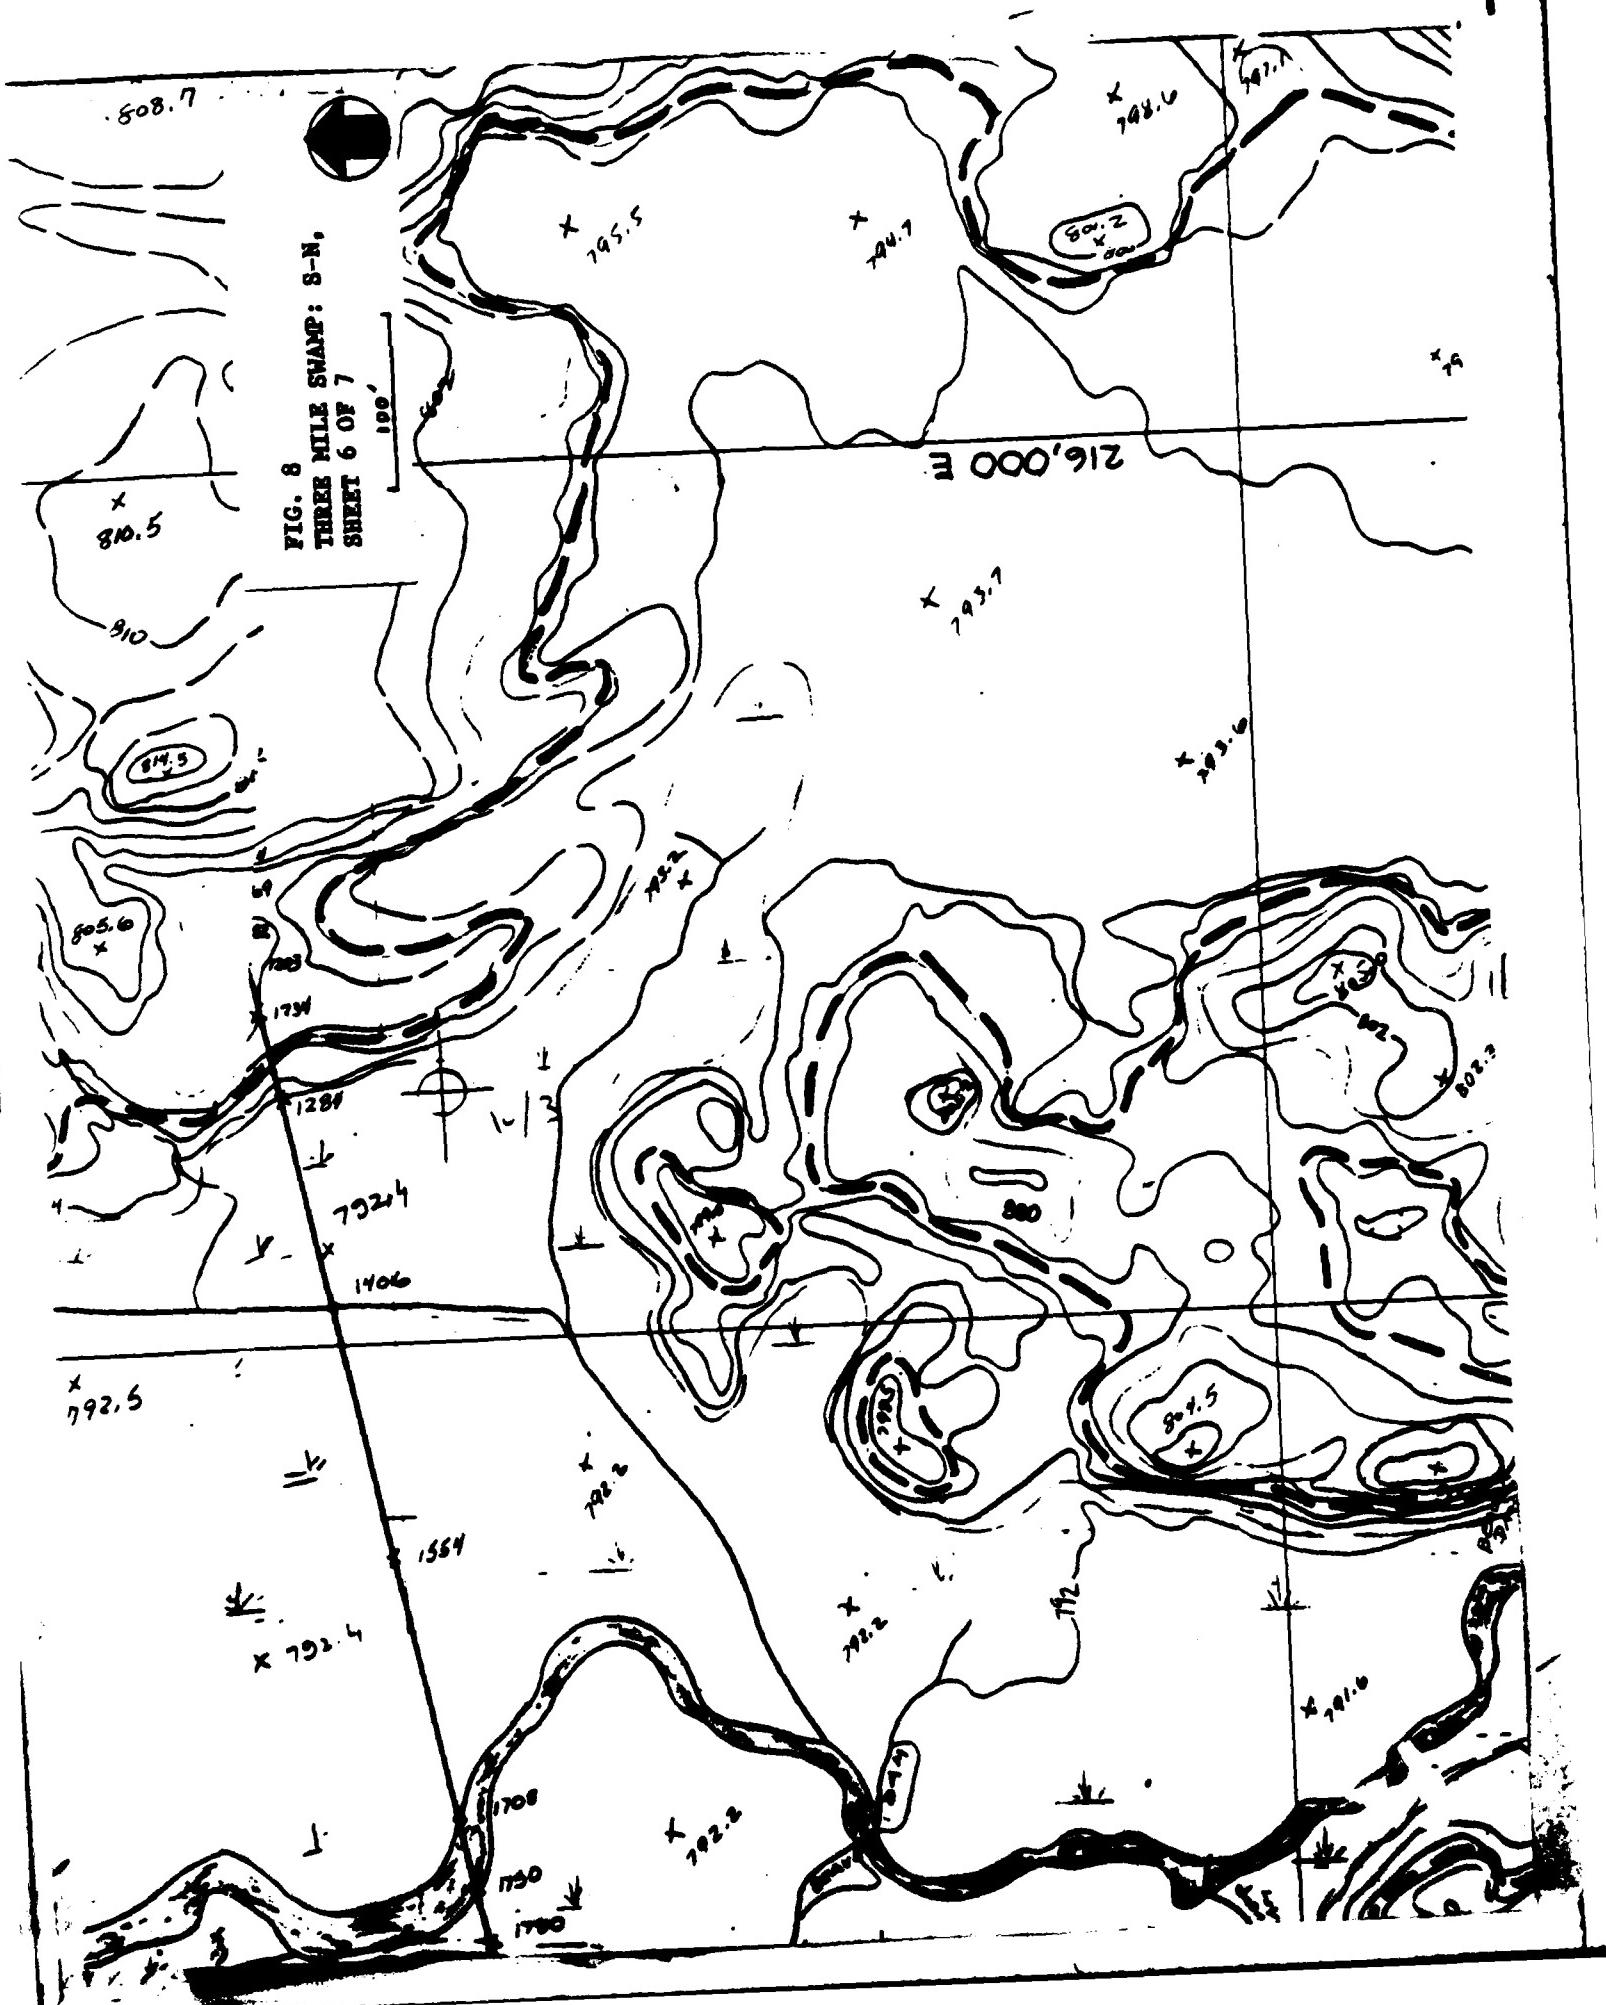



FIG. 9
THREE MILE SWAMP: S-N,
SHEET 7 OF 7

100'

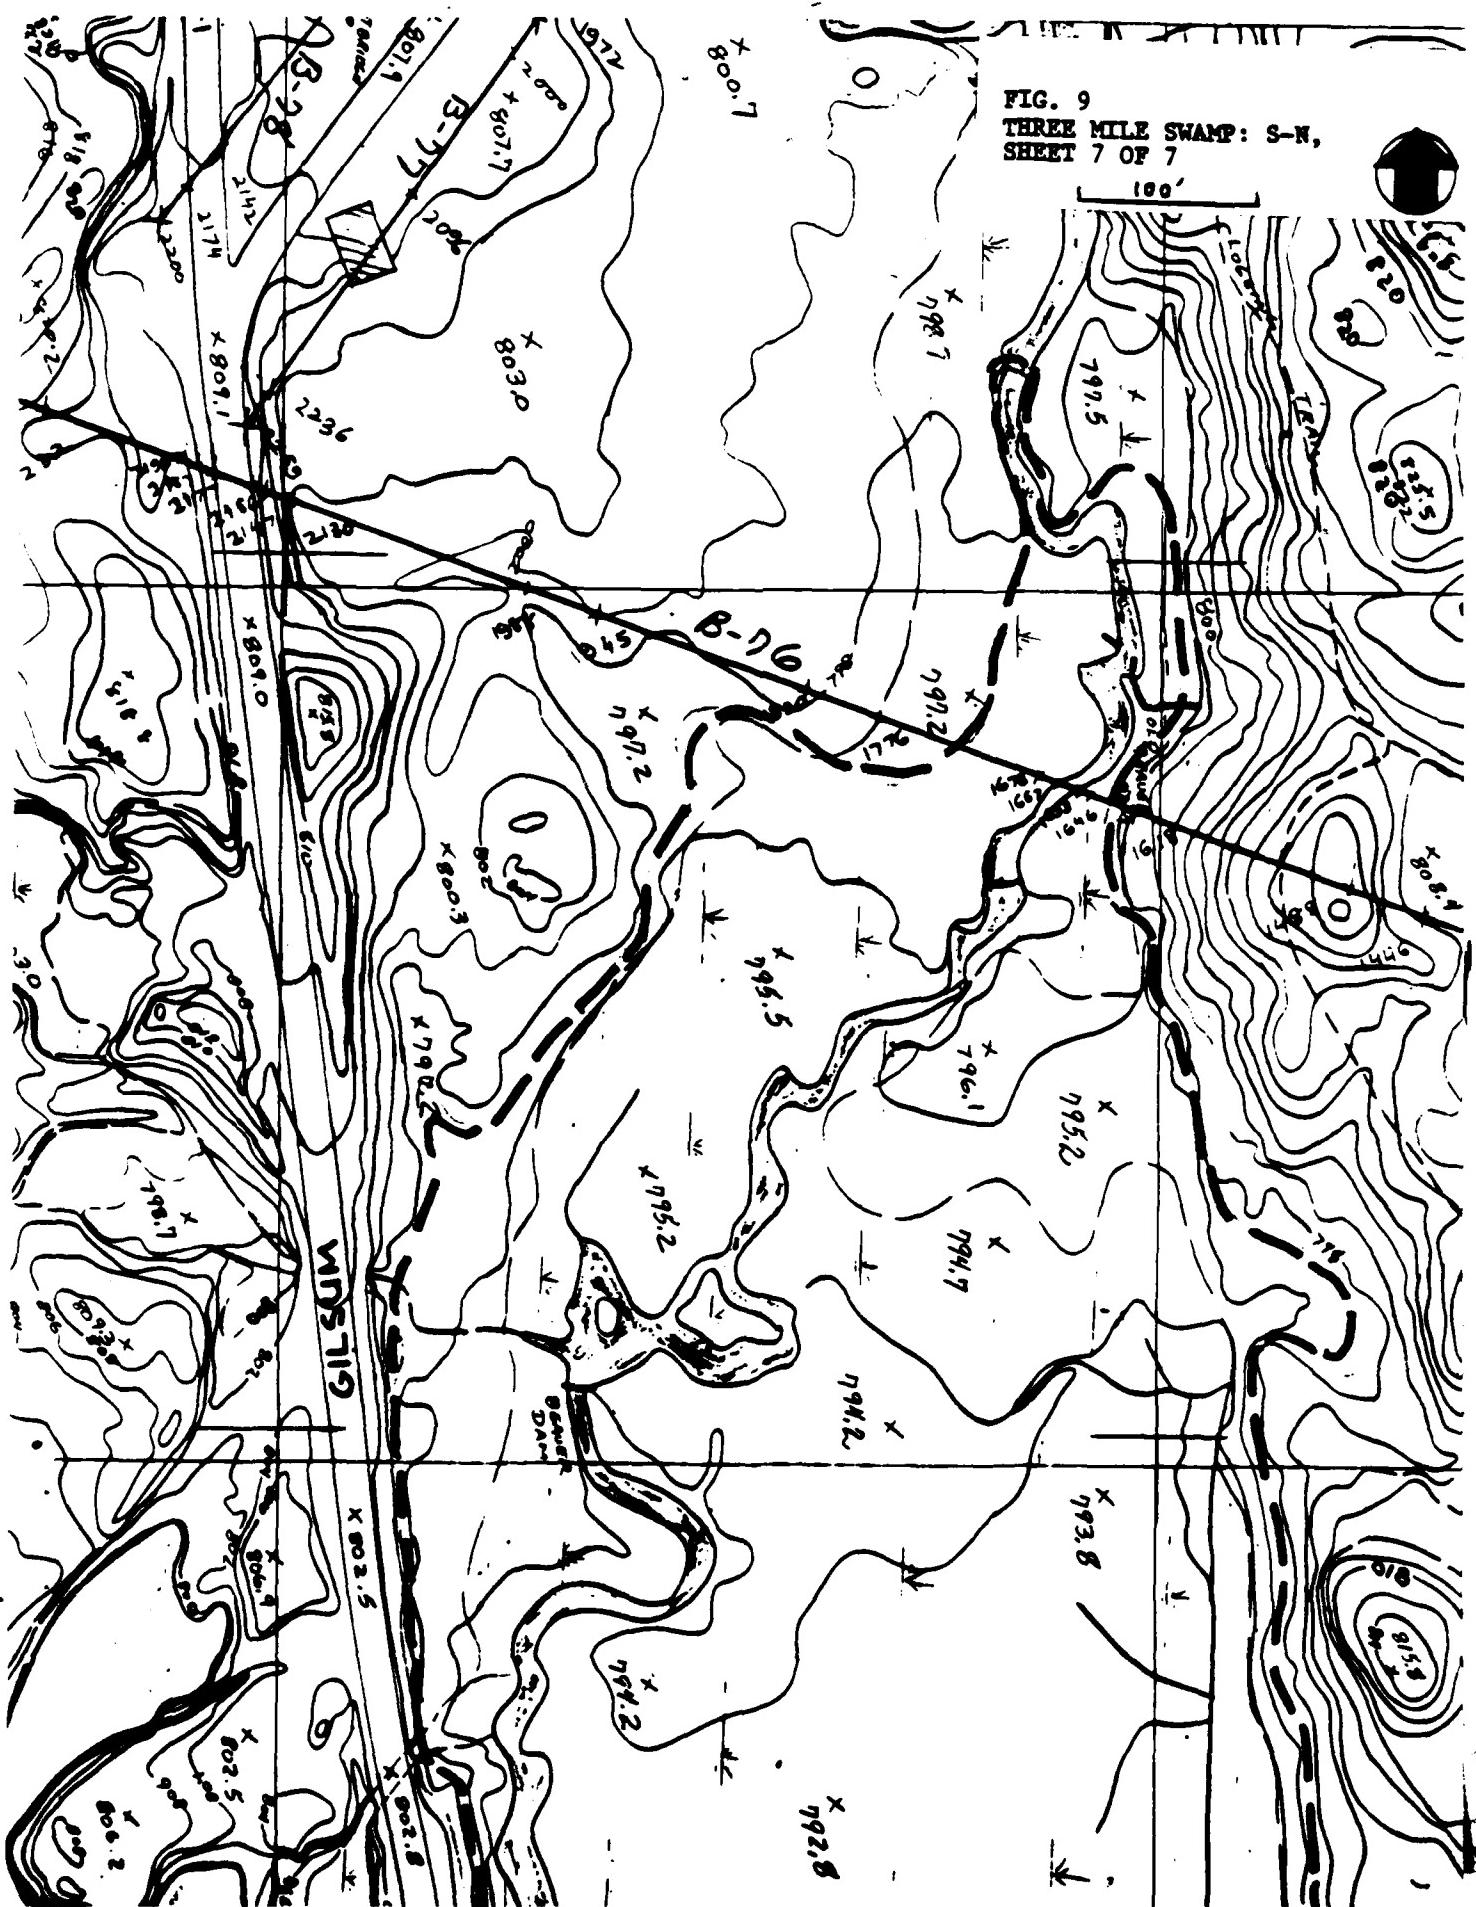

KL

- [Symbol: White box] WELL DRAINED 0-8% SLOPE
- [Symbol: Hatched box] WELL DRAINED 8-15% SLOPE
- [Symbol: Black box with diagonal lines] WELL DRAINED STONY 0-8% SLOPE
- [Symbol: Black box with diagonal lines] WELL DRAINED STONY 8-15% SLOPE
- [Symbol: Black box] SEASONALLY WET
- [Symbol: Hatched box] WET
- [Symbol: White box] SLOPES OVER 15%
- [Symbol: Solid black box] FILL
- [Symbol: Dashed line] PROJECT AREA

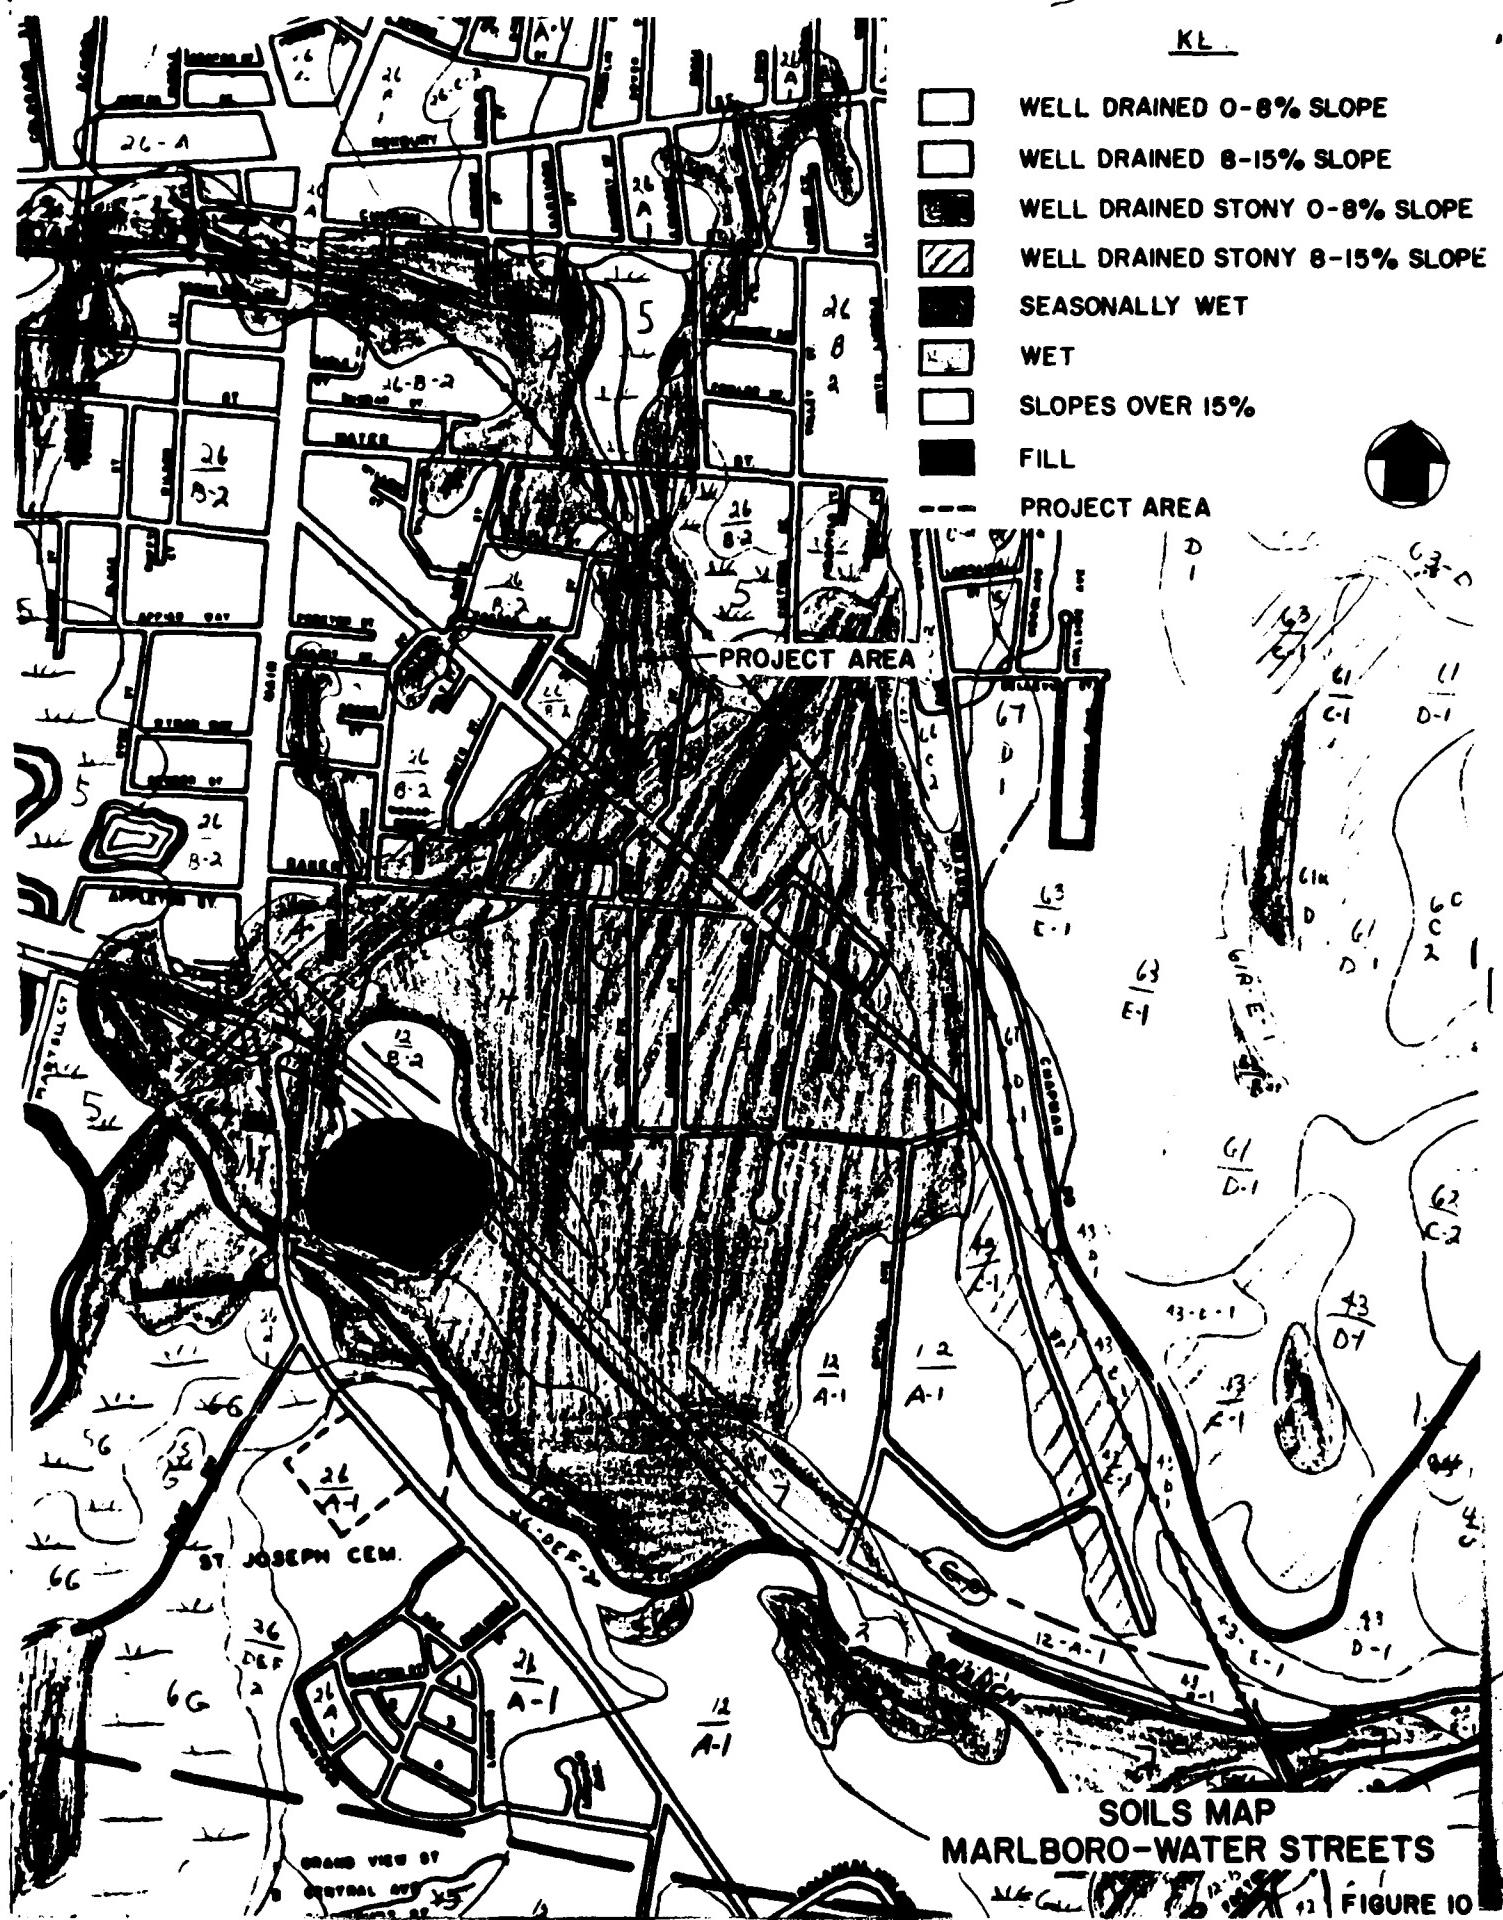

SOILS MAP
MARLBORO-WATER STREETS

FIGURE 10

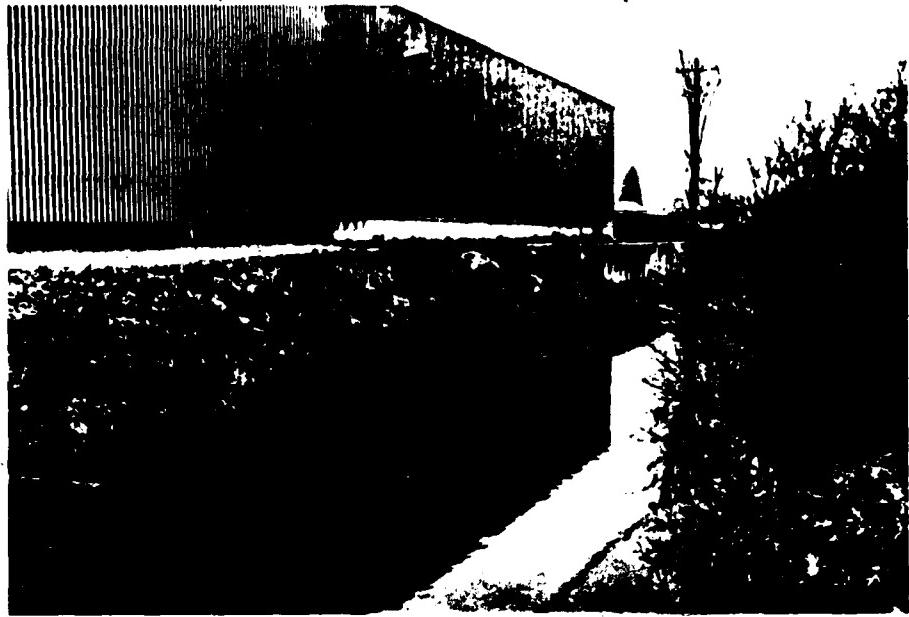


FIG. 11
VIEW S.W. FROM END OF GARDNER ST

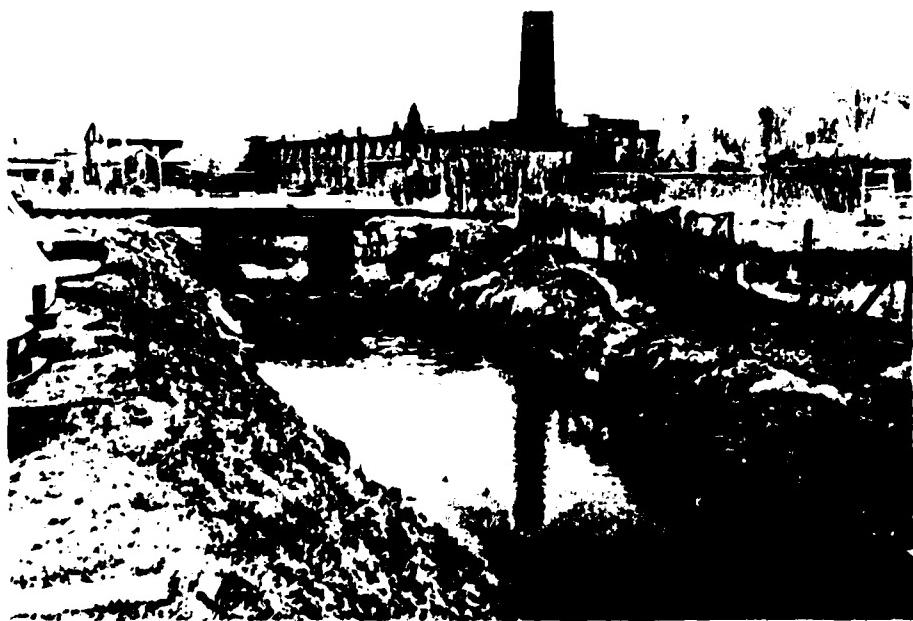


FIG. 12
VIEW N. FROM MYRTLE STREET



FIG. 13
VIEW N. FROM RAILROAD BRIDGE



FIG. 14
DAM AT 3 MILE SWAMP: view to NW

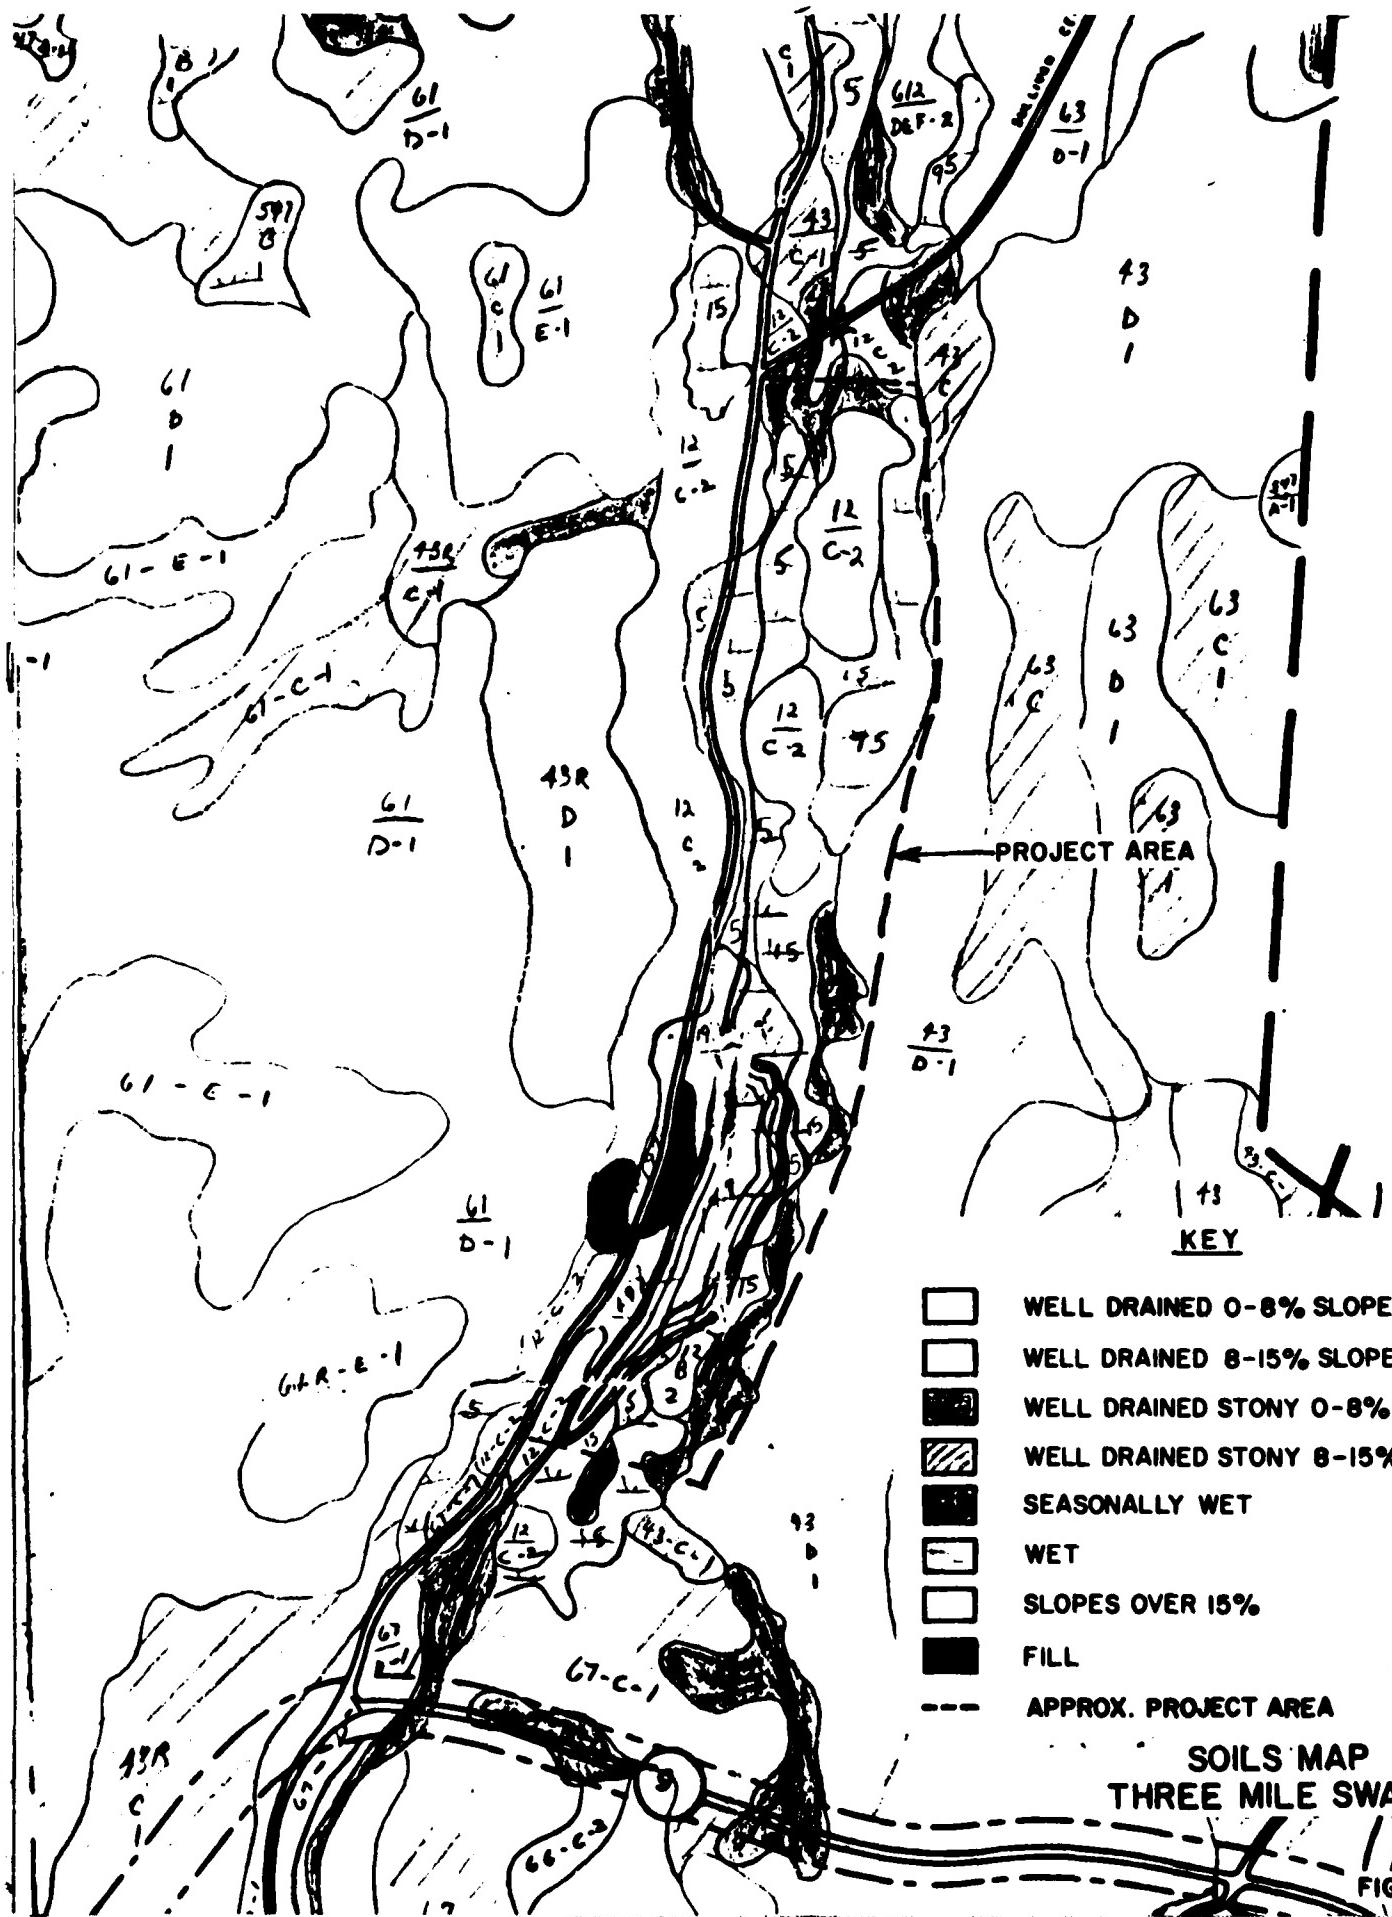


FIGURE 15

TRANSECT RECORD

SITE / SURVEY UNIT THREE MILLE SWAMP, KEESEY, NH

TRANSECT — T-1

INTERVAL: PACES — METERS 20 FEET.

— 10 —

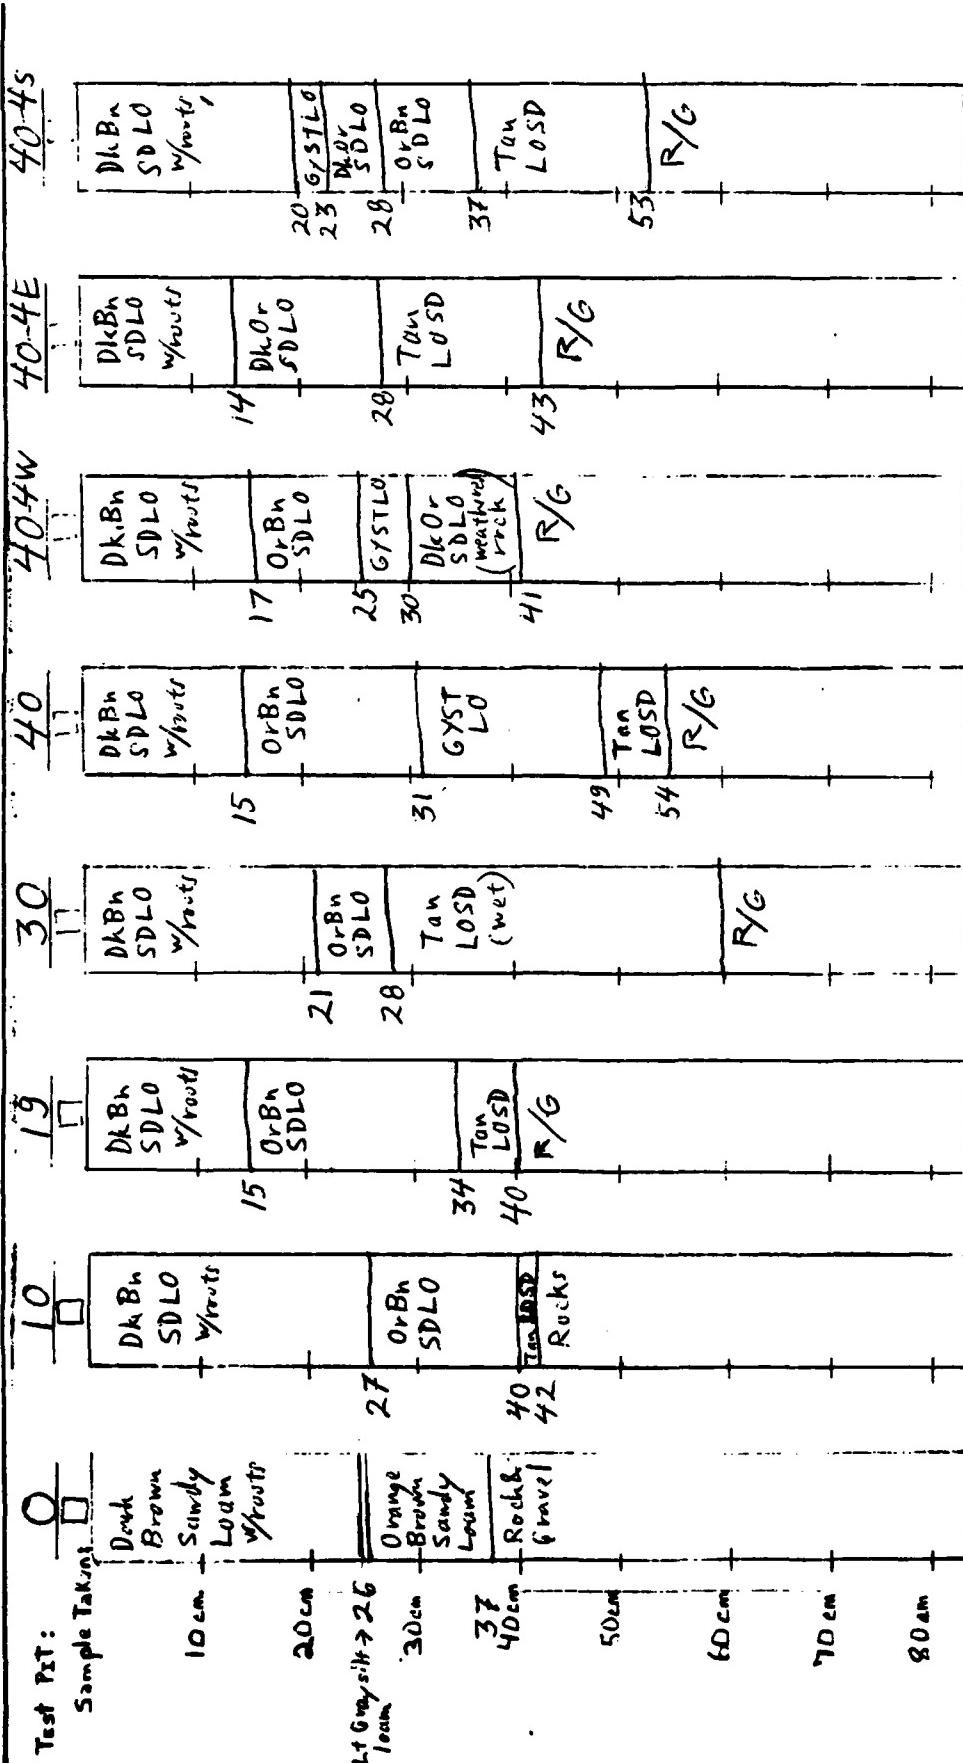


FIG. 16

DATE 6/8/82 **RECORDED BY** J. S. W.

RECORDED J. S. W.

TRANSECT RECORD

SITE/SURVEY UNIT Three Mile Swamp, Keene, NH

TRANSECT T-1 (continued)

INTERVAL: PACES METERS 20 FEET

Test Pit: 40-4N

Sample Taken:

Dk. Brn
SDLo

10 cm + w/roots

20 cm

2.5 Lt. Gr. S. Plw
(wet)

30 cm

Tan
LoSP
(wet)

40 cm

R/G

41

50 cm

60 cm

70 cm

80 cm

50

60

22

25


Tan
LoSP

40 R/G

44 Hard
pan

DATE 6/8/82
RECORDER J. S. W.

FIG. 17

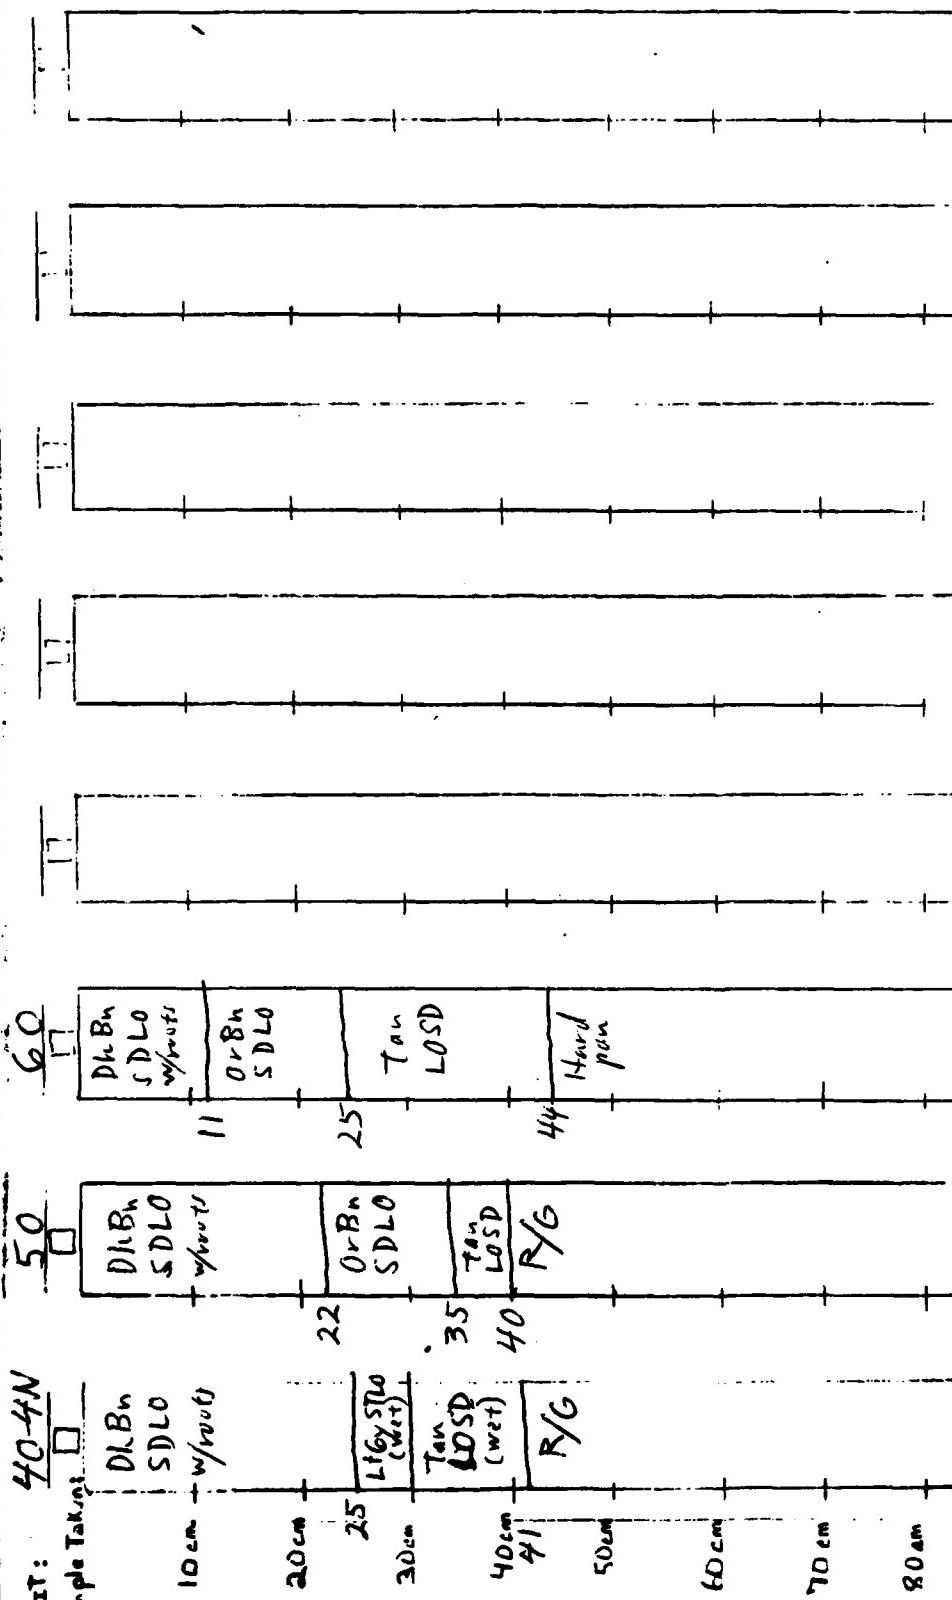

TRANSECT RECORD

SITE/SURVEY UNIT Three Mile Swamp, Keene, NH

TRANSECT T-2

INTERVAL: PACES METERS 20 FEET

Test Pit: 0
Sample Taken: Dk. Bn
SDLo
w/roots

10 cm 8

20 cm Tan
LoSP
RG

30 cm R

40 cm 32
Ltgyst
Lo


50 cm 40
Tan
LoSP
RG

60 cm 45
R

70 cm 48
RG

80 cm 50
RG

DATE 6/9/82
RECORDED J.S.W.
(Note: M130 on steep slope)

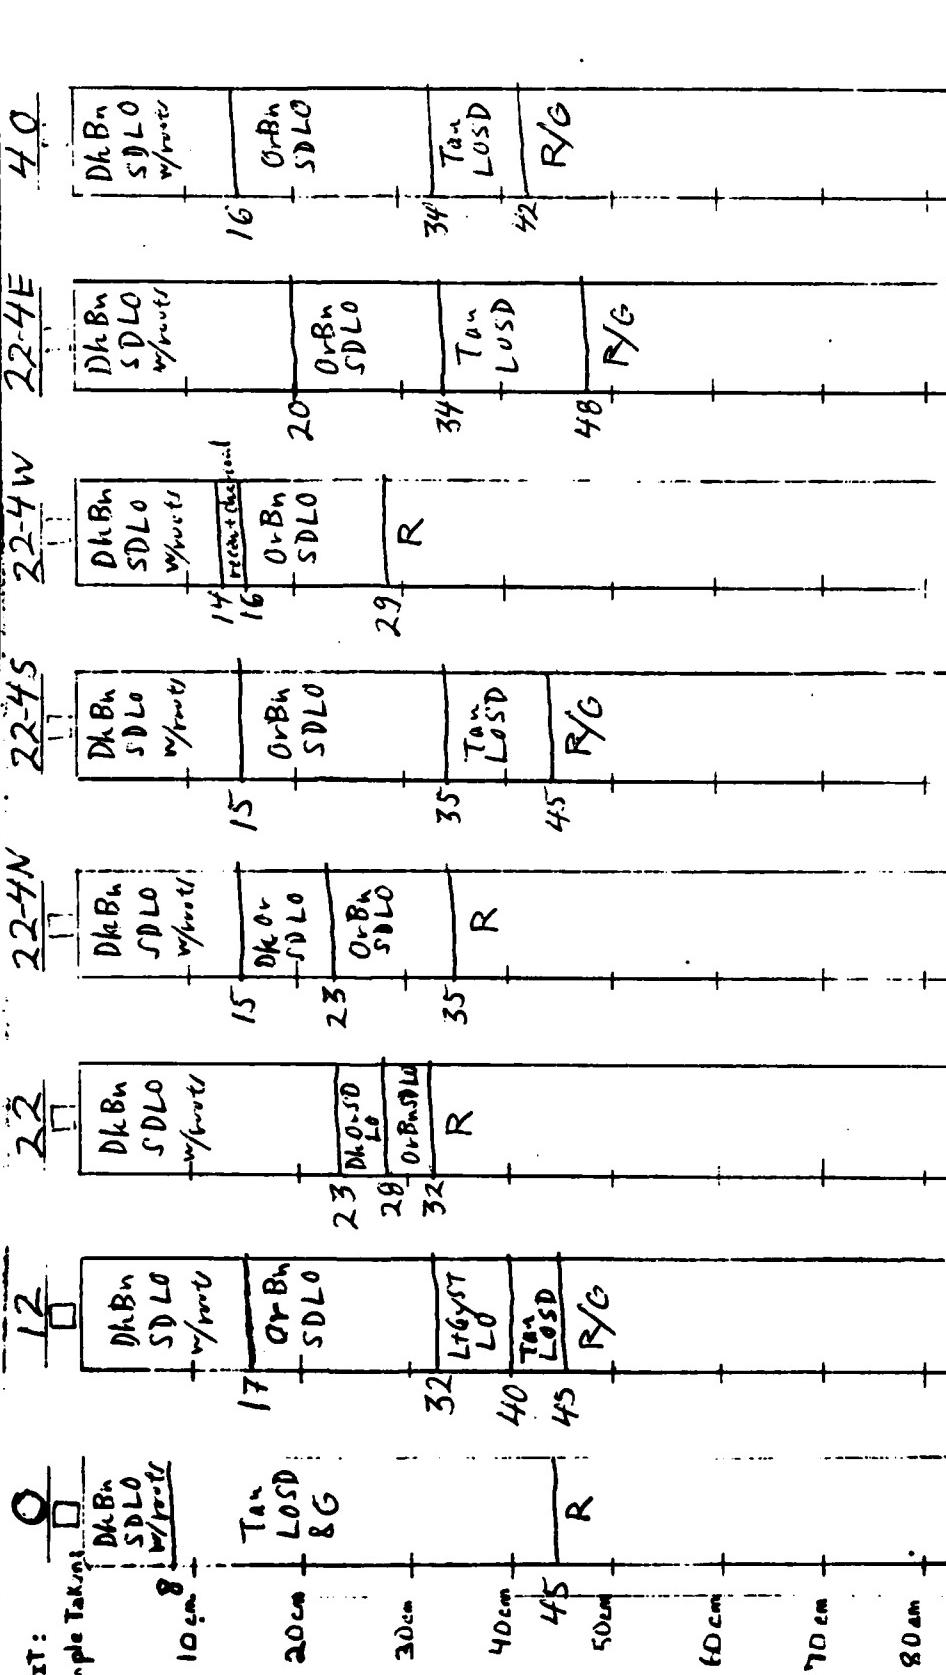

TRANSECT RECORD

SITE/SURVEY UNIT Three Mile Spring, Kechi N.H.
TRANSECT T-2 (Cont'd/reduced)

INTERVAL: PACES METERS 20 FEET

DATE 6/9/82
RECORDER J. S. W.

Test Pit: 50

Sample Taken:

D1, Bn

S D L O
(vert)
efforts

10 cm

20 cm

28

30 cm

33

39

40 cm

50 cm

60 cm

70 cm

80 cm

0' Bn

S D L O


T o g (vert)

L O S D

Hard

Pan

FIG 19

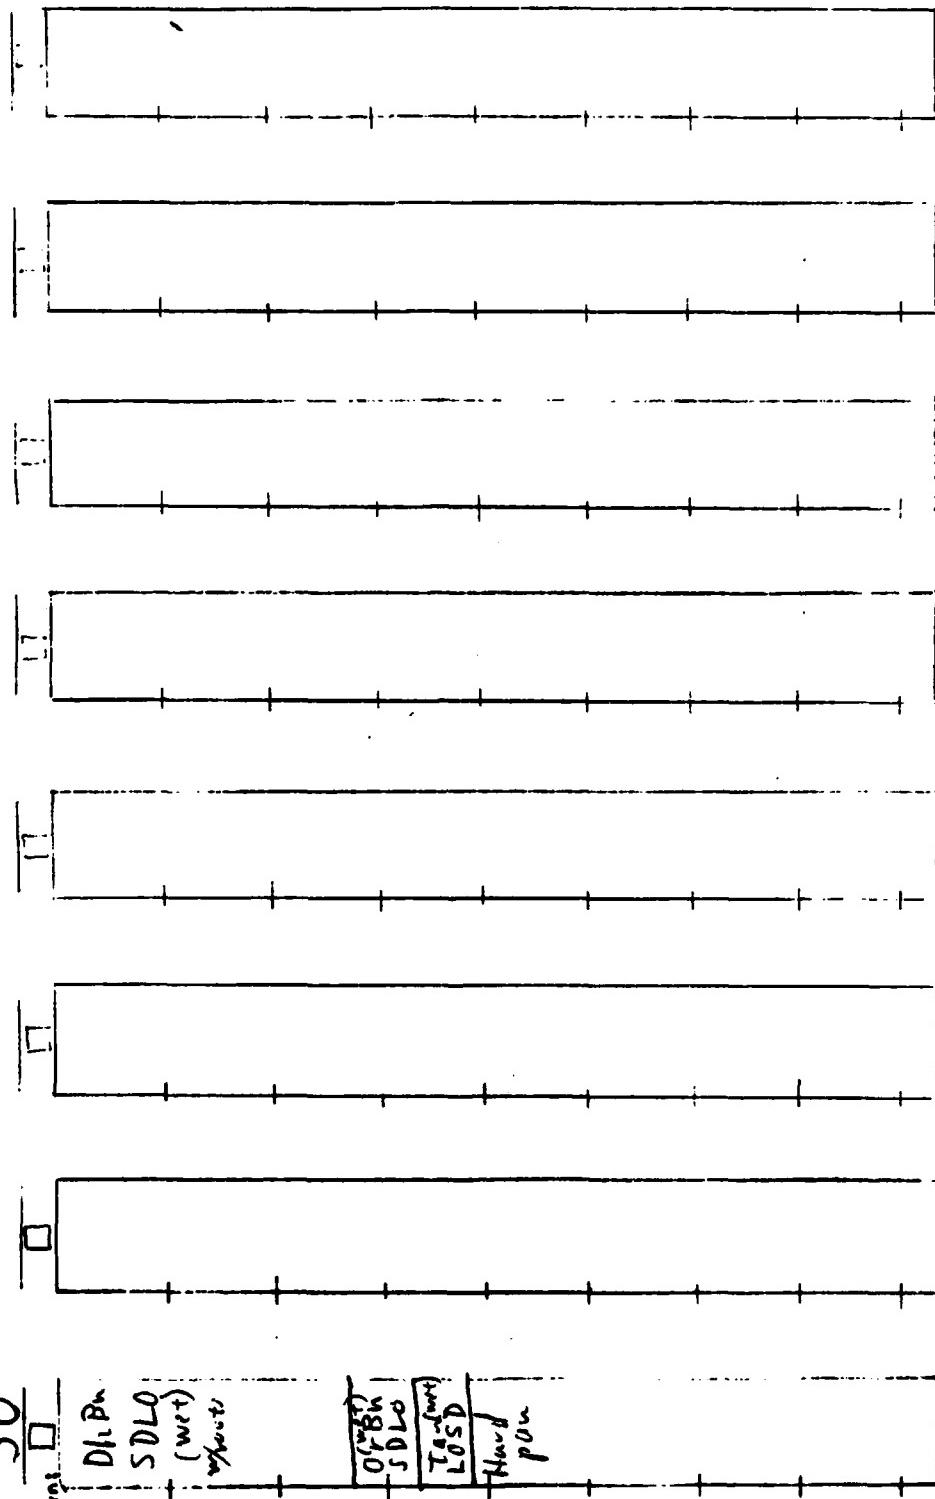

TRANSECT RECORD


SITE / SURVEY UNIT Three Mile Swamp, Keene, NH

TRANSECT T-3

INTERVAL: PACES METERS 2.0 FEET

DATE 6/15/82
RECORDER J. S. W.

FIG. 20

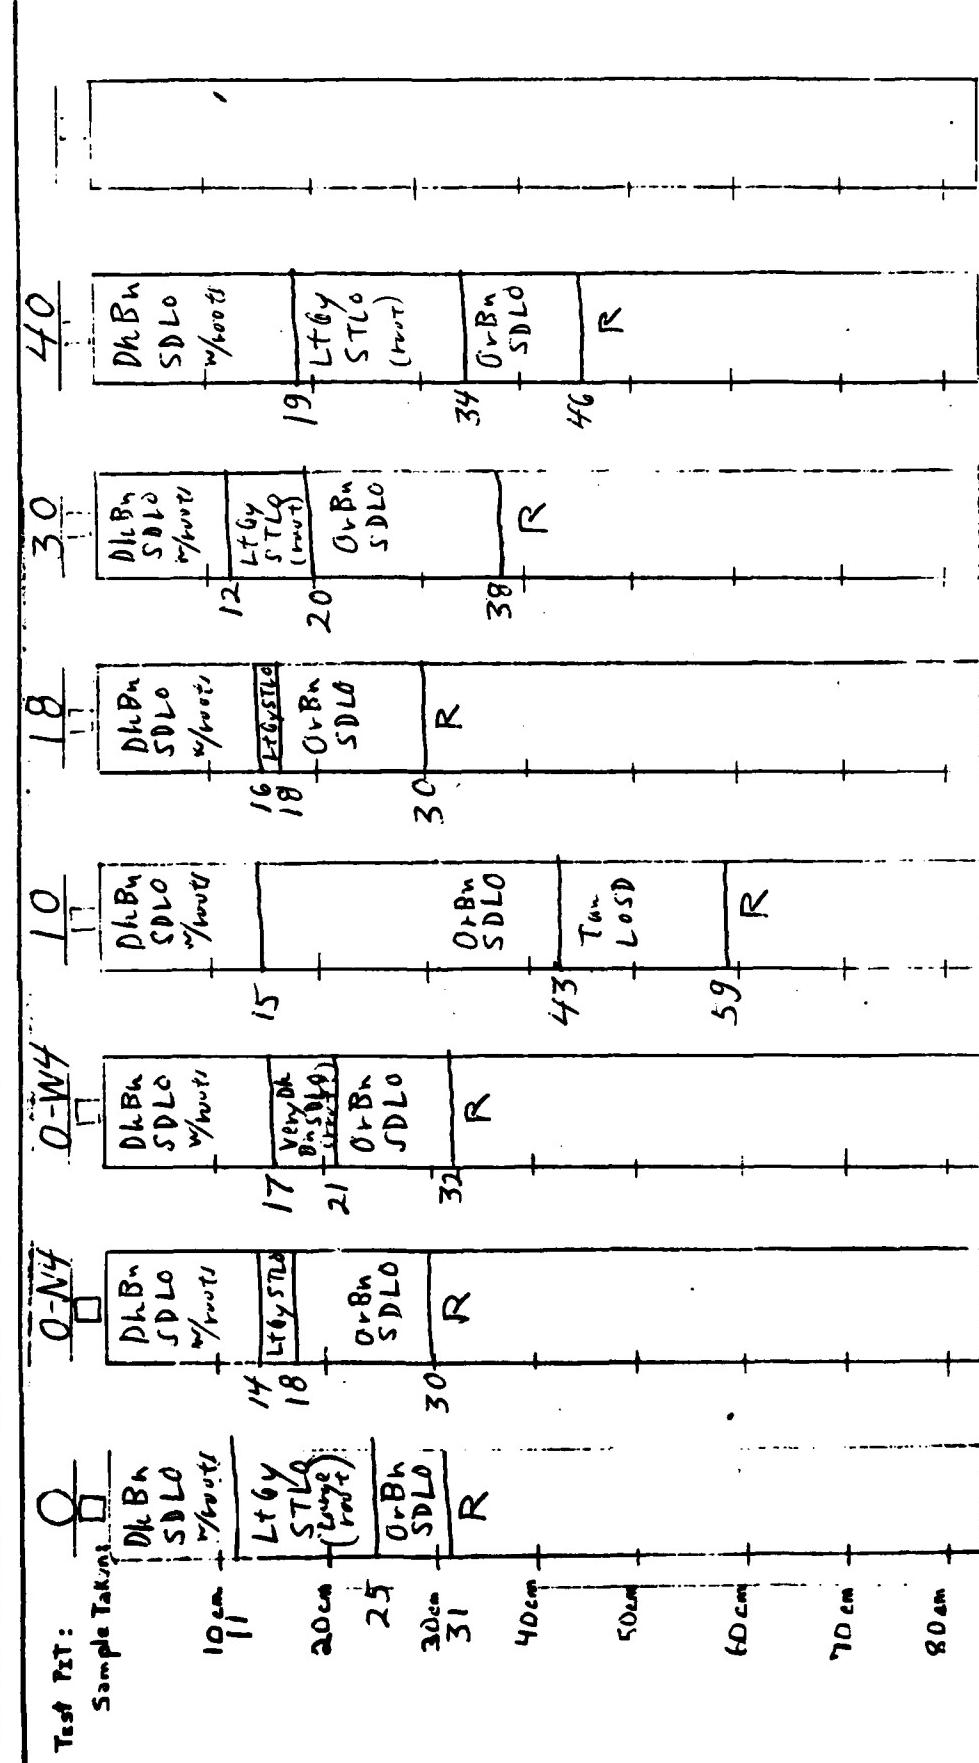

TRANSECT RECORD

SITE/SURVEY UNIT Three Mile Swamp, Lee County, FL

TRANSECT T-4

INTERVAL: PACES METERS 20 FEET

Test Net: O
Sample Taken:

Dk Br	SD Lo	+ w/wo w
Or Br	SD Lo	25 very Br
SD Lo	27 L+6y	SD Lo
32	36 very Br	Or Br
Lo Spd	38 very Br	SD Lo
40 cm	R	57 R
50 cm		50 Ton
60 cm		Load
70 cm		
80 cm		

FIG. 21

DATE 6/15/82
RECORDER J. S. W.

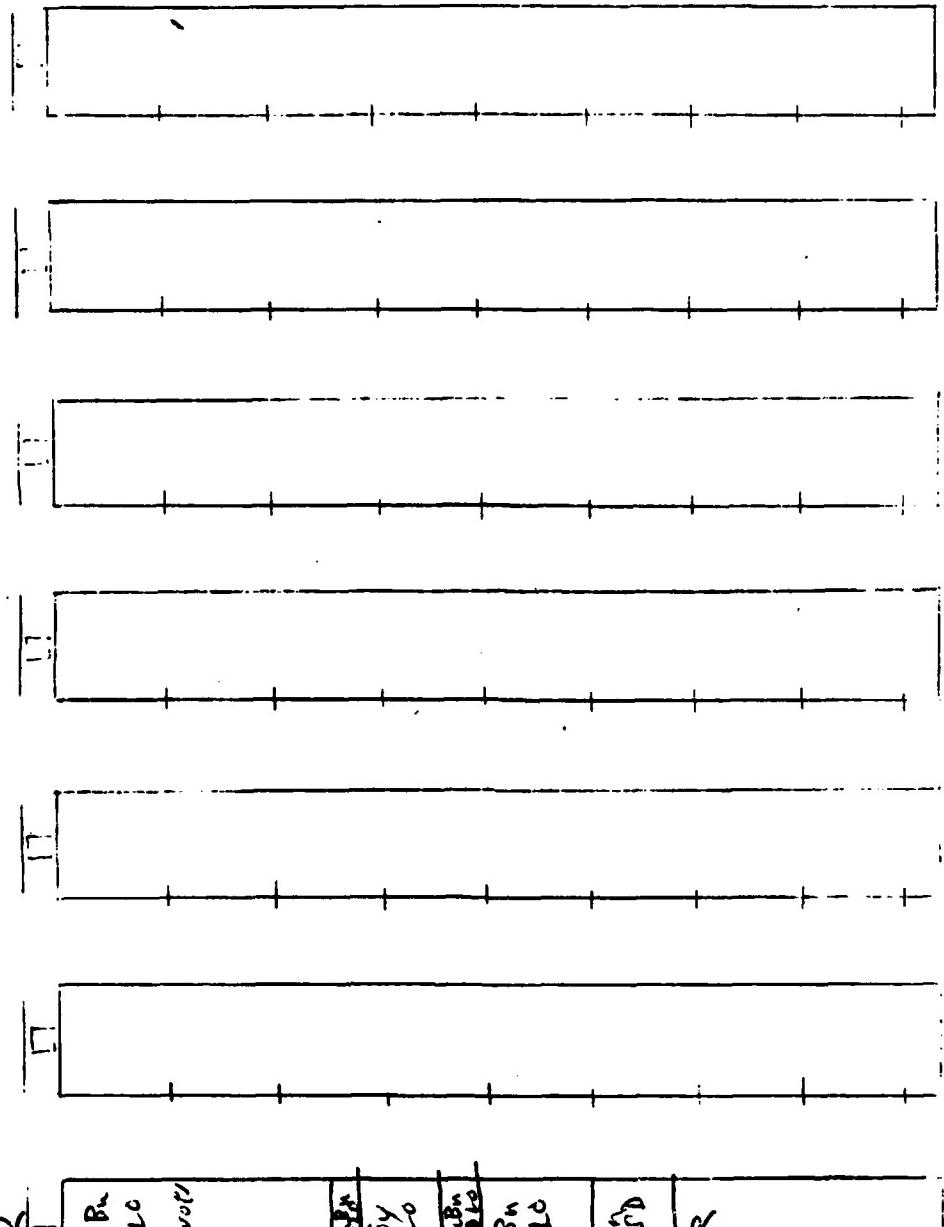


FIGURE 22
LIST OF MATERIALS RECOVERED

<u>Test Pit</u>	<u>Material</u>	<u>Description</u>
T-1:TP-40	Clear Quartz	Possible rectangular biface no distal portion, base incurvate-thinning flake scars, thumbnail size.
	Clear Quartz	Possible biface frag.
T-2:TP-22	Clear Quartz	Possible rectangular biface, no distal portion, base incurvate-thinning flake scars, convex cross-section, thumbnail size.
T-3:TP-0	Coarse Grained Quartzite	Cortex on dursal surface, possible flaking along edges, edges crushed, ventral surface-large broad flake scars, possible natural shattering.
T-4:TP-0	Smoky Quartz	Small triangular flake, no striking platform or bulb of percussion. Dorsal surface has central flake scars. Distal tip has step fracture, base shaped/rounded on ventral surface, sharp on dorsal surface.

SECTION E


REAL ESTATE

DEPARTMENT OF THE ARMY
NEW ENGLAND DIVISION, CORPS OF ENGINEERS
424 TRAPELO ROAD
WALTHAM, MASSACHUSETTS 02154


PRELIMINARY ESTIMATE OF REAL ESTATE COSTS
THREE-MILE SWAMP
AND
CHANNEL IMPROVEMENTS
BEAVER BROOK LOCAL FLOOD PROTECTION
KEENE, NEW HAMPSHIRE

MARCH 1983

PREPARED BY

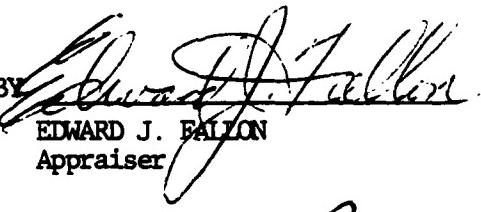
EDWARD J. FALLON
Appraiser

APPROVED BY

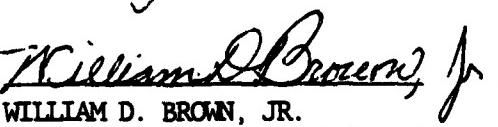
WILLIAM D. BROWN, JR.
Acting Chief, Appraisal Branch

PURPOSE

The purpose of this report is to estimate the preliminary real estate costs concerning the Beaver Brook Local Flood Protection Project in Keene, New Hampshire.

INSPECTION OF THE REAL ESTATE

The properties affected by the proposed project were viewed in the field during January and February 1983 by this writer.

LOCATION

The first part or upper portion of the proposed project is located in the northwesterly section of the city of Keene adjacent to Route 10 in an area known as Three-Mile Swamp.

The second part, Channel Improvement, or lower Beaver Brook basin lies along Beaver Brook between Water and Marlboro Streets. Both Water and Marlboro Streets commence in the downtown area of the city of Keene.

PROJECT DESCRIPTION Three-Mile Swamp

The Three-Mile Swamp area consists of constructing a larger dam at the site of the existing rockwall dam which is located in the southerly section of Three-Mile Swamp. The construction would improve storage conditions during flood periods by creating a permanent pool of approximately 70 acres at elevation 790 feet NGVD during non-flood periods. During the standard project flood, the pool is expected to rise to elevation 797 feet NGVD thus, inundating an additional 50 acres of land.

The project would affect approximately 11 ownerships of which one is considered to be of public ownership, Route 10.

CHANNEL IMPROVEMENTS

The Channel Improvements would be constructed in the lower Beaver Brook basin between Water and Marlboro Streets. The improvements will consist of widening the channel in some areas and installing stone rip rap along the side slopes. The overall width of the channel would be increased by about 30 feet to an overall width of about 60 feet. The channel enlargement from its point of beginning at the southerly side of the bridge on Water Street would affect 8 private and 1 public ownership (B&M Railroad) and would extend downstream a distance of about 1700 feet following the brook's course and terminating on the northerly side of Marlboro Street. At this time no known improvements will be affected.

TAX LOSS

The anticipated tax loss for the Beaver Brook study based upon the 1982 Tax Assessment of \$33.60 per thousand is estimated to be about \$1000.00.

ACQUISITION COSTS

Acquisition costs will include costs for mapping, surveying, legal descriptions, title evidence, appraisals, negotiations, closing and administrative costs for possible condemnations. The acquisition costs are based upon this office's experience in similar civil works projects in the general area and are estimated at \$3,000 per ownership. About 20 total ownerships will be affected of which 11 are attributable to the three-mile swamp area while the remainder is for the channel improvement area.

RELOCATION ASSISTANCE COSTS

Public Law 91-646, Uniform Relocations Assistance Act of 1979, provided for uniform and equitable treatment of persons displaced from their homes, businesses, or farms by a Federally Assisted Program. It also establishes uniform and equitable land acquisition policies for these projects. Included among the items under PL 91-646 are the following:

- a. Moving Expenses
- b. Replacement Housing (Homeowners)
- c. Replacement Housing (Tenants)
- d. Relocation Advisory Services
- e. Recording Fees
- f. Transfer Taxes
- g. Mortgage Prepayment Costs
- h. Real Estate Tax Refunds (Pro-rata)

Within a reasonable time prior to displacement, the taking authority must certify that there will be available, in areas generally not less desirable and at rents and prices within the financial means of the families and individuals displaced, decent, safe, and sanitary dwellings, equal in number to the number of, and available to, such displaced persons who require such dwellings and reasonably accessible to their places of employment.

There are no known ownerships in the area to be acquired in fee where the people would have to be relocated. Therefore, the following estimates are included for planning purposes to cover the implementation of this act.

Three Mile Swamp

10 Private Ownerships	@	\$200	=	\$2,000
1 Public Ownership	@	\$200	=	<u>200</u>
				\$2,200

Channel Improvement

8 Private Ownerships	@	\$200	=	\$1,600
1 Public Ownership	@	\$200	=	<u>200</u>
	Total			\$1,800
				\$4,000

SEVERANCE DAMAGES

Severance damages usually occur when partial takings are acquired which restrict the remaining portion from full economic development. The severance damages are measured and estimated on the basis of "before" and "after" appraisal methods and will reflect actual value loss incurred to the remainder as a result of partial acquisition. Detail appraisals will reflect these losses. Preliminary investigation indicate that no severance damages is anticipated by the proposed project. However, for planning purposes costs for severance damages if any are provided for in the contingency factor.

PROTECTION AND ENHANCEMENT OF CULTURAL ENVIRONMENT

In accordance with instructions set forth in teletype DA (DAEN) R 191306A, dated October 1971, Subject: "EO11593, 13 May 1971, Protection and Enhancement of Cultural Environment"; a study has been made in the subject areas. The study revealed that no local, State, Federally owned nor Federally-controlled property of historical significance would fall within the provisions of EO 11593.

CONTINGENCIES

A contingency allowance of 20 percent is considered to be reasonable adequate to provide for possible appreciation of property values from the time of this estimate to acquisition date, for possible minor property line adjustments or for additional hidden ownerships which may be developed by refinement to taking lines, for adverse condemnation awards and to allow for practical and realistic negotiations.

GOVERNMENT-OWNED FACILITIES

Section III of the Act of Congress approved 8 July 1958, (PL 85-500) authorized the protection, realteration, reconstruction, relocation or replacement of municipally-owned facilities. A preliminary inspection of the property area indicated no Government-owned facilities are affected.

FEE REQUIREMENTS

Three-Mile Swamp

Preliminary investigations indicate that no improvements would be affected in the Three-Mile Swamp area. The Three-Mile Swamp area is comprised of undeveloped lands with most of the 70 acres being of wetlands, scrub growth and vegetation commonly found in wetland areas. There are some trees along the perimeter areas but nothing that would have a commercial value.

Therefore, the fee areas that are necessary for acquisition are estimated as follows:

5 Private Ownerships
70 acres @ \$375.00 per acres = \$26,250

EASEMENT AREAS

Permanent Easement Areas

Permanent easements for construction and maintenance purposes is necessary and are as follows:

Three-Mile Swamp

A permanent right-of-way access over the existing right-of-way that lies just south of the dam is necessary for construction and maintenance purposes. The right-of-way would commence on the easterly sideline of Route 10 and extend approximately 300 feet in an easterly direction and then turn and extend approximately 150 feet in a northerly direction. This access route would be 25 feet wide and contain 11,250 square feet.

Additional permanent easements for flowage are necessary and would extend out from the permanent pool at elevation 790 feet NGVD to elevation 797 feet NGVD. The easement areas vary in width due to the topographical layout of the area, and contain about 50 acres and would affect approximately 11 ownerships of which one is considered to be public in that of Route 10.

Channel Improvements

Channel Improvements would necessitate the widening of portions of the existing channel, of Beaver Brook, between Water and Marlboro Streets, Approximately 30 feet to a top width of about 60 feet. The easement areas vary in width throughout the project area and contain about 0.39 acres of private lands.

The realignment of portions of the river would affect approximately 8 private and one public ownership(s) (Boston & Maine Railroad).

Preliminary investigations indicate that after the imposition of the permanent easement interest, the highest and best use of the remainders of the properties affected will not be materially affected. The cost to acquire the permanent easement areas would be equivalent to the underlying

fee value since those uses would be for project purposes. However, lands would remain in their private ownerships to maintain conformity of their existing lot areas.

The following costs are predicated on estimated market values as indicated below:

Three-Mile Swamp
Right-of-Way

0.26⁺ acres Private Land

@ \$375.00 per acre \$ 97.00

Flowage Easement

50⁺ acres Private Land \$18,750.00

50.26⁺ Total Acres Total \$18,847.00
Call \$18,900.00

Channel Improvements

13,000 square feet (0.30⁺ acres) Private Land (Commercial Use)

@ \$1.11 per square foot \$14,430.00

4,000 square feet (0.09⁺ acres) Private Land (Residential Use)

@ \$0.60 per square foot \$ 2,400.00

17,000 square feet (0.39⁺ acres) Total Total \$16,830.00
Call \$16,800.00

TEMPORARY CONSTRUCTION EASEMENTS

The temporary construction easements which are necessary for construction and staging areas are as follows:

Three-Mile Swamp

A temporary construction easement in the form of a staging area comprised of a one acre parcel located adjacent to the dam.

Channel Improvements

Approximately one acre for a staging area is necessary in the Marlboro Street area. Additional temporary construction easements 25 feet wide, containing about 1.51⁺ acres, along each side of the channel widening is required.

All of the $1.51\pm$ acres are under private ownership with approximately $1.08\pm$ acres being for commercial/industrial use and the remaining $.43\pm$ acres for residential use.

The land areas to be encumbered by temporary easements are predicated upon a fair return of invested capital, for use of the owner's land for a one year term. Therefore, based on the indicated market values the following estimates are given:

Three-Mile Swamp

Staging Area

1.0 \pm acres Private Land @ \$375.00 per acre	\$375.00
---	----------

Fair Return

@ 15% per year (for one year)	\$ 56.00
(\$375.00 X .15 = \$56.25)	Call \$100.00

Channel Improvements

Staging Area

1.0 \pm acres Private Land @ \$1.11 per square foot	\$ 48,352.00
--	--------------

Channel Area

1.08 acres Private Land @ \$1.11 per square foot	51,338.00
0.43 \pm acres Private Land @ 0.60 per square foot	11,250.00

1.51 \pm Total Acres	Total	\$110,940.00
------------------------	-------	--------------

Fair Return

@ 15% per year (for one year)	\$ 16,641.00
Call	\$ 16,700.00

\$110,940.00
.15%
\$ 16,641.00

CONCLUSIONS AND SUMMARY OF REAL ESTATE COSTS

The areas of study for the Beaver Brook Local Flood Protection Study are based upon lines super imposed upon assessors and topographic maps.

The contents of this report are subject to refinement prior to acquisition and the proposed construction.

The value of the lands within the project areas have been estimated by use of the market data or Sales Comparison approach. A search was conducted in the general area to obtain market data. Local officials, Real Estate Brokers and Appraisers were interviewed to obtain data and value estimates.

SUMMARY OF REAL ESTATE COSTS

There follows and estimate of the real estate costs for the interests proposed for acquisition for a one year period.

Three-Mile Swamp

Lands

Fee Acquisition	\$26,250
Permanent Easements	18,900
Temporary Easements	<u>100</u>
	\$45,250
Contingency - 20% of Above	<u>9,050</u>
Sub Total	\$54,300
Acquisition Costs	33,000
Relocation Assistance Costs	2,200
Total Estimated Real Estate Costs	<u>\$89,500</u>
Call	\$90,000

Channel Improvements

Lands

Permanent Easements	\$16,800
Temporary Easements	<u>16,700</u>
	\$33,500
Contingency - 20% of Above	<u>6,700</u>
Sub Total	\$40,200
Acquisition Costs	27,000
Relocation Assistance Costs	1,800
Total Estimated Real Estate Costs	<u>\$69,000</u>
Three-Mile Swamp	\$ 90,000
Channel Improvements	<u>69,000</u>
Total Estimated Project Real Estate Costs	<u>\$159,000</u>

